

ACCESSIBILITY IS
FREEDOM



2022 CITY OF EVANSTON ADA TRANSITION PLAN



City of
Evanston

Accessibility is Freedom

Table of Contents

Executive Summary	2
Chapter 1: Introduction	5
1.1 Organization of the Plan	6
1.2 Background of the ADA	8
1.3 Legislative ADA Mandates	10
1.4 City of Evanston ADA History	13
Chapter 2: Culture of Accessibility	14
2.1 City of Evanston Staff Involvement	15
2.2 Public Engagement and Input	16
Chapter 3: Self-Evaluation	18
3.1 Programs, Services, and Activities	19
3.2 Parks and Facilities	23
3.3 Public Right-of-Way	29
Chapter 4: Recommendations	32
4.1 Programs, Services, and Activities	33
4.2 Parks and Facilities	41
4.3 Public Right-of-Way	43
4.4 Schedule and Budget	43
Chapter 5: Implementation	44
5.1 Prioritization Process	45
5.2 Implementation Schedule	48
5.3 Official Responsible for Implementation	50
5.4 Annual Update Process	51
Appendices	53
Appendix 1 - Summary of Input from Public Online Surveys	54
Appendix 2 - Website Review Report	101
Appendix 3 - List of Facilities	156
Appendix 4 - Facility Assessment Reports	160
Appendix 5 - PSA Checklist	571
Appendix 6 - PSA Reviews	581
Appendix 7 - Glossary	586
Appendix 8 - List Of Prioritized Facilities	592

Executive Summary

GOAL STATEMENT

This Americans with Disabilities Act (ADA) Transition Plan is intended to guide the City of Evanston (City) in implementing and advancing a culture of inclusivity for all residents regardless of their ability. This Transition Plan (Plan) will draw from the City's existing mission of "promoting the highest quality of life for all residents by providing fiscally sound, responsive municipal services and delivering those services equitably, professionally, and with the highest degree of integrity."¹ By undertaking this Transition Plan process, the City will remove barriers which will maximize the talents and contributions of all residents in order to fulfill the City's vision of "creating the most livable city in America."²

The Plan will focus on providing access to City programs, services, and activities (PSAs), parks and facilities to persons with disabilities. By removing potential barriers to such City services, it will be easier for residents with disabilities to participate in the City's cultural and economic growth. As such, the Plan's goal is to establish a City-wide culture of accessibility, which will place ADA access at the forefront of City planning, construction, and policy-making efforts.

PROJECT OVERVIEW

The Transition Plan was developed over an approximately 14-month period which began in July 2021 and continued into September 2022. During that time, Altura worked in conjunction with City staff along with Avid Consulting, Inc. (Avid), McGuire Igleski & Associates, Inc. (MIA), and All Together. Altura is based in Austin, Texas and served as the lead consultant providing project management and accessibility consulting services. Avid, an architectural engineering firm based in Evanston, was part of the facilities inspection team and assisted with the development of the ADA rights-of-way (ROW) program. MIA, an architectural firm based in Evanston, participated in the assessment of the City's historic facilities. All Together is a public engagement

¹ www.cityofevanston.org/government

² www.cityofevanston.org/government

firm based in Evanston that developed a plan to include stakeholder participation through public meetings, open houses, and online surveys.

Approximately 1,400 existing PSAs were collected through interviews and feedback from eight City departments. The Plan includes a sample of specific recommendations for modification of PSAs based on detailed analysis by Altura. For more information see Chapter 4.1: Programs, Services, and Activities.

In September and October 2021, 119 City-owned facilities were evaluated for architectural barriers using the 2010 Standards for Accessible Design and the Americans with Disabilities Act Accessibility Guidelines. Inspection reports were developed for each facility that include items such as identification of barriers, recommendations for remediation, and actions for the recommended remediation. It is recommended that the City of Evanston schedule expenditures over the next 15 years to achieve program access while addressing the identified parks and facilities.

Program access as defined in the ADA: “A public entity’s services, programs, or activities, when viewed in their entirety, must be readily accessible to and usable by individuals with disabilities.”³ In essence, not every facility that contains barriers must be altered in order for the City to meet ADA requirements; the City can move or duplicate programs from facilities with barriers to barrier-free facilities. In situations where physical barriers will need to be addressed, the City should implement temporary solutions until a permanent alteration is made. For more information, see Chapter 4: Recommendations.

The City is implementing an innovative approach to ADA compliance within the public right-of-way (ROW). Instead of spending resources on field inspections of the entire infrastructure in the ROW network, this Plan presents an alternative approach to reaching programs specific to the ROW. This approach will allow the City to continuously perform a self-evaluation of the infrastructure within the ROW and progressively move towards program access compliance. Details are found in Section 3.3: Public Right-of-Way.

³ 28 CFR Part 35.150 www.ada.gov/regs2010/titleII_2010/titleII_2010_regulations.htm#subpartd

SUMMARY OF RECOMMENDATIONS

The Plan provides recommendations to facilitate the City in complying with ADA Title II requirements. The detailed recommendations can be found in Chapter 4. The following actions are the five recommendations that the City can take to have an immediate impact of ADA compliance:

1. Appoint a full-time ADA Coordinator
2. Formalize an ADA Departmental ADA Liaison system
3. Create an ADA Advisory Group, Task Force, or Commission to meet regularly with the ADA Coordinator
4. Have the ADA Advisory Group review the annual City budget to address the recommendations of the Plan
5. Create a system to track ADA requests from residents and track the progress of the request

An ADA Transition Plan is a living document that can be modified over time based on the City's priorities and available resources. The Plan should serve as the starting point and outline for the City to remove identified architectural barriers to achieve program access. The Plan may be modified to reflect the community's evolving needs and, as funding and other resources become available, to assist in the implementation of the Plan.

The City's Plan can be adjusted via an Annual Update Report that the City will produce starting one year from the Plan's adoption. The Annual Update Report will capture the City's efforts in reaching program access such as the number of facilities altered to remove barriers as well as programs and services created to provide added accessibility to residents and staff. Based on the availability of resources, the City will report that the Plan is on schedule or can adjust the expected timeline for completion.

CHAPTER 1: INTRODUCTION

The ADA is a civil rights law that mandates equal opportunity for individuals with disabilities. The ADA prohibits discrimination in providing access to participation in activities such as jobs, public accommodations, government services, the built environment, public transportation, and communications. The City has undertaken a self-evaluation of its PSAs and built environment to determine the extent to which individuals may face barriers to access.

The Plan describes the process developed to complete the evaluation of the City's PSAs, parks and facilities, and it will guide the implementation of necessary modifications in the future. By adopting the Plan, the City takes another step in its ongoing commitment to, and history of, access and inclusion for all people living in, working in, and visiting the City.

What is to Come:

- 1.1 Organization of the Plan
- 1.2 Background of the ADA
- 1.3 Legislative ADA Mandates
- 1.4 City of Evanston ADA History



1.1 Organization of the Plan

The Plan is organized to provide some of the history and background of the City's approach to accessibility, explain the process used in the self-evaluations, and explain how information from the self-evaluations, staff interviews, and public input was utilized in the development of the Plan itself. The chapters are:

CHAPTER 1: INTRODUCTION

This chapter discusses why the City undertook the creation of the Plan. While there are federal legal requirements, more importantly the City seeks to ensure equal access to all individuals regardless of disability. In that spirit, the chapter outlines the federal requirements to demonstrate how the City's goals align with providing access and inclusivity.

CHAPTER 2: CULTURE OF ACCESSIBILITY

This chapter discusses the City's commitment to a culture of accessibility throughout the organization. The City has a rich history of addressing accessibility concerns in the community. The impact of ADA accessible culture benefits both current and future generations as facilities are designed to be accessible to all and programs are provided without barriers to participation. This chapter includes samples of responses to questions about accessibility gathered from City staff and the public.

CHAPTER 3: SELF-EVALUATION

This chapter presents the self-evaluation process for PSAs, including website and communications, and for the parks and facilities, which included a cooperative methodology between City staff and Altura. The process relied heavily on designated ADA Liaisons from City departments to provide accessibility related information specific to each department. The findings of the self-evaluations will be presented and discussed.

CHAPTER 4: RECOMMENDATIONS

This chapter will provide recommendations for addressing the findings of the self-evaluations, including PSAs, the City's website, parks, facilities, and approach to the public right-of-way. It includes recommendations and a recommended timeframe to achieve program accessibility.

CHAPTER 5: IMPLEMENTATION

This chapter discusses the implementation process for achieving program accessibility. The federal mandates for implementation are covered and customized for the City and recommended processes are presented. Some of the implementation processes will apply at a City-wide level while others will be department specific.



All People Are Welcome plaque in Civic Center

1.2 Background of the ADA

The ADA is a civil rights law, enacted on July 26, 1990, that broadly prohibits discrimination on the basis of disability. “Disability means, with respect to an individual:

- (i) A physical or mental impairment that substantially limits one or more of the major life activities of such individual;
- (ii) A record of such an impairment; or
- (iii) Being regarded as having such an impairment...”⁴

The ADA mandates that the above definition “be construed broadly in favor of expansive coverage, to the maximum extent permitted by the terms of the ADA.”⁵ Based on that broad construction, the ADA protects individuals from discrimination based on disability whether the individual currently has a disability; does not currently have a disability but did at one time; never had a disability but is perceived as having a disability; or never had a disability but is related to, or otherwise associated with, an individual who has a disability.

The ADA ensures equal opportunity for all individuals with disabilities in the areas of employment, state and local government services, public accommodations, and telecommunications, as outlined in the five titles of the legislation:

- Title I: Employment – Prohibits employment discrimination against otherwise qualified individuals with disabilities.
- Title II: State and Local Governments – Prohibits discrimination in accessing services provided by state and local government entities, including transportation. Services may include employment to the extent not already covered by Title I.
- Title III: Public Accommodations – Prohibits discrimination in places of public accommodation, commercial facilities, and transportation.
- Title IV: Telecommunications – Mandates that telecommunication devices be placed for persons with hearing or speech impairments.
- Title V: Miscellaneous

⁴ 28 CFR Part 35.108(a)(1) www.ada.gov/regs2010/titleII_2010/titleII_2010_regulations.htm#a35108

⁵ 42 U.S.S. 12132 www.ada.gov/pubs/adastatute08.htm#12132

Title II of the ADA, which specifically addresses state and local governments, protects qualified individuals with disabilities because of their disability from being “excluded from participation in or ... denied the benefits of services, programs or activities of a public entity, or be subjected to discrimination by any such entity.”⁶ Title II regulations, which include the requirement for the creation of an ADA Transition Plan, went into effect on July 26, 1991. The transition plan requirement had a completion deadline of July 26, 1992. Title II regulations were further revised on March 5, 2011, with compliance required by March 15, 2012, and again on October 11, 2016.

In accordance with the ADA, state and local government agencies with 50 or more employees are obligated to conduct a self-evaluation of their facilities, PSAs, and policies and procedures. Entities then must create a Transition Plan to address those barriers identified in the assessment by providing suggested remedies, timeframes for which to eliminate any identified barriers, and the official responsible for implementing the Plan. An ADA Transition Plan is a document that guides government entities’ transition towards compliance with the ADA in a set timeframe. Importantly, although the ADA requires that facilities, PSAs, and policies and procedures be accessible in the most integrated manner possible, it does not require that agencies make structural changes to existing facilities if compliance can be achieved by alternative means.

While this Plan is intended to meet all technical requirements, it also utilizes a large geographic information system (GIS) component to capture existing site conditions and perform more complex analysis of the data. The findings documented in the Plan can also be used as an asset management tool to identify and plan for alterations of existing infrastructure in addition to coordinating the PSAs provided by the City.

⁶ 28 CFR Part 35.130(a) www.ada.gov/regs2010/titleII-2010/titleII_2010_regulations.htm#a35130

1.3 Legislative ADA Mandates

As previously mentioned, Title II of the ADA prohibits discrimination by public entities on the basis of disability by requiring that PSAs and the facilities that house them be accessible to persons with disabilities. To accomplish this, the Department of Justice developed regulations requiring government agencies to self-evaluate its PSAs to identify barriers to accessibility. The City is obligated to remove physical barriers to accessibility when program changes cannot ensure access to PSAs in existing facilities. The ADA requirements apply even when a City-owned facility is leased to a third-party concessionaire or provider of a PSA.

Title II regulations were amended on March 15, 2012, and those amended requirements can be found in Part 35 of Title 28 of the Code of Federal Regulations (CFR). Highlights of the Title II requirements applicable to the City as part of the scope of work for the Plan include, but are not limited to:

- Part 35.105 Self-evaluation
- Part 35.106 Notice
- Part 35.107 Designation of responsible employee and adoption of grievance procedures
- Part 35.130 General prohibitions against discrimination
- Part 35.133 Maintenance of accessible features
- Part 35.149 Discrimination prohibited
- Part 35.150 Existing facilities
- Part 35.151 New construction and alterations
- Part 35.163 Information and signage

With the understanding that the structural changes to facilities would take time and funding, the regulations allow for the creation of a Transition Plan to implement the changes over time. The ADA regulations provide that if a public entity that employs 50 or more persons plans to make structural changes to facilities in order to achieve program accessibility, it must develop a Transition Plan setting forth the steps necessary to complete such changes.

The Transition Plan must, at a minimum, contain the following:

- Identify and list physical barriers in the public entity's facilities that limit the accessibility of its programs or activities for individuals with disabilities;
- Describe in detail the methods that will be used to remove the barriers and make the facilities accessible;
- Provide a schedule to achieve compliance with Title II, with annual updates on the progress of the Plan; and
- Identify the official responsible for implementation of the plan.⁷

ADA TITLE II PROGRAM ACCESS

Title II provides guidance on how a government entity such as the City can achieve compliance. A public entity is required to provide each PSA in a manner that, "when viewed in its entirety, is readily accessible to and usable by individuals with disabilities."⁸ The key phrase is "when viewed in its entirety." In other words, not every single service or facility must be made accessible. Instead, the overall network of services and facilities must be made accessible. While a more detailed discussion is provided in Section 3.1, anything that the City provides to the public or to internal staff is considered a PSA. Examples include the ability to pay bills online and at physical locations, trash pick-up, employment opportunities, police and fire services, and transit services.

Title II does not require a public entity to make each of its existing facilities accessible, take any action that would threaten or destroy the historic significance of a property, or take any action that would result in a fundamental alteration to the nature of the PSA or cause undue financial and administrative burdens. The regulations provide further guidance on the process for determining undue financial and administrative burdens:

"In those circumstances where personnel of the public entity believe that the proposed action would fundamentally alter the service, program, or activity or would result in undue

⁷ 28 CFR Part 35.150(d)(3) www.ada.gov/regs2010/titleII_2010/titleII_2010_regulations.htm#a35150

⁸ 28 CFR Part 35.150(a) www.ada.gov/regs2010/titleII_2010/titleII_2010_regulations.htm#a35150

financial and administrative burdens, a public entity has the burden of proving that compliance with §35.150(a) of this part would result in such alteration or burdens. The decision that compliance would result in such alteration or burdens must be made by the head of a public entity or his or her designee after considering all resources available for use in the funding and operation of the service, program, or activity, and must be accompanied by a written statement of the reasons for reaching that conclusion.”⁹

Altura will apply a program access test to the PSAs offered by the City in conjunction with the facility self-evaluations when developing recommendations. Briefly, the program access test analyzes the PSAs offered at a facility and looks for access and compliance in the context of the overall system. The recommendations in this Plan will be aimed at satisfying the program access test. This includes using WCAG 2.0 Level AA Standards to identify barriers to services for people with disabilities within digital media such as the City’s website and social media platforms.

The City provides a broad array of PSAs at various physical locations and via virtual means. The Plan provides recommendations for improving existing PSAs, relocating PSAs to accessible physical locations, or making alterations to the facilities where the PSAs are provided. The self-assessment process and recommendations are outlined later in this Transition Plan Update.



Lighthouse Wildflower Trail Garden

⁹ 28 CFR Part 35.150(a) www.ada.gov/regs2010/titleII_2010/titleII_2010_regulations.htm#35150

1.4 City of Evanston ADA History

An important aspect to keep in mind when discussing accessibility is that it is, at its core, a civil rights issue. The City should be commended for its commitment to social justice, as evidenced by the creation of the Equity and Empowerment Commission in 2017 and their goal to eradicate inequalities across City services. Representation and inclusivity in all areas of society will lead to positive outcomes for all residents.

In 2012, the City created an ADA Transition Plan, which the City has elected to update. As a result of the 2012 process, an ordinance forming an ADA Advisory Board was adopted, but that ordinance was repealed, and the Board was rolled into the Equity and Empowerment Commission upon its inception in 2017.

In this current Transition Plan process, Altura has been assisted by an ADA Advisory Group made up of disability rights advocates from across the community. Their insight has been invaluable and has underscored the importance of this effort.



Painting from the Fleetwood-Jourdain Community Center

CHAPTER 2: CULTURE OF ACCESSIBILITY

While the ADA regulations have been in place since 1991, the impact of true ADA compliance is often seen as a series of boxes to check in a long list of federal mandates. There are requirements for items such as hiring practices, communications policies, access to facilities, and transportation services. However, it is often overlooked that the ADA helps provide freedom and access to all people. The City has made a commitment to a culture of accessibility throughout the organization. The goal of this culture is to reframe its approach to the ADA from just meeting the minimum technical requirements to extending opportunity to all individuals, helping to ensure equal access to the City residents and visitors regardless of ability or disability.

In order to support this culture within the City, the Plan recommends that this accessibility mindset be implemented at all levels of City government. This degree of implementation is crucial to engraining the desired accessibility mindset in the everyday workflow of the City.

What is to Come:

- 2.1 City of Evanston Staff Involvement
- 2.2 Public Engagement and Input



2.1 City of Evanston Staff Involvement

Various department heads and designated liaisons helped to facilitate the Plan process by participating in interviews and providing materials relevant to PSAs to be reviewed. Participating City staff should be commended for their commitment to the process, giving graciously their time and expertise. Staff interviews established a base-line institutional knowledge of the ADA, and they provided insight into how each department operates and administers ADA responsibilities.

A common theme among staff is that there are no set policies in place regarding accessibility, but that accommodations are made on a case-by-case basis. All staff expressed a willingness to do whatever it took to find a solution, even if they did not know what the process would be. One interviewee said the process had been “eye-opening,” and several mentioned a hope that this effort would raise awareness of accessibility for all staff.

City staff have also implemented several initiatives that further demonstrate a commitment to providing ADA-related services to all residents. Examples include the Parks and Recreation Department providing a variety of programs dedicated to people with special needs noting that these “programs emphasize individual development in a wide range of leisure areas including sports, culture, social, after-school and special events” such as Flag Football, Floor Hockey and Volleyball, as well as their involvement in the Special Olympics.

2.2 Public Engagement and Input

PUBLIC ENGAGEMENT EFFORTS FOR DEVELOPMENT OF THE ADA TRANSITION PLAN

Public engagement is critical to obtaining the community's input and for the ultimate adoption of the Plan, as well as to meet the federal requirement that stakeholders be included in the process. Altura and All Together developed an outreach strategy to obtain feedback on prioritizing facilities and elements within those facilities, prioritizing PSAs, and for assistance in identifying opportunities to improve existing policies. This strategy made use of social media, City and partner organization's newsletters, and posters displayed in major parks, facilities, and recreational areas to drive engagement. Local partner organizations included:

- Center for Independent Futures
- Evanston CASE
- AccessibleNU
- Open Communities
- Evanston Chamber of Commerce
- Evanston Public Library
- The McGaw YMCA
- Evanston Latinos

Several avenues were created for the public to provide input and interact with City staff during the process including two open houses and the posting of online surveys. The results of the public input process helped to determine which types of facilities and elements to prioritize.

OPEN HOUSE EVENTS

To support the open house events, hardcopy and electronic flyers were created and distributed to community stakeholders. The first open house was held on November 18th, 2021, at the Levy Senior Center located at 300 Dodge Avenue. Due to the ongoing Covid-19 pandemic, attendance was limited. However, those that did attend were eager to participate. The second open house was held virtually on August 11, 2022. An update on the Plan was provided as well

as an overview of the 85% Draft Plan. Public input was welcomed and provided via the on-line posting of the 85% Draft for public review. Comments were made by the public and incorporated into this Transition Plan Update.

Attendees of the open houses cited accessible routes and sidewalks as the most important elements to address. Community centers and parks ranked highest for facilities, noting “all people need to recreate and be able to use facilities while there” and “everyone wants to get outside.” Comments were also made about consulting with people with disabilities in efforts to address diversity and inclusivity, such as ensuring representation on boards and commissions.

ONLINE SURVEY

Digital and hardcopy flyers directed stakeholders to a website where they were able to access the online survey. The online survey was provided in both English and Spanish, and it generated a total of 165 responses. The public was asked to provide information on the programs and services that they use, the types of facilities they frequent, and the elements within facilities that they use the most. These responses helped identify the needs and wishes of the community. A summary of the input received from the survey is found in Appendix 1.

When asked about infrastructure, the public right-of-way was overwhelmingly selected as needing the most attention. When given the opportunity to write in responses, the majority of respondents mentioned sidewalks either in disrepair or totally absent from certain areas of the City. One respondent said, “I use the sidewalks when they are available. As long as there are parts of the city without sidewalks, you are failing me.” However, many also expressed excitement about the Transition Plan processes and felt encouraged that the City is addressing accessibility concerns.

As part of public input, three specific recommendations were added to the Plan. One recommendation is for the City to create an ADA Advisory Group. A second as for the group to review the City’s annual budget to address the Plan’s recommendations, and the third was to create a tracking system for resident requests. Chapter 4 details the recommendations and Chapter 5 discusses implementation of the recommendations.

CHAPTER 3: SELF-EVALUATION

As required by the ADA, the City must conduct a self-evaluation of City-owned facilities, PSAs, and policies and procedures. While PSAs are what the City provides, policies and procedures outline how the PSAs are to be provided. The self-evaluation process for PSAs and policies and procedures included in-person interviews with staff and collection of information from City departments. Eight departments provided lists of PSAs for analysis, though it is understood that those lists are in no way exhaustive, but rather represent a sample of PSAs provided by the City at the time of this Transition Plan process.

The self-evaluation process for facilities involved the development of a GIS database, the development of an inspection computer application, coordination with City staff to provide access to the facilities, and physical inspection of the facilities. Development of the GIS application was conducted with City staff approval to allow for integration of the data into existing City GIS systems. The inspection data will be integrated into City software which will allow the City to track the recommended facility alterations as part of the existing project management tool. The Plan presents the findings of the 119 facilities inspected.

What is to Come:

- 3.1 Programs, Services, and Activities
- 3.2 Facilities
- 3.3 Public Right-of-Way (ROW)



3.1 Programs, Services, and Activities

PSAs as they pertain to the ADA are activities, events, and actions undertaken by a Title II entity, such as the City, in the regular course of business. These PSAs can be provided to both the public as well as internally to staff.

Examples of PSAs include, but are not limited to:

- Conducting meetings such as City Council Meetings
- Administering programs such as the Citizen's Police Academy
- Providing housing programs
- Communications with residents, including digital communications
- Providing employee benefits
- Collecting public input for items such as Infrastructure Improvement Programs
- Providing streets, sidewalks, and curb ramps
- Permitting for construction projects
- Collecting trash and recycling
- Providing utilities and the many options for the public to pay utility bills
- Law enforcement

FINDINGS

The City provides a broad spectrum of PSAs that support the City's mission of delivering quality public services and promoting the safety, health, and quality of life of its citizens. A total of 1403 PSAs were provided by department staff to Altura which represents a snapshot in time as of October 2021. It is understood that PSAs are constantly changing as outdated programs are no longer provided, existing PSAs are modified to meet current needs, and new programs are added.

In general, the City provides PSAs with accessibility as a consideration. Staff appear to have a strong desire to accommodate people with disabilities, frequently stating that accommodations are made "on a case-by-case" basis. However, as with most government

agencies, there are opportunities for the City to improve accessibility in its PSAs. Altura identified several elements to verify to ensure ADA compliance, such as ensure meetings are held in facilities that meet ADA standards for accessibility.

The recommended modifications to PSAs, detailed in Section 4.1, will help ensure that the City's PSAs are provided without barriers to people with disabilities. These modifications vary from requesting that City staff verify that certain components are in-place to providing a specific ADA requirement.

CITY WEBSITE

The City of Evanston website is large and robust. It is built with the govAccess content management system and employs a variety of technologies for content delivery. A list of 35 webpages and 15 PDFs were submitted by the City for this accessibility audit.

The goal of the audit was to identify non-compliant Web Content Accessibility Guidelines (WCAG) issues and to ensure the audited webpages and PDF meet the WCAG 2.1 AA compliance standards. While presenting information online has a great potential for inclusion of people with disabilities, it equally has the same potential for their exclusion if care is not taken to ensure that electronic systems and documents are designed to be accessible

This WCAG audit will help the City of Evanston team see and understand where there are accessibility issues across the City of Evanston website. The recommendations, presented in Section 4.1, can assist prioritization of next steps to improve ADA compliance and enhance accessibility and inclusion for people with disabilities.

EVALUATION METHOD

To ensure a comprehensive accessibility audit, the team performed both automated and manual evaluations, as well as testing by persons with visual impairments using screen reader technology. Automated accessibility tools can evaluate the technical adherence of a website, web application, or digital asset such as a PDF document, but this technical evaluation can only catch between 30% to 40% of accessibility errors. The other 60% of errors are comprised of issues that are simply beyond the ability of the auditing packages. To ensure the audit was more than

just a technical evaluation, the team used assistive technology natives (people with disabilities) and experienced auditors to manually evaluate the navigational design, complex interactions, and overall perception and usability of the digital properties.

TECHNICAL STANDARD

The WCAG guidelines have 3 levels of conformance: A, AA, and AAA. Each level is progressively more difficult to achieve, but also more accessible. The 25 success criteria at Level A are the most fundamental to accessibility. Level AA extends level A and is recognized by many Federal and state laws as the minimum level of compliance. The team used the Web Content Accessibility Guidelines 2.1 Level AA standard.

WEBPAGE AUDIT FINDINGS

This is an overview of some of the webpage audit findings. A comprehensive review of the issues can be found in *WCAG 2.1 Report* and *Complex Interactions and Best Practice Report* in Appendix 2. The absence of critical errors found shows a significant effort by the City to provide accessible online content.

In general, we found the City's website to have minimal critical errors with some elements that should be corrected to facilitate the navigation and use of the website. For example, outdated code for the sub-navigation menu requires users to go through more than 55 links and other interactive objects before they can access features of the site.

Another example is design defects exist when fonts are too small or too thin, or colors do not meet contrast requirements. This information may be difficult to perceive, especially for low-vision users. This type of design can be easily corrected.

It is recommended that the City take a phased approach to correcting the items listed in the website report of findings in Appendix 2. See Section 4.1 for more details.

PDF AUDIT FINDINGS

An important element of the website analysis is the City's posting of PDF files. This is an overview of some of the PDF audit findings. A comprehensive review of the issues can be found in City of Evanston PDF Accessibility Audit in Appendix 2.

There were 15 PDFs (32 pages total) submitted and reviewed. In general, the reviewed PDF files had some type of accessibility error. It appears that each department and staff are allowed to post PDF files to their corresponding webpage. However, this creates a situation where the website contains information at varying degrees of compliance. We observed areas where the City had made great effort to meet WCAG requirements only to have someone post a non-compliant PDF and lower the page's overall compliance level. It is recommended that the City create a process that helps ensure that posted PDF files meet WCAG requirements. See Section 4.1 for more details.

COMMUNICATIONS PLAN

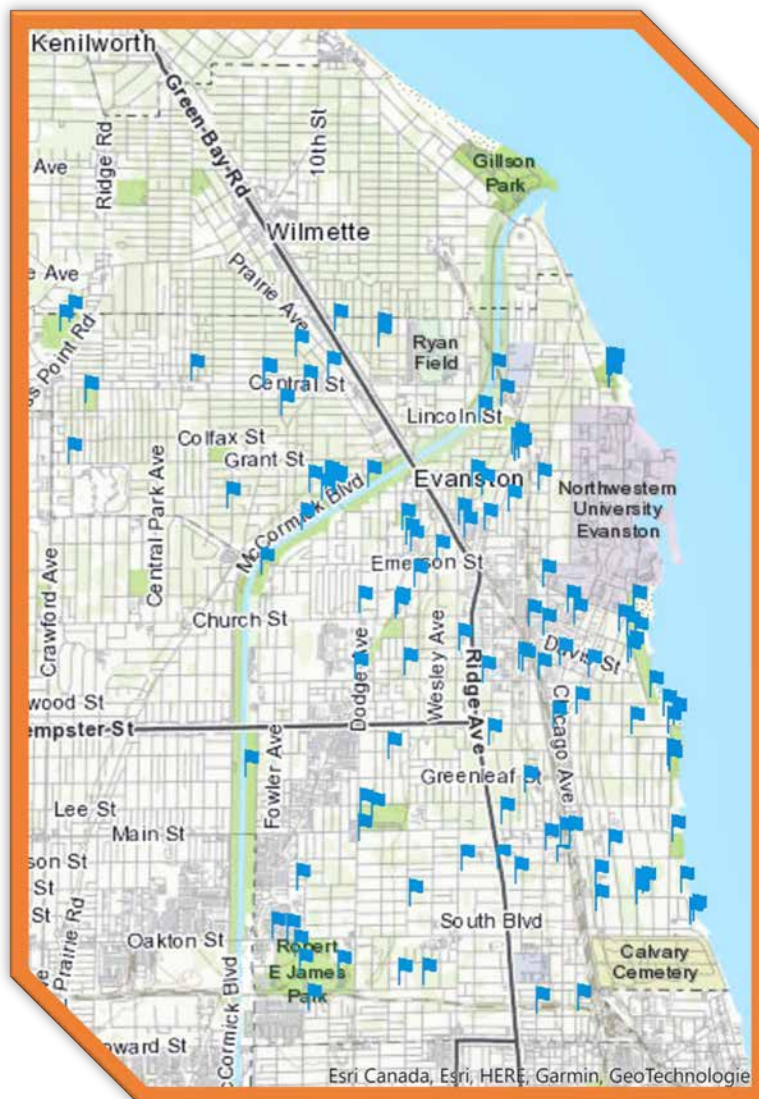
There is a pattern in the communication elements that have been reviewed to date. In general, departments develop their own content and distribute it via various platforms such as mailouts, website postings, meeting notices, and video. From an accessibility perspective, the existing communications processes lack a centralized method to ensure ADA compliance. Several elements such as website postings, downloadable PDF files, and videos were identified to be a barrier to people with disabilities. It is recommended that a City-wide communications process and a governance structure be developed to facilitate accessible communication.



Sign posted at the Civic Center

3.2 Parks and Facilities

As part of the Plan, a self-evaluation survey of 119 City-owned parks and facilities was performed over a two-month period from September 2021 through October 2021. The map below indicates the location of all park facilities included in the self-evaluation. A full list of parks and facilities is provided in Appendix 3.



Map showing locations of parks and facilities inspected

TECHNICAL STANDARDS

There were two different technical accessibility standards used based on the date of construction. The 2010 Standards for Accessible Design (2010 Standards) were applied to facilities that were constructed or renovated after March 15, 2012, and the Americans with Disabilities Act Accessibility Guidelines (ADAAG) were applied to facilities that were constructed or renovated between 1991 and March 2012. Technical accessibility standards refer to different types of architectural elements and how to make them compliant, for example, how much knee space is required at a lavatory.

The federal accessibility technical design standards changed on March 15, 2012, when the 2010 Standards took effect. Facilities constructed or permitted before the effective date should have complied with the previous standards, the ADAAG. Facilities constructed, altered, or permitted after the effective date must comply with 2010 Standards. Elements that were constructed before the effective date are safe harbored from compliance with the new standards if the constructed elements fully complied with the ADAAG at the time of construction. If those elements did not comply with the ADAAG, those elements must now comply with the 2010 Standards. Facilities that pre-dated the ADA standards and were constructed prior to 1991 are not granted safe harbor and must comply with current ADA requirements.

Several elements that were not previously scoped in the ADAAG now have technical requirements within the 2010 Standards. Those elements are not safe harbored by the ADA and must comply with the latest standards. Example elements that are not safe harbored include dwelling units and recreation facilities such as playscapes/play areas, pools, amusement rides, boating facilities, fishing piers, golf and miniature golf courses, and exercise equipment. Where dates of construction and alterations of the facilities could not be determined, the 2010 Standards were used as the technical standard for those facilities.

SELF-EVALUATION AND FIELD SURVEY METHOD

On-site assessments were coordinated with City staff. Altura provided the City Project Manager with a schedule of facilities to be inspected who then notified onsite staff to ensure that facility access would be available. A City staff member also accompanied the Altura Team during some assessments to help navigate and ensure access throughout.

An Altura field team of between 2-5 people was assigned to each facility in the project scope. The team included accessibility staff deeply knowledgeable with the 2010 Standards and experienced GIS data collection technicians. All members of the team had architectural, engineering, or GIS backgrounds. The team used tape measures and digital levels as measurement tools and an iPad to collect the data. GIS protocols were established and finalized with City input, then the data was collected via a GIS collector application. The field team identified noncompliant elements that are architectural barriers at each facility to produce a report listing the noncompliant elements, element priority per violation, and associated recommendations for compliance.

A GIS layer was produced that maps the identified architectural barriers found in the facility self-evaluations. The database is non-proprietary and can be implemented into the City's existing GIS infrastructure, as well as the City's project management software, *Cityworks*. The information contained in the hardcopy reports is also available on the GIS map and within the GIS database.

SELF-EVALUATION REPORT METHODOLOGY

The reports contain information as outlined in this section and will assist in describing the proposed solution to the identified barrier. It should be known, however, that there is typically more than one option to address barriers. The final decision will be taken by the City, or the design professional tasked with developing the construction documents.

PHOTOGRAPHS

A photograph of the individual barrier is typically provided. The photo is intended to demonstrate the element that is not in compliance with the standards and the element's location

within its immediate surroundings. One photo per element was included in the report. The photo does not always provide all the information to understand the complete issue, so all aspects of the barrier's row within the report should be consulted to understand the depth of the element.

GIS ID

An individual GIS ID number is provided for each element. This number will remain unique for the specific element throughout the entire self-evaluation process. This number is tied to the GIS database and can be used to access the point in the database where additional information can be found.

REPORT ID

Each element will have a unique number per facility report. The number will start at 1 for each facility and will only be unique within the facility. This number will not be present in the GIS database and is only provided for navigating each facility report. A single number may be provided to an element with multiple code sections of noncompliance, where the recommended action will resolve multiple barriers.

LOCATIONS

Each element will have a general description of its location. Although the location is also available in the GIS map and database, a specific location will be provided in the report. Location descriptions can include interior versus exterior, the floor, list a specific room title if posted or if room identification was provided by City staff, or may be more generic such as "Men's Restroom."

ELEMENT AND CODE REFERENCE

Each element will list a physical barrier such as “ramp,” “drinking fountain”, or “door”. Each element will identify at least one specific 2010 Standards or ADAAG code section that makes the element a barrier. The code will include headings from the scoping section and the technical section of the standards. Code heading examples are “208.2.4 Van Parking Spaces” and “403.3 Slope.” In some instances, there could be more than one code for the specific violation. Some elements are in noncompliance of more than one code section.

BARRIER

Each barrier will be defined with a brief explanation of why it is noncompliant. Examples of barriers include “Reach range, not between 15 and 48 inches” and “Walking Surface-Running slope greater than 1:20”. There are some instances where the element has more than one violation. In those situations, “Multiple Barriers” will be noted.

RECOMMENDED ACTION

The proposed recommended actions present one possible solution to address the noncompliant element and should be used for planning purposes. Some of the recommended actions for barrier removal are generic in nature and may involve additional steps to achieve accessibility compliance. The recommended actions should not be interpreted as the only means to achieve compliance nor as a substitute for construction documents. In situations where the recommended action required more complex solutions such as moving walls or plumbing, compliance with other applicable codes was not considered. In the case of multiple barriers, the recommended action would be to replace the entire element or provide a new accessible one.

A licensed professional designer should be consulted to develop the final solution for each identified barrier and should develop the required construction documents to ensure compliance with all applicable code requirements.

PRIORITY

Each element will have an associated priority level which comes directly from the priority matrix established after following ADA recommendations, reviewing staff comments, and incorporating stakeholder feedback. The priority levels will reflect the importance of addressing the elements within the facility. In instances where the City decides to address specific barriers within the facility and not the entire facility, the prioritization of each element can be used as a guide to address each barrier.

FINDINGS

The findings of barriers at facilities show a pattern based on the age of the facility and any associated alterations. In general, facilities constructed before 1990 tend to have more noncompliant elements. As alterations occurred in these facilities, those specific elements were typically brought into compliance, while elements that have not been altered remain noncompliant.

Facilities constructed and/or altered after 1994 tend to be more compliant than facilities constructed earlier, however, there are still noncompliant elements. Some barriers can be attributed to smaller alterations that were likely performed without consultation with a design professional. For example, fixed elements such as AED cabinets or flat-screen televisions become protruding objects which are barriers for people with visual disabilities.

The identified barriers represent any findings that are not in compliance with the technical elements of the ADA standards. However, some of the identified barriers may not be a violation of the ADA. For example, the ADA exempts certain elements within employee work areas from compliance. As Altura captured information, it is possible that an identified barrier is not an actual violation of the ADA based on use of the facility.

The information presented in this Plan is based only on the self-evaluations conducted by Altura. Conditions are subject to change as scheduled alterations progress and routine maintenance continues.

3.3 Public Right-of-Way

The City undertook a unique approach to the self-assessment of the infrastructure within the public right-of-way (ROW). Examples of infrastructure elements within the public ROW include, but are not limited to sidewalks, curb ramps, on-street parking, driveways, intersection crossings, and pedestrian pushbuttons. The goal of compliance in the ROW is to ensure that all new infrastructure is compliant with the latest ROW accessibility guidelines while addressing the older and assumed non-compliant infrastructure. The City recognizes that infrastructure that pre-dates the 2011 Public Rights-of-Way Accessibility Guidelines (PROWAG) is not likely to meet these guidelines, and so resources will not be used to verify the level of compliance of this infrastructure. Instead, the City will pursue a programmatic approach to compliance in the ROW.

The ROW Program consists of various components to assist the City in reaching ADA program access. The components include:

- Staff training
- Assessment of existing ordinances and standard details that impact the ROW
- Creation of a priority matrix for the ROW
- System for resident requests
- Dedication of annual funding to the ROW Program

Through a separate effort, the City developed the Sidewalk Improvement Program which closely matches this plan's recommendations. Furthermore, this plan recommends that the City implement the Sidewalk Improvement Program. The program should be implemented with the addition of continued staff training for PROWAG.

TECHNICAL STANDARDS

There is no adopted federal ADA standard for elements in the ROW. However, PROWAG is considered the best practice method to achieve compliance in the ROW. Government agencies such as the Federal Highway Administration consider PROWAG the standard of the practice and recommend that the guidelines be used to address areas not covered by the ADAAG. As such,

the City has been following this federal recommendation and using PROWAG as the guidelines to be followed for infrastructure in the public ROW.

ROW PROGRAM

The City's ROW Program will follow the Sidewalk Improvement Program in the effort to meet both the community's needs per the program and reach ADA program access. In terms of the ADA Transition Plan recommendations, the program consists of two phases. The first phase is to ensure that all new construction in the ROW is compliant with PROWAG or the latest ROW standards. Staff training will allow for consistent identification of compliant infrastructure through a plan review and inspection process. The second phase is to address existing infrastructure and bring those facilities into compliance with the ROW guidelines or standards. As projects are planned for existing infrastructure, staff will identify the elements that require modifications for compliance and those elements will be included in the project scope.

STAFF TRAINING

Altura provided City staff with extensive training specific to ADA compliance in the ROW. The training covered both the 2010 Standards for Accessible Design as well as PROWAG. Targeted staff included plan reviewers, engineers, planners, and inspectors. It is recommended that staff continue regular training as the PROWAG requirements are expected to evolve before their final adoption.



Sidewalk along Dempster Street

ASSESSMENT OF ORDINANCES AND STANDARD DETAILS

Relevant ordinances, standard details, and development mandates were reviewed to ensure that ADA compliance will be met for all new infrastructure in the ROW. The plan recommends the creation of a standard process where City staff review plans for PROWAG before construction begins and inspects the project before final acceptance. The plan review will include pedestrian elements covered in PROWAG and identify the needs for new sidewalk construction or the alteration of existing non-compliant elements. The construction process will include a specific review for ADA compliance of the pedestrian elements of the project before the final close-out of the project.

CREATION OF PRIORITY MATRIX

The City's Sidewalk Improvement Program has created a priority matrix in a process that accounts for various pedestrian generators and demographic data. The priorities align with the needs of the community and ADA compliance. Therefore, this plan recommends that the existing Sidewalk Improvement Plan's priorities be followed.

SYSTEM FOR RESIDENT REQUESTS

The City's Sidewalk Improvement Program allows the public to make requests for infrastructure improvements within the City's ROW. This plan recommends that the system for resident requests established by the City's program include the ability to make ADA specific sidewalk and curb ramp requests. Following the established 311 system, residents make improvement requests. These requests are scored within the priority matrix and help establish the City's project list.

DEDICATION OF ANNUAL FUNDING

Similar to dedicating funding to address barriers within facilities, an annual funding amount should be specifically dedicated to address elements within the ROW. The funding can coincide with the City's Sidewalk Program system of addressing sidewalk improvement and sidewalk gap construction funds.

CHAPTER 4: RECOMMENDATIONS

This Plan provides the recommendations for PSAs and for facility and right-of-way alterations which are aligned with achieving the City's goal of accessibility, inclusion, and equal access for all. The City's culture of going above and beyond extends to meeting accessibility requirements and should be commended.

The recommendations for PSAs are based on achieving program accessibility. As such, the goal of the recommendations is for the City to meet the ADA requirements while also meeting best practices for achieving accessibility compliance.

The recommendations for facilities are based on addressing all the identified barriers that we found in the self-evaluation and analysis of the 119 locations.

What is to Come:

- 4.1 Programs, Services, and Activities
- 4.2 Parks and Facilities
- 4.3 Public Right-of-Way
- 4.4 Budget and Schedule



4.1 Programs, Services, and Activities

Altura created a checklist that existing and new City PSAs can be compared against to help ensure ADA compliance. The checklist, available in Appendix 5, should be used as PSAs are being created or altered to cross-reference ADA compliance. While not all comments may apply to each PSA, the checklist will provide guidance on aspects to be considered when developing PSAs. The checklist elements were applied to the 1403 PSAs provided by City staff, and recommendations for modifications noted. Appendix 6 has the reviewed PSAs with recommendations.

The Plan's recommendation is to have City staff review each PSA for ADA compliance by using the checklist in conjunction with the details in this section. While the ADA does not place a priority on any specific type of PSA, there are minimum requirements that must be met for compliance. Those minimum requirements, along with best practices, are discussed in this section.



Ackerman Park

PROGRAM ACCESSIBILITY

After analyzing the information provided by City staff, we have identified facilities that have PSAs located within them. These facilities will be scored higher in the priority matrix as explained in Section 5.1. The ten parks or facilities with the highest number of PSAs are presented below in table 4.1.1.

Facility	Number of PSAs
Robert Crown Community Center	408
Chandler-Newberger	204
Levy Senior Center	186
Noyes Cultural Arts Center	50
Leahy Park	50
Dempster Launch Facility	47
Lovelace Park	43
Civic Center	32
Evanston Ecology Center	30
James Park	30

Table 4.1.1 Top Ten Facilities/Parks with most PSAs

As can be seen from the table above, recreational facilities and government centers host the most PSAs. The analysis includes recommendations for the possible moving of PSAs to different locations to improve accessibility to the community.

Looking at PSAs, it is recommended that a City-wide procedure for modifying policies, practices, and procedures be developed for PSA participation. The policy should comprise a process for requesting and reviewing program participation and circumstances for denial. This policy should also consist of a service animal policy for the public. To enhance program participation, Altura also recommends disability awareness training, specifically for staff interacting with the public.

PROVIDE PUBLIC NOTICE

All public entities must provide information to the public, program participants, program beneficiaries, applicants, and employees about the ADA and how it applies to the public entity. The City has accessibility information on its website, including the grievance procedure, but

Altura recommends adding a Notice of Compliance. This Notice of Compliance should include the provision of alternative formats and be included in other venues and outlets such as:

- Social media such as Twitter and Facebook
- City website, including the Community Relations Committee page
- Information panels at each facility
- Local newspapers
- Local radio and television stations public service announcements

Examples of Alternative Formats include:

- Captioned public service announcements on television
- Sign Language Interpreters
- Large print
- Recommended: sans-serif typeface, 18-point size
- If a request is made for a specific font size, provide notice in that size
- Braille
- Text file on a thumb drive or emailed to the person
- HTML format on an accessible website
- Audio recording
- Radio announcement

Include the Notice of Compliance in program announcements and applications.

The following are examples:

- Job announcements
- Program applications
- Board and commission meetings

EMERGENCY PREPAREDNESS AND EVACUATION

Making sure that people with disabilities have full access to the City emergency preparedness and response programs is a critical ADA obligation.

Emergency issues that have an impact on people with disabilities include:

- Notification – Many traditional emergency notification methods are not accessible to or usable by people with disabilities. People who are deaf or hard of hearing cannot hear radio, television, sirens, or other audible alerts. Those who are blind or have low vision may not be aware of visual cues such as flashing lights. Warning methods should be developed to ensure that all citizens have the information necessary to make sound decisions and take appropriate, responsible action.
- Evacuation – People with a mobility disability may need assistance leaving a building without a working elevator. People who are blind may not be able to use traditional orientation and navigation methods. A person who is deaf may be trapped and unable to communicate because the only communication device relies on voice. Procedures should be in place to ensure that people with disabilities can evacuate the physical area under different conditions.
- Emergency transportation – Accessible transportation may be needed to evacuate people with disabilities. Some communities have used lift-equipped school buses to evacuate people with mobility disabilities during floods. Of course, this would require significant coordination with local transit authorities or school districts. For example, bus drivers' job descriptions will need to include working during emergencies.
- Locations of accessible emergency shelters and other shelters with specific features – The public should be notified about the location of emergency shelters. Emergency personnel need lists of accessible locations, and information should be easily found on websites.
- Service animals – People with disabilities who use service animals should not be separated from their service animal, even if pets are not permitted. Service animals are the responsibility of their handlers, who must always keep them under control.

- Access to information – Communication must be accessible for all people, regardless of disability, and staff and volunteers should be trained in basic ways to provide accessible communication.

TRAINING

During the staff interview process, it was discovered that the City does not have an ongoing ADA training program. Nearly all staff expressed a desire for additional ADA training and were eager to learn more about how to best serve their residents. Training was provided to City staff on topics determined based on interest and need.

CITY WEBSITE

The following recommendations should be considered to address deficiencies in ADA compliance and enhance the usability of the City's information communications and technology (ICT) assets. The recommendations are based on the technical findings of the review of the City's use of digital media as well as a review of current City resources. (See Appendix 2 for technical guidance with web and PDF remediation.)

The recommendations are intended to provide a two-layered process to reach ICT accessibility. The first step is to create a strategy that is incorporated into the City's existing workflow to make digital accessibility a daily activity. This will include a review of existing processes and resources available to the City. The second step involves having staffing resources to ensure that the strategy is carried out as an on-going process.

The recommendations are detailed below:

- Define, create, and implement a strategy for systematically addressing accessibility across Evanston's ICT products and services. This will require a detailed analysis of:
 - The City's processes and programs involved in the use of digital media
 - The City's purchasing process for digital media
 - The City's departmental protocols for using digital media such as posting to the website
- Use of testing tools to identify and address accessibility gaps in ICT for programs and services.
 - Different tools are available to assist with ensuring that accessibility is provided

- Examples include web auditing tools, tools for PDF accessibility, and testing with assistive technology such as screen readers
- Acquire tools and resources needed to support staff efforts to include accessibility in the development of ICT for programs and services. Such tools and resources may include:
 - Web and PDF testing tools, checklists, and how-to videos for developers
 - Libraries of accessible web and PDF templates
 - Code libraries of accessible widgets
 - Color contrast analyzer tools
 - Scan tool for systematically auditing and tracking compliance and remediation of web resources
- Develop an exception process to track and document identified non-compliance issues. For example:
 - Listing a phone number to contact a staff member for assistance via phone
 - Creating a plan to remediate inaccessible documents and PDFs on the website
- Restore the Digital Services Specialist position or consulting service to oversee implementation of the proposed accessibility program.
 - The risk of not addressing accessibility is greater than the cost of obtaining the resources to manage the process
 - Consulting services are available to assist in developing a program within limited resources
 - Restore the Digital Services Specialist position to manage the on-going accessibility process

ACCESSIBILITY COMMUNICATIONS PLAN

The accessibility communications plan should be developed with approval from management and follow the City's overall communication practices. The elements of the recommended plan include:

- Appoint or hire an Accessibility Communications Coordinator to oversee communications accessibility compliance in the organization, chair the accessibility workgroup, identify gaps in compliance, and make recommendations for training and accessibility expenditures.
- Develop an Accessibility Policy that defines the governance structure and identifies the guidelines that the City will adhere to.
- Create a governance structure within the organization, sanctioned by executive leadership, to include an Accessibility Steering Committee.

- Develop procedures which insert accessibility into the communications business structure of the City.
- Identify key roles and specific training to support accessibility in each communications area.
- Develop an Electronic and Information Resources (EIR) Accessibility Policy to clearly govern the process for creating and distributing electronic information. This will include, but not be limited to website content, social media governance, video production requirements, and emergency preparedness communication.
- Develop a communications grievance procedure to address complaints or inquiries from the public. The procedure should include the process for removing or addressing noncompliant content.
- Invest in an automated tool to scan websites and documents on a regular schedule to track compliance. The tool will be managed by the City's webmaster and regularly generate report findings to the steering committee.

COMMUNICATIONS GOVERNANCE STRUCTURE

Creating the Accessibility Communications Plan is the first step in establishing the required policies and procedures to help ensure accessible communications. However, there is also a need for supporting infrastructure to ensure that the Plan is implemented and followed successfully. The governance structure helps to ensure that the Plan is not just partially followed or eventually abandoned.

GOVERNANCE STRUCTURE COMPONENTS

The Accessibility Workgroup

The Accessibility Workgroup enacts policies and makes recommendations for communications compliance. The workgroup will address accessibility issues and update departments on the communications decisions, acting as a conduit for information to and from individual departments.

The Accessibility Workgroup consists of:

- Communications Department Liaison
- City Webmaster
- ADA Coordinator
- Departmental ADA Liaisons

The Departmental ADA Liaisons consist of the existing Liaisons that have been working with the Plan process. The Liaisons would have the added responsibility of serving on the workgroup. The liaison training is especially important because communications accessibility is technical in nature. The Liaisons will be responsible for:

- Acting within their business area as accessibility point of contact for staff
- Acting as the gatekeeper for any departmental changes made to the City website
- Attending regularly scheduled meetings of the Accessibility Workgroup or ensuring that a representative from their department attends the meeting when their attendance is not possible
- Identifying existing, planned, or new electronic communications products within their business area
- Participating as voting members of the Accessibility Workgroup to address and improve business processes for accessibility compliance
- Improving staff awareness within their department

The many responsibilities placed on the City's ADA Coordinator mean that they must have the required support system and infrastructure to effectively manage City-wide ADA compliance on an ongoing basis. The ADA Coordinator must ensure that all City policies and procedures, PSAs, and physical infrastructure be made accessible. For more information regarding the role of the City's ADA Coordinator, see Section 5.3.

ADA ADVISORY GROUP

An ADA Advisory Group or Commission should be established to provide a voice to residents and provide a vehicle for community participation regarding ADA related issues. This advisory group should meet with the City's ADA Coordinator on a regular basis. Along with discussing ADA issues, the group should also monitor the City's process for resolving resident requests and review the City's annual budget to address the Plan's recommendations.

4.2 Parks and Facilities

The facilities in the self-evaluation were found to be in varying degrees of compliance. The recommendations are to address identified barriers in selected facilities, but this will change as feedback is provided by the City. At that point, the recommendations will be based on the analysis of required resources to address barriers at a facility with the possibility of moving an existing PSA to another facility that will require less expenditures.

The selected parks and facilities represent those that host a minimum of one PSA and are scored based on the priority matrix as outlined in Section 5.1. Below is a table of the facilities that are recommended to be altered and have identified barriers to accessibility removed.

Parks and Facilities Recommended for Alterations		
Ackerman Park	Eggleston Park	Ingraham Park
Baker Park	Eiden Park	James Park
Beck Park	Elliott Park	Ladd Arboretum
Bent Park	Evanston Ecology Center	Larimer Park
Burnham Shores Park	Evanston Fire Department Buildings	Leahy Park
Butler Park	Evanston Fire Department HQ	Levy Senior Center
Cartwright Park	Evanston Police Department	Lighthouse Beach
Chandler Park	Fleetwood-Jourdain Center	Lovelace Park
Chandler-Newberger	Fog Houses	Main Library
Civic Center	Foster Park	Mason Park
Clark Square	Fountain Square	Noyes Cultural Arts Center
Clark St Beach / Centennial Park	Garden Park	Penny Park
Community Gardens	Gibbs-Morrison Center	Raymond Park
Dawes Park / Greenwood Beach	Harbert Park	Tallmadge Park
Dempster Launch Facility	Independence Park	

Table 4.2.1 Parks and Facilities Recommended for Alterations

The barriers that have been identified to-date include items that can be addressed by staff as part of ongoing maintenance. These include fixed elements that can be relocated to compliant locations such as fire extinguishers, first aid kits, television monitors, toilet paper dispensers, and coat hooks. Other barriers require a more complex solution, and it is recommended that a professional designer be contracted to address the alterations required to achieve accessibility compliance.

The identified barriers in newer facilities demonstrate the need for a change to the City's existing permitting, plan review, and inspection process. Currently, the City does not review or inspect for ADA compliance. Instead, the City relies on design professionals such as architects and engineers to ensure ADA compliance in the design of City owned facilities. We recommend that the City implement a process that includes the review and inspection for ADA compliance whether by City staff or a third-party provider. However, the City currently does not have the required resources to perform the recommended function with existing staff.

Where architectural barriers are to be addressed in the future, City staff must develop temporary solutions to ensure program access. For example, if a facility's main entrance is not accessible, the public can be directed to use an accessible side entrance until the barrier at the main entrance is removed.



City of Evanston Police Department

4.3 Public Right-of-Way

During the public input process, the infrastructure in the public ROW was identified as the highest priority over other City parks and facilities. As mentioned in Section 3.3, this plan recommends and endorses the implementation City's Sidewalk Program. The City's program has created a prioritization system, resident process for making requests, and identifies costs as well as funding. Following the City's program also facilitates compliance with ADA in the public right-of-way.

4.4 Schedule and Budget

It is recommended that the City reach program access within 15 years of the date of this report. To reach this goal, the City's overall budget should include a line item to fund the recommendations of the ADA Transition Plan. Working with the Budget Department and recognizing expected funding sources, expected expenditures, and capital improvement forecasts, the City shall create an annual budget amount over the 15-year period.

As part of the required Annual Report, the City will monitor the progress made on addressing on-going staff training, ADA grievances, modifications to PSAs, removal of architectural barriers in parks and facilities, removal of barriers in the public ROW, and annual expenditures in these efforts. The budget can be adjusted annually to match financial and staffing resources with the recommendations in the ADA Transition Plan. Section 5.4 provides more details on the Annual Update Process.

CHAPTER 5: IMPLEMENTATION

This chapter will present the suggested method by which to achieve compliance with the ADA Title II requirements for program accessibility. The City can follow the proposed method and adjust the methodology, schedule, and budget as warranted by changes in the City's financial situation. However, any changes should be documented and recorded as an amendment to this Plan. The recommendations provided are a snapshot of the City's accessibility standing as of the date of this report.

What is to come:

- 5.1 Prioritization Process
- 5.2 Implementation Schedule
- 5.3 Official Responsible for Implementation
- 5.4 Annual Update Process



5.1 Prioritization Process

The prioritization of elements within facilities and the facilities themselves allows Altura to develop recommendations that provide the greatest impact for the City.

PRIORITIZATION PROCESS FOR PARK AND FACILITY ELEMENTS

Element prioritization is used as a metric to understand the importance of the noncompliant elements. Element ranking within a facility was developed by combining the recommendations in Title II of the ADA with input gathered from the Department interviews, the ADA Advisory Group, public Open House feedback, and the online survey. If the City decides to address only specific barriers within a facility instead of addressing all barriers at the same time, element rankings could be utilized. For example, the City could elect to focus on only the Priority 1 barriers in certain facilities due to budget constraints.

Priorities were divided into five levels, with Priority 1 being the highest. Each individual facility report documents noncompliant elements, the applicable ADA standard and a priority ranking. A summary of the priorities with elements is provided in the list below.

Priority	General Comment	Sample Elements
Priority 1	The top priority is providing an accessible route in and out of a park or facility while protecting people with low vision from protrusions that are not cane detectable.	• Entrances and Emergency Exits • Exterior Routes to Entrances • Protruding Objects
Priority 2	The second priority is providing accessible parking and routes within the park or facility.	• Accessible Routes • Parking • Doors
Priority 3	The third priority is providing accessible amenities of parks and buildings such as restrooms and drinking fountains.	• Restrooms • Drinking Fountains • Dressing/Fitting/Locker Room
Priority 4	The fourth priority is providing accessible amenities that are less common within parks and facilities.	• Showers • Room Signage • Appliances
Priority 5	The fifth priority is providing accessible amenities that are not integral to the park or facility's use.	• Pay Phones • Windows • Vending Machines

PRIORITIZATION PROCESS FOR INDIVIDUAL FACILITIES

To develop the recommended schedule for facility improvements, individual facilities were scored to create priorities for performing architectural modifications. The prioritization process considers factors with weighted averages to generate a final score for each facility. The factors and weighted values used for this analysis was developed by the Altura Team based on input from City staff and stakeholders. See Appendix 8 for the list of prioritized facilities that host a minimum of one PSA. The following provides a framework that can be adjusted over time.

Beck Park



The proposed factors utilized in the prioritization, in order of weighted value are:

- **Number of Programs, Services, or Activities at a facility** – Facilities that host a high number of total PSAs are scored according to Table 5.1.1 below with a 35% weighted value.

Number of PSAs	Score
0-2	1
3-9	2
10-20	3
21-99	4
100+	5

Table 5.1.1 Number of PSAs at a Facility

- **Type of Facility** – Facilities are also scored based on designation and use. Facilities are categorized by type and scored according to Table 5.1.2 below with a 30% weighted value.

Type of Facility	Score
Citywide Services	10
Libraries	9
Community Center	8
Community Park	7
Recreation Field Houses	6
Neighborhood Park	5
Police and Fire	4
Parking Garages	3
Tot Lot	2
Operations	1

Table 5.1.2 Type of Facility

- **Facility used as a polling place** – Facilities used as a polling location are given a score according to Table 5.1.3 below with a 10% weighted value.

Polling Location	Score
Yes	5
No	0

Table 5.1.3 Facilities used as Polling Locations

- **Public Input** – Facilities mentioned as a priority in the public input process are given a score according to Table 5.1.4 below with a 15% weighted value.

Public Input	Score
Yes	5
No	0

Table 5.1.4 Facilities as Priorities from Public Input

5.2 Implementation Schedule

ADA Title II states:

“Time period for compliance. Where structural changes in facilities are undertaken to comply with the obligations established under this section, such changes shall be made within three years of the effective date of this part (January 26, 1992), but in any event as expeditiously as possible,” 28 CFR §35.150(c).

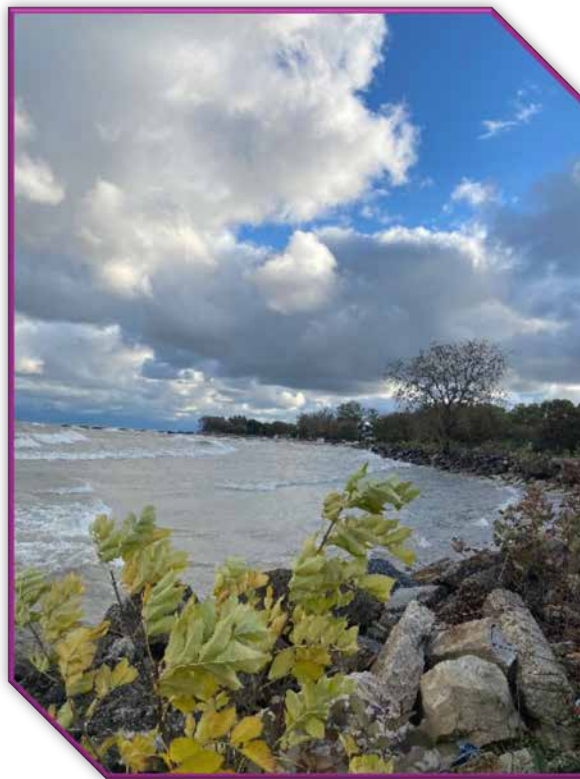
This Plan is an update to the City’s 2012 ADA Transition Plan. It is recommended that corrective actions take place immediately and continue with a goal for completion by a set deadline. While the City has existing schedules to perform maintenance on a City-wide level, a specific ADA Maintenance Schedule should also be developed and added into the existing schedule. A proposed schedule of 15 years to achieve ADA Program Access is proposed.

The proposed schedule can be adjusted over time as the City’s financial and labor resources change. As part of the annual update process described in Section 5.4, the ADA Coordinator should perform an assessment of the City’s financial resources to adjust the schedule accordingly and document any changes.

As required by ADA Title II, annual updates to this plan shall be generated by the City, demonstrating the progress made that year, with a listing of projects undertaken, projects completed, and expenditures made to reach compliance. The annual updates are a federal requirement and are intended to be used internally as a means of tracking progress. The City must ensure the annual updates are readily available as proof of annual progress. The self-evaluation reports for facilities and GIS layers should be amended as alterations are completed. It is recommended that a process be created to ensure that the facility alterations are made in compliance with ADA standards prior to altering any data within this Plan, such as adoption of a formal City policy requiring completion of an ADA-specific inspection before acceptance of any new construction.

With proper training, the ADA inspection could be performed by the City project manager or a member of the Building Division. With proper training, a member of the design team, or a qualified third-party ADA inspector can also perform the ADA inspection. Once ADA compliance has been verified, the project is reported as completed to the ADA Coordinator and the GIS layer is updated. With this additional inspection process, there is less likelihood of the existing pattern of barriers continuing in City-owned facilities.

As required by the ADA, the Plan should be made available for viewing by the public for the duration of the alteration schedule and for a minimum of three years after Plan completion.



Shores of Evanston

5.3 Official Responsible for Implementation

Per Title II requirements, a person must be assigned to be responsible for implementing the Plan. The responsibility of ensuring ADA compliance across the whole organization is a difficult task for a single person. As mentioned in Chapter 4.1, it is recommended that the City appoint an ADA Coordinator and formalize Departmental ADA Liaisons to provide the required support to the person responsible for implementing the Plan. This will help the City meet federal ADA requirements and ensure the Plan becomes a living document that creates a culture of accessibility across the City.

The responsibilities associated with the designated person to ensure implementation of the Plan include, but are not limited to:

- Act as the City's single point of contact regarding ADA compliance
- Chair monthly ADA Liaison meetings
- Managing the City's ADA Grievance Procedure
- Participate in the City Communications Plan process
- Participate in the City's reasonable accommodation process
- Conduct ongoing reviews of City policies and procedures for ADA compliance
- Perform annual updates to the City's ADA Transition Plan
- Ensure that resources are being provided to ADA Transition Plan efforts
- Supervise ongoing ADA training for staff
- Ensure that new infrastructure is constructed to meet accessibility requirements
- Remain up to date on changing ADA trends and interpretations

The responsibility of implementing the Plan typically falls to the ADA Coordinator. However, there is no official City ADA Coordinator at the time of this report. It is recommended that the City fund the position and install an ADA Coordinator as soon as possible.

5.4 Annual Update Process

The annual update is an ADA requirement that demonstrates the City's progress on the Plan. As discussed in Section 4.1, it is recommended that appropriate infrastructure be provided to effectively produce the federally mandated annual update to the plan. To have a seamless annual update process, it is critical to have the support of City management and cooperation of staff.

While the update is a requirement, it can also serve to instill a culture of ADA compliance within the City's existing systems and processes. The update process is useful in keeping ADA compliance at the forefront of City staff's job duties, thus ensuring that it is effectively interwoven into other departmental systems. For example, the update process can complement the City's existing asset management system.

The annual update process involves gathering and reporting on information across all City departments and functions. The validity and accuracy of the annual update is only as strong as the information provided by the ADA Liaisons. The annual update also provides the City with the opportunity to make modifications to the Plan's schedule or budget, or both. At a minimum, the following components should be updated every year:

- Self-evaluation reports for any construction projects completed within the year and their associated costs, including:
 - Architectural barriers addressed
 - Curb ramps and linear feet of sidewalk constructed
 - Amount of accessible on-street parking added
- Update the GIS layer to reflect the alterations to facilities confirmed to be compliant
- Document the budget expenditures for the year
- If required, make changes to the schedule which should include:
 - Defendable reason(s) for making the change
 - Shift in the Plan's budget due to changes in resources or market conditions
 - Shift in the scheduled facilities to be altered
- Summary of ADA Training

- o Modifications, if any, made to original training plan
- o Results of attendance goals and metrics
- Report on changes to City PSAs, policies, and procedures
- Status of the City's website regarding ADA compliance
- Report on number of ADA grievances and resolutions
- Tracking of resident request for ADA alterations

The annual update involves the coordination of every City department and their efforts in making progress on the Plan. As outlined in Section 4.1, the recommendations for the City's ADA Program and Departmental ADA Liaison structure greatly facilitate the annual update process. For example, the Liaison from the Administrative Services Department would be responsible for providing the departmental update for the items listed above from each of the eight divisions within the department. The Liaison would work with each division to ensure that the information is being captured on an ongoing basis and provided annually, at a minimum. The first annual update is due on the anniversary of the adoption of the Plan. Depending on the size and structure of each department, the Liaisons will require varying levels of effort to produce the required annual update report.

It is recommended that the City produce quarterly update reports until the process is ingrained as part of the City's standard workflow. The quarterly reports will demonstrate the required effort, at every level, to capture and report the information. The quarterly updates will also allow for adjustments to be made in the process in preparation for the annual update.



Evanston Fire Station No. 1

Appendices

- ◇ **Appendix 1:** Summary of Input from Public Online Surveys
- ◇ **Appendix 2:** Website Review Reports
- ◇ **Appendix 3:** List of Facilities
- ◇ **Appendix 4:** Facility Assessment Reports
- ◇ **Appendix 5:** PSA Checklist
- ◇ **Appendix 6:** PSA Reviews
- ◇ **Appendix 7:** Glossary
- ◇ **Appendix 8:** List of Prioritized Facilities

Appendix 1 - Summary of Input from Public Online Surveys

The online survey was provided in both English and Spanish. It generated a total of 165 responses. The public was asked to provide information on the programs and services that they use, the types of facilities they frequent, and the elements within facilities that they use the most. These responses helped identify the needs and wishes of the community.

--

When asked “Which types of infrastructure do you feel need the most attention?” the public felt that the rights-of-way needed the most attention (49.67%), then buildings (38.41%) and lastly parks (11.92%).

Three types of facilities that the public believed are the highest priority included Community Centers such as Fleetwood-Jourdain & Crown Center (66.44%), Municipal Buildings such as Lorraine H. Morton Civic Center (61.64%), & Libraries (60.27%).

At 69.49%, most of the public agreed that city-owned facilities or areas within Evanston are in need of accessibility improvements.

The top three elements within a building that are most important for the community be accessible are restrooms (70.95%), entrances (62.16%), & accessible parking (43.24%).

Elements	Response %	Number of Responses
Restrooms	70.95%	105
Entrances	62.16%	92
Accessible Parking	43.24%	64
Exterior Accessible Route from Transportation	35.81%	53
Interior Accessible Route	35.81%	53
Reception or Point of Sale Counter	19.59%	29
Special Use (such as Auditorium, Classrooms, ect.)	14.19%	21
Drinking Fountains	12.84%	19

The top three elements within a park that the public finds most important for each community park to have accessible are restrooms (65.31%), routes & trails (44.22%), & accessible parking (43.54%).

Elements	Response %	Number of Responses
Restrooms	65.31%	96
Routes & Trails	44.22%	65
Accessible Parking	43.54%	64
Drinking Fountains, Trash Receptacles & Other Site Furnishings	40.14%	59
Picnic Tables	25.85%	38
Seating/Bleachers	25.17%	37
Playground	25.17%	37
Fitness Equipment	12.24%	18
Sport Courts & Fields	8.84%	13

The top three elements in the public right-of-way the public finds most important to have accessible are sidewalks (77.71%), curb ramps (65.61%), & crosswalks (55.41%).

Elements	Response %	Number of Responses
Sidewalks	77.71%	122
Curb Ramps	65.61%	103
Crosswalks	55.41%	87
Bus Stops	34.39%	54
Pedestrian Pushbuttons	26.11%	41
On-Street Parking	22.93%	36

Programs and services that the public finds most important to utilize are the maintenance of streets & public areas (52.29%), fire and police services (43.79%), & library programs (37.25%).

Program or Service	Response %	Number of Responses
Maintenance of Streets and Public Areas	52.29%	80
Fire & Police Services	43.79%	67
Library Programs	37.25%	57
Community Services (such as Food Safety Licenses, Public Health Emergency Preparedness, Waste Management)	36.60%	56
Affordable Housing Programs	32.68%	50
City Government (such as City Website, City Council Meetings)	21.57%	33
Senior Programs (such as Levy Lecture Series, Mobile Driver Services)	20.92%	32
Parks & Recreation Classes	20.92%	32
Youth Programs (such as Mayor's Summer Youth Employment Program, Summer Camps)	17.65%	27
Economic Development (such as COVID-19 Small Business Program, Small Business Mentoring Program)	13.07%	20
Boards & Commissions (such as Racial Equity Diversity Inclusion [REDI] Commision, Zoning Committee)	11.76%	18
Beach Pass Programs	11.11%	17

Q1 What is your zip code?

Answered: 162 Skipped: 2

#	RESPONSES	DATE
1	60202	12/19/2021 2:41 AM
2	60201	12/18/2021 7:07 PM
3	60201	12/17/2021 5:29 PM
4	60202	12/17/2021 12:59 PM
5	60202	12/17/2021 12:32 PM
6	60201	12/17/2021 9:21 AM
7	60202	12/17/2021 6:47 AM
8	60201	12/16/2021 11:31 PM
9	60201	12/16/2021 10:15 PM
10	60201	12/16/2021 8:50 PM
11	60202	12/16/2021 8:29 PM
12	60201	12/16/2021 8:17 PM
13	60202	12/16/2021 6:54 PM
14	60202	12/16/2021 6:49 PM
15	60201	12/16/2021 6:07 PM
16	60202	12/16/2021 5:46 PM
17	60202	12/16/2021 5:45 PM
18	60201	12/16/2021 5:44 PM
19	60201	12/16/2021 5:41 PM
20	60201	12/15/2021 4:48 PM
21	60201	12/15/2021 1:36 PM
22	6020	12/15/2021 10:35 AM
23	60202	12/15/2021 10:27 AM
24	60201	12/15/2021 10:21 AM
25	60202	12/14/2021 10:47 AM
26	60202	12/14/2021 10:45 AM
27	60202	12/14/2021 10:41 AM
28	60645	12/14/2021 10:30 AM
29	60202	12/13/2021 3:02 PM
30	60201	12/13/2021 8:11 AM
31	60201	12/12/2021 12:37 PM
32	60201	12/12/2021 8:35 AM
33	60202	12/12/2021 7:46 AM

City of Evanston ADA Transition Plan Update Survey

34	60202	12/11/2021 3:37 PM
35	60201	12/11/2021 9:40 AM
36	60202	12/10/2021 10:08 PM
37	60201	12/10/2021 4:36 PM
38	60602	12/10/2021 12:57 PM
39	60201	12/10/2021 12:09 PM
40	60202	12/10/2021 11:02 AM
41	60201	12/10/2021 10:19 AM
42	60202	12/10/2021 6:25 AM
43	60202	12/10/2021 1:58 AM
44	60201	12/9/2021 9:21 PM
45	60201	12/9/2021 8:11 PM
46	60202	12/9/2021 8:03 PM
47	60202	12/9/2021 7:17 PM
48	60201	12/9/2021 6:45 PM
49	60201	12/9/2021 6:43 PM
50	60201	12/9/2021 6:35 PM
51	60201	12/9/2021 6:26 PM
52	60201	12/9/2021 6:06 PM
53	60202	12/9/2021 5:27 PM
54	60201	12/9/2021 5:25 PM
55	60202	12/9/2021 2:58 PM
56	60202	12/9/2021 2:35 PM
57	60201	12/9/2021 9:20 AM
58	60202	12/9/2021 8:37 AM
59	60201	12/9/2021 7:16 AM
60	60202	12/9/2021 6:43 AM
61	60202	12/9/2021 3:41 AM
62	60202	12/9/2021 1:28 AM
63	60201	12/8/2021 10:09 PM
64	60201	12/8/2021 8:02 PM
65	60202	12/8/2021 4:11 PM
66	60202	12/8/2021 3:09 PM
67	60202	12/8/2021 2:35 PM
68	60202	12/7/2021 11:06 AM
69	60201	12/6/2021 8:25 AM
70	60201	12/6/2021 8:13 AM
71	60202	12/6/2021 7:18 AM

City of Evanston ADA Transition Plan Update Survey

72	60053	12/5/2021 2:14 PM
73	60201	12/5/2021 1:27 AM
74	60201	12/4/2021 2:01 PM
75	60201	12/3/2021 8:52 PM
76	60201	12/3/2021 8:21 PM
77	60201	12/3/2021 7:53 PM
78	60201	12/3/2021 4:49 PM
79	60202	12/3/2021 3:58 PM
80	60201	12/3/2021 2:30 PM
81	60201	12/3/2021 1:24 PM
82	60201	12/3/2021 12:31 PM
83	60201	12/3/2021 10:59 AM
84	60201	12/3/2021 2:54 AM
85	60202	12/2/2021 10:39 PM
86	60202	12/2/2021 10:05 PM
87	60202	12/2/2021 10:03 PM
88	60202	12/2/2021 9:44 PM
89	60202	12/2/2021 9:36 PM
90	60202	12/2/2021 9:24 PM
91	60201	12/2/2021 8:52 PM
92	60201	12/2/2021 7:38 PM
93	60202	12/2/2021 7:28 PM
94	60202	12/2/2021 7:08 PM
95	60202	12/2/2021 6:18 PM
96	60202	12/2/2021 6:05 PM
97	60201	12/2/2021 5:47 PM
98	60202	12/2/2021 5:47 PM
99	60202	12/2/2021 5:39 PM
100	60202	12/2/2021 5:38 PM
101	60201	12/2/2021 5:36 PM
102	60201	12/2/2021 5:36 PM
103	60201	12/2/2021 5:28 PM
104	60201	12/2/2021 5:23 PM
105	60201-3933	12/2/2021 5:23 PM
106	60201	12/2/2021 5:11 PM
107	60201	12/2/2021 1:52 PM
108	60201	12/2/2021 1:00 PM
109	60201	12/2/2021 11:43 AM

City of Evanston ADA Transition Plan Update Survey

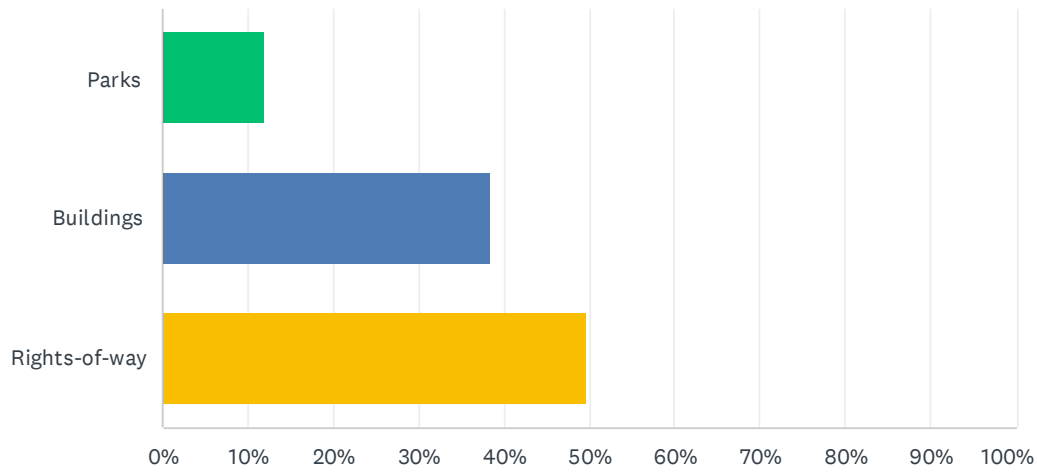
110	60201	12/2/2021 10:04 AM
111	60202	12/2/2021 5:29 AM
112	60201	12/2/2021 4:32 AM
113	60202	12/1/2021 11:49 PM
114	60201	12/1/2021 9:54 PM
115	60202	12/1/2021 9:48 PM
116	60201	12/1/2021 9:46 PM
117	60201	12/1/2021 9:20 PM
118	60201	12/1/2021 5:32 PM
119	60201	12/1/2021 5:11 PM
120	60201	12/1/2021 5:07 PM
121	60201	12/1/2021 4:44 PM
122	60201	12/1/2021 4:41 PM
123	60202	12/1/2021 4:36 PM
124	60201	12/1/2021 4:32 PM
125	60201	12/1/2021 4:30 PM
126	60202-1719	12/1/2021 4:16 PM
127	60202	12/1/2021 4:13 PM
128	60201	12/1/2021 3:47 PM
129	60202	12/1/2021 3:41 PM
130	60202	12/1/2021 3:03 PM
131	60202	11/30/2021 7:30 PM
132	60202	11/30/2021 5:31 PM
133	60202	11/28/2021 12:20 PM
134	60201	11/26/2021 2:15 PM
135	60201	11/25/2021 5:39 PM
136	60201-2605	11/24/2021 9:32 PM
137	60077	11/24/2021 4:57 PM
138	60202	11/24/2021 2:09 PM
139	60202	11/24/2021 1:50 PM
140	60203	11/24/2021 1:21 PM
141	60201	11/24/2021 12:51 PM
142	60202	11/24/2021 12:31 PM
143	602021	11/23/2021 10:14 AM
144	60201	11/22/2021 11:54 AM
145	60202	11/20/2021 10:01 PM
146	60201	11/19/2021 11:31 AM
147	60202	11/19/2021 10:35 AM

City of Evanston ADA Transition Plan Update Survey

148	60202	11/19/2021 9:42 AM
149	60202	11/19/2021 8:59 AM
150	60201	11/19/2021 7:51 AM
151	60201	11/18/2021 10:43 PM
152	60202	11/18/2021 9:45 PM
153	60201	11/18/2021 8:42 PM
154	60202	11/18/2021 8:27 PM
155	60202	11/18/2021 7:24 PM
156	60201	11/18/2021 6:45 PM
157	60201	11/18/2021 5:45 PM
158	60202	11/18/2021 5:38 PM
159	60201	11/18/2021 5:16 PM
160	60202	11/18/2021 3:30 PM
161	60201	11/18/2021 2:42 PM
162	60202	11/18/2021 11:05 AM

Q2 Which types of infrastructure do you feel need the most attention?


Answered: 151 Skipped: 13



ANSWER CHOICES	RESPONSES	
Parks	11.92%	18
Buildings	38.41%	58
Rights-of-way	49.67%	75
TOTAL		151

Q3 Please select 3 types of facilities that you believe are the highest priority.

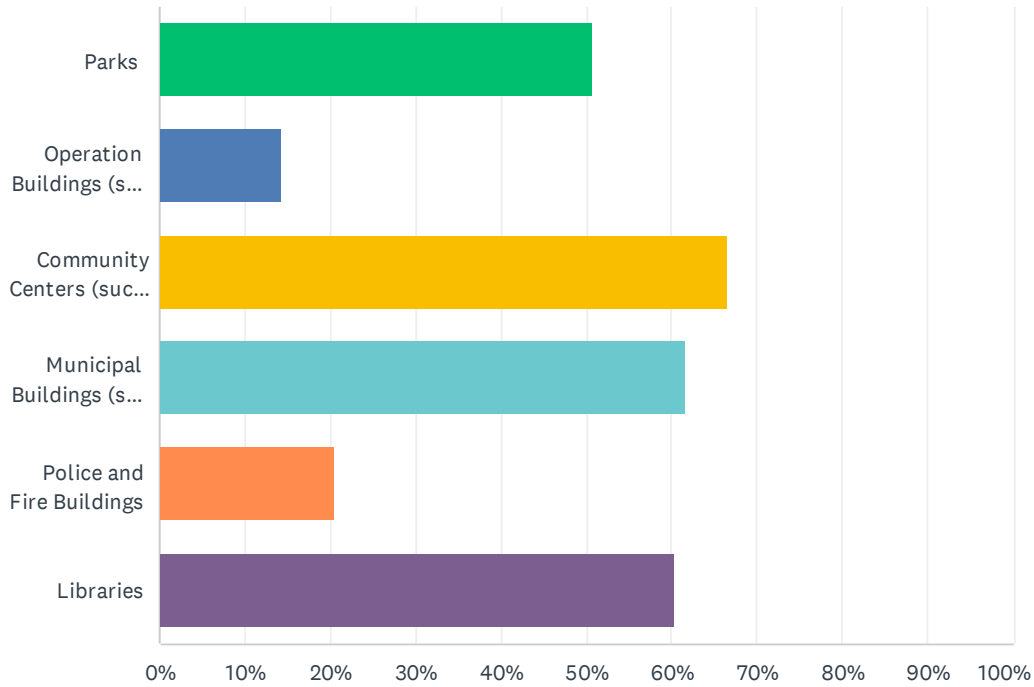
Answered: 146 Skipped: 18



ANSWER CHOICES	RESPONSES	
Parks	50.68%	74
Operation Buildings (such as water plant & service center)	14.38%	21
Community Centers (such as Fleetwood-Jourdain & Crown Center)	66.44%	97
Municipal Buildings (such as Lorraine H. Morton Civic Center)	61.64%	90
Police and Fire Buildings	20.55%	30
Libraries	60.27%	88
Total Respondents: 146		

Q4 Are there any city-owned facilities or areas within Evanston that are in need of accessibility improvements?

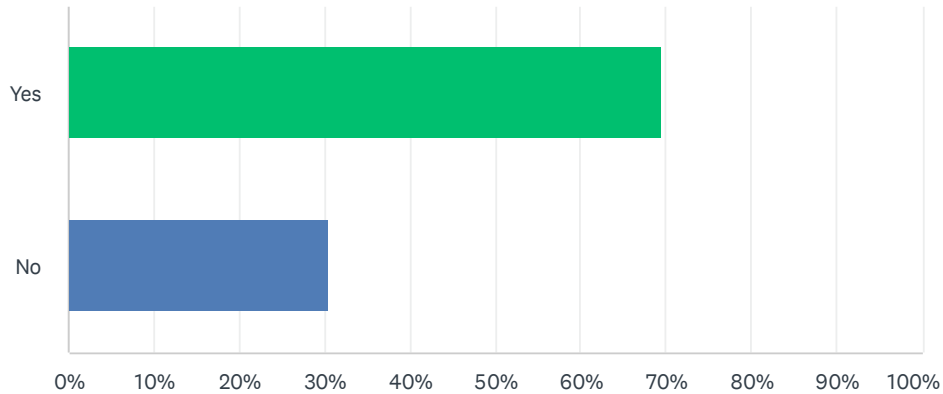Answered: 118 Skipped: 46



ANSWER CHOICES	RESPONSES	
Yes	69.49%	82
No	30.51%	36
TOTAL		118

#	IF YES, PLEASE PROVIDE THE FACILITY NAME OR AREA THAT CAN BE MADE ACCESSIBLE.	DATE
1	Lake Front	12/17/2021 9:21 AM
2	Civic Center	12/17/2021 6:47 AM
3	Reopen the parking garage under library for handicapped parking	12/16/2021 9:27 PM
4	all surfaces where sidewalks are used by Evanston citizens, including older people	12/16/2021 8:50 PM
5	All public transit stations-Metra, L Train, etc	12/16/2021 8:29 PM
6	Bus stops	12/16/2021 6:07 PM
7	Davis and Chicago crossing. Planter in way.	12/15/2021 4:48 PM
8	Parking	12/14/2021 10:41 AM
9	Curb cuts in winter	12/12/2021 12:37 PM
10	South Boulevard beach needs a better ramp into the beach and sidewalks	12/11/2021 3:37 PM
11	Clearing snow from curb ramps is a huge priority for people using wheelchairs, especially manual chairs.	12/11/2021 9:40 AM
12	Unsure	12/10/2021 4:36 PM
13	Joseph E. Hill Childhood Education Center/Evanston Skokie School District 65	12/10/2021 12:09 PM
14	Fleetwood	12/10/2021 11:02 AM
15	Civic Center	12/10/2021 10:19 AM
16	Restrooms at Davis Street Lagoon	12/10/2021 6:25 AM

City of Evanston ADA Transition Plan Update Survey

17	Robert Crown Community Center and Library	12/10/2021 1:58 AM
18	Sidewalks all around Evanston need repairs. I've seen sidewalks that are so unlevelled they might as well be steps. How is a person in a wheelchair or a senior expected to pass through these safely?!	12/9/2021 9:21 PM
19	Streets and parks need to be accessible to people with asthma and respiratory illness. Constant leaf-blowing through the fall and spring causes asthma attacks and hospitalizations. Evanston needs to get serious about banning this hazard, which both exacerbates and causes disabilities.	12/9/2021 8:11 PM
20	Parking lanes	12/9/2021 7:17 PM
21	the corners of Emerson -Ridge and Green bay, very dangerous planning	12/9/2021 6:45 PM
22	All Metra and CTA train lines need to be accessible. Foster is an example of one that isn't- there is no elevator	12/9/2021 6:43 PM
23	Light House Beach!! It's a crime that people have to pay money to park there!!	12/9/2021 6:35 PM
24	virtually all elementary and middle schools are not ADA compliant	12/9/2021 5:27 PM
25	Crown & Civic centers	12/9/2021 2:35 PM
26	Central St. CTA Station	12/9/2021 9:20 AM
27	Robert crown library has no book drop	12/9/2021 8:37 AM
28	Notes center Civic center	12/9/2021 3:41 AM
29	The Pie Shop recording studio by the high school.	12/9/2021 1:28 AM
30	Cross walks and side walks which are uneven and dangerous to people in wheel chairs and it would be good to have lights which are timed longer time to walk across the street and the count down sign	12/8/2021 10:09 PM
31	MAIN LIBRARY- MAINTAIN LIBRARY SURFACE LOT. DO NOT SELL LIBRARY SURFACE LOT.	12/8/2021 8:02 PM
32	All of the areas where there are no sidewalks. You can't navigate many areas of the city on a wheel chair if you don't drive. You have to wheel out into the street and it is very dangerous.	12/8/2021 3:09 PM
33	Restrooms in the parks	12/8/2021 2:35 PM
34	Sidewalks along Sherman and around the area between Sherman and Ridge and Foster and Noyes	12/6/2021 8:25 AM
35	Parks and beaches	12/5/2021 2:14 PM
36	sidewalk on Lake St, south of YMCA parking lot; sidewalk on Lake St,between Ridge and just East of Asbury, on North side of street. That section of sidewalk is difficult to traverse on my scooter. Also, snow removal of streets by snowplows prevent accessible curb crossings--very difficult or impossible to cross the street after snowplow clears the street again.	12/4/2021 2:01 PM
37	Parks	12/3/2021 8:52 PM
38	Pedestrian accommodation infrastructure and engineering improvements.	12/3/2021 8:21 PM
39	Cross walks after snow plowing.	12/3/2021 4:49 PM
40	All public buildings need family bathrooms	12/3/2021 2:30 PM
41	Fleetwood-Jourdain	12/3/2021 1:24 PM
42	Bathrooms in parks! Closed for the season or doors that are nearly impossible to open.	12/3/2021 10:59 AM
43	Purple Line Train Station between South and Dempster- all 3 southern stations are inaccessible. Central Street Station which services the Hospital is also inaccessible.	12/2/2021 10:39 PM
44	Farmer's Market	12/2/2021 10:03 PM
45	Central between Back Lot to Great Harvest. Other than the 3 ramp areas, the curb is crazy high. I use a cane, sometimes walker, and have to hold on to stranger's cars to get up and	12/2/2021 9:44 PM

City of Evanston ADA Transition Plan Update Survey

down from the sidewalk to the street.

46	The Levy Senior Center has had a variety of accessibility improvements, but more are needed, because the Center serves primarily older adults, including those with a variety of impairments to physical mobility and to hearing, vision, and cognition. The surrounding James Park needs similar improvements, including benches more closely spaced along all paths for resting, including ones in shaded areas.	12/2/2021 9:24 PM
47	public sidewalks are very cracked in places. We need more progressive methods to manage mental health.	12/2/2021 7:28 PM
48	Lorrain H. Morton building needs a ground level major entrance (the out of the way rear entrance is inadequate) often locked and must find a decrepit elevator to get to office floors. Need a set of elevators in the big ground new level entrance off the parking lot to get to the offices above.	12/2/2021 7:08 PM
49	Civic Center -- more alternatives to stairs	12/2/2021 6:05 PM
50	Bathrooms at the lake parks	12/2/2021 5:47 PM
51	Sidewalks throughout	12/2/2021 5:38 PM
52	The EVANSTON HOSPITAL is next to dumpy NO ELEVATOR?? !! Centeal St train station-disabled & unwell can hardly walk those deteriorated steps to go to Doctor office bldg 1000 Central	12/2/2021 5:28 PM
53	main library	12/2/2021 11:43 AM
54	Civic center	12/2/2021 5:29 AM
55	Postoffice	12/1/2021 11:49 PM
56	Curbs are a problem for me. If a car is near, I use that as assistance. In addition, during winter when snow is present, and businesses shovel, they pile the snow by where the cars park. I am 82 years old, and am unable to navigate the piles to enter the establishments.	12/1/2021 5:11 PM
57	Civic center	12/1/2021 5:07 PM
58	Fire Headquarters has door handles that I can't use. Other buildings also have door handles that I can't use.	12/1/2021 4:44 PM
59	Civic center	12/1/2021 4:41 PM
60	Larger print signage everywhere	12/1/2021 3:03 PM
61	The Morton Civic Center remains a difficult building to navigate. I know that this is understood and is part of the review as to whether to construct a new civic center.	11/30/2021 7:30 PM
62	CTA stops and bus shelters	11/30/2021 5:31 PM
63	Lorraine Morton Civic Center	11/25/2021 5:39 PM
64	Curb cuts and tactile sidewalks, @ cta Central - Noyes - Foster stations, elevator at Metra stations	11/24/2021 9:32 PM
65	CTA and Metrs Elevated stops (except) Davis Street	11/24/2021 4:57 PM
66	All.	11/24/2021 1:50 PM
67	Unsure of the exact jurisdiction that this falls under, but I would like to see streetscape improvements. Central St is a good example of the challenges -- the curbs are staggered; at times there are two, separate curbs, and the sidewalk levels is usually at least a foot and a bit higher than the road. This makes getting out of a car difficult for people in my family, and increase the chances of slipping and falling. I also think bus stops can be made more accessible! There are some near my residence that are: in a grassy area with no sidewalk, no ramp access, no coverings/shed. These can be dangerous especially on a very busy road.	11/24/2021 1:21 PM
68	Evanston Public Works has little to no accessible parking for the public. Civic Center does have parking that can be used for PW, but it's about a block away.	11/24/2021 12:31 PM
69	Evanston Police Department - We have attended tours of the Evanston Police Station. Not all areas of the building are wheelchair accessible. Noyes Cultural Center - the door at the top of	11/23/2021 10:14 AM

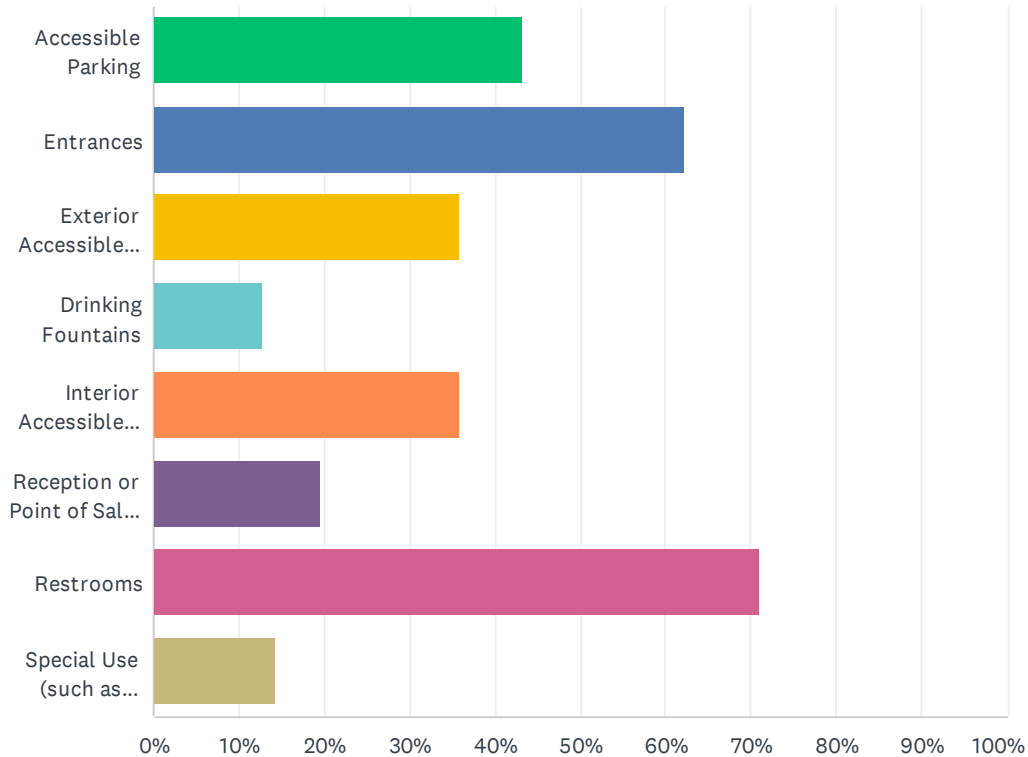
City of Evanston ADA Transition Plan Update Survey

the wheelchair ramp stays locked. The only way to get into the building using a wheel chair is to make special arrangements with a staff member to unlock it upon arrival. The Main St. Metra station needs a ramp on the Southbound platform. The elevator is often closed. All of the CTA Purple line stations need elevators or ramps. Flu

70	Evanston desperately needs to widen sidewalks on Chicago Ave between Greenleaf and Dempster, and on Main between Hinman and Sherman. They also need to remove the debris and rocks that pile up on the northwest corner of Maple and Lake which make that sidewalk totally inaccessible for wheelchair users. We also need raised crosswalks in as many locations as possible (to my knowledge the only raised crosswalk in the city is on the NU campus outside the football practice facility).	11/20/2021 10:01 PM
71	Sidewalks all over the city. I live in southwest Evanston and there are tons of sidewalk areas that you cannot access using a wheelchair.	11/19/2021 10:35 AM
72	Clear unblocked sidewalks are important. Parked cars over sidewalks and in crosswalks blocking wheelchairs. Lack of sidewalks in some areas. And as winter comes, uncleared...	11/19/2021 9:42 AM
73	sidewalks, crosswalks	11/19/2021 8:59 AM
74	Beaches. Most parks	11/18/2021 10:43 PM
75	Lighthouse beach restroom	11/18/2021 8:42 PM
76	Most beaches are not accessible	11/18/2021 7:24 PM
77	Sidewalks are dangerous both due to surface irregularities and danger of getting hit in the head from signs or branches	11/18/2021 5:45 PM
78	Civic center entrance is confusing for those who can't handle stairs	11/18/2021 5:38 PM
79	see my comment about Clark Square, for example	11/18/2021 11:05 AM

Q5 What elements within a building do you find most important for the community to have accessible in each facility? Please select up to 3.


Answered: 148 Skipped: 16



ANSWER CHOICES	RESPONSES	
Accessible Parking	43.24%	64
Entrances	62.16%	92
Exterior Accessible Route from Transportation	35.81%	53
Drinking Fountains	12.84%	19
Interior Accessible Route	35.81%	53
Reception or Point of Sale Counter	19.59%	29
Restrooms	70.95%	105
Special Use (such as Auditorium, Classrooms, etc.)	14.19%	21
Total Respondents: 148		

Q6 What elements within a park do you find most important for each community park to have accessible? Please select up to 3.

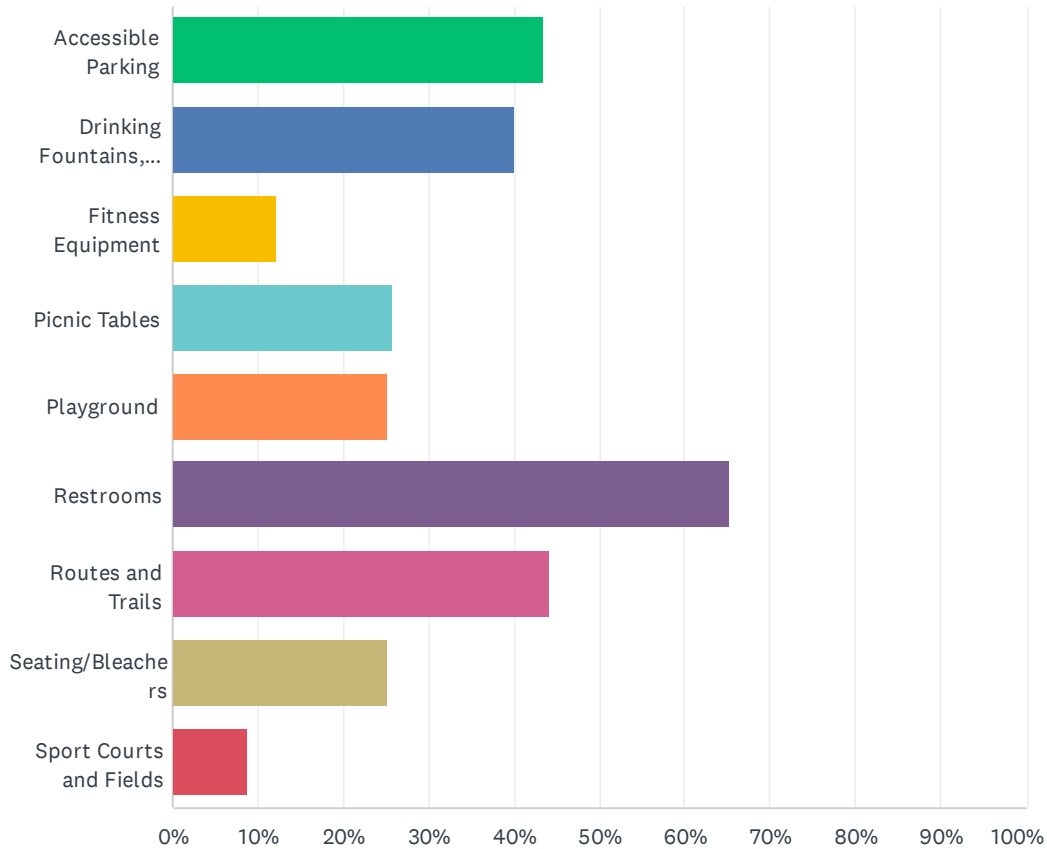
Answered: 147 Skipped: 17



ANSWER CHOICES	RESPONSES	
Accessible Parking	43.54%	64
Drinking Fountains, Trash Receptacles, and Other Site Furnishings	40.14%	59
Fitness Equipment	12.24%	18
Picnic Tables	25.85%	38
Playground	25.17%	37
Restrooms	65.31%	96
Routes and Trails	44.22%	65
Seating/Bleachers	25.17%	37
Sport Courts and Fields	8.84%	13
Total Respondents: 147		

Q7 What elements in the public right-of-way do you find most important to have accessible? Please select up to 3.

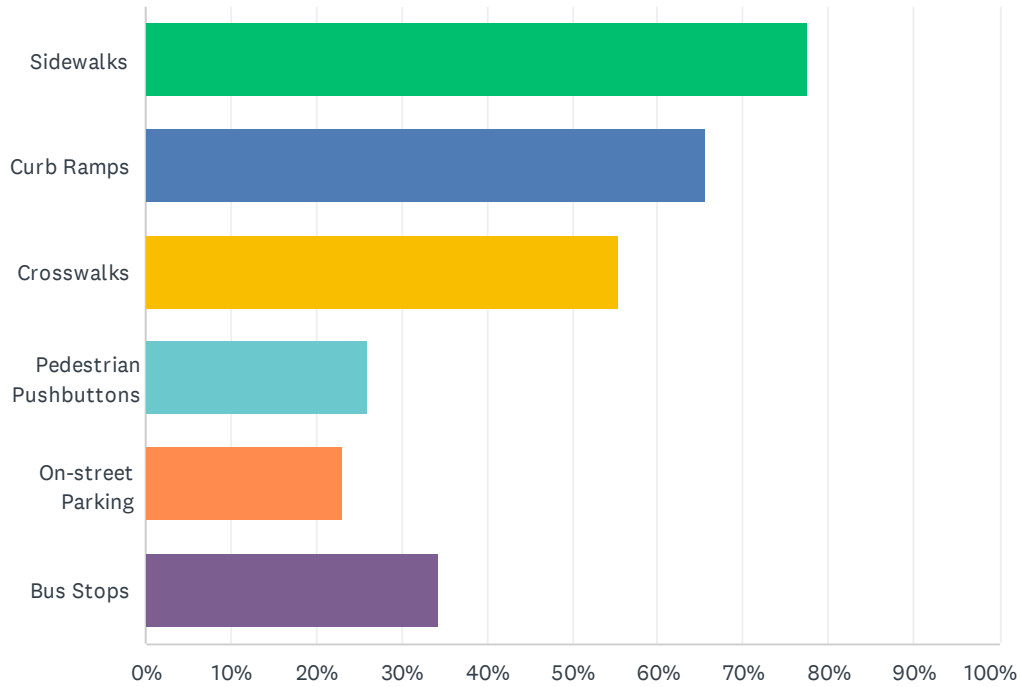
Answered: 157 Skipped: 7



ANSWER CHOICES	RESPONSES	
Sidewalks	77.71%	122
Curb Ramps	65.61%	103
Crosswalks	55.41%	87
Pedestrian Pushbuttons	26.11%	41
On-street Parking	22.93%	36
Bus Stops	34.39%	54
Total Respondents: 157		

Q8 Select the programs and services the City provides that are most important to you. Please select up to 3.

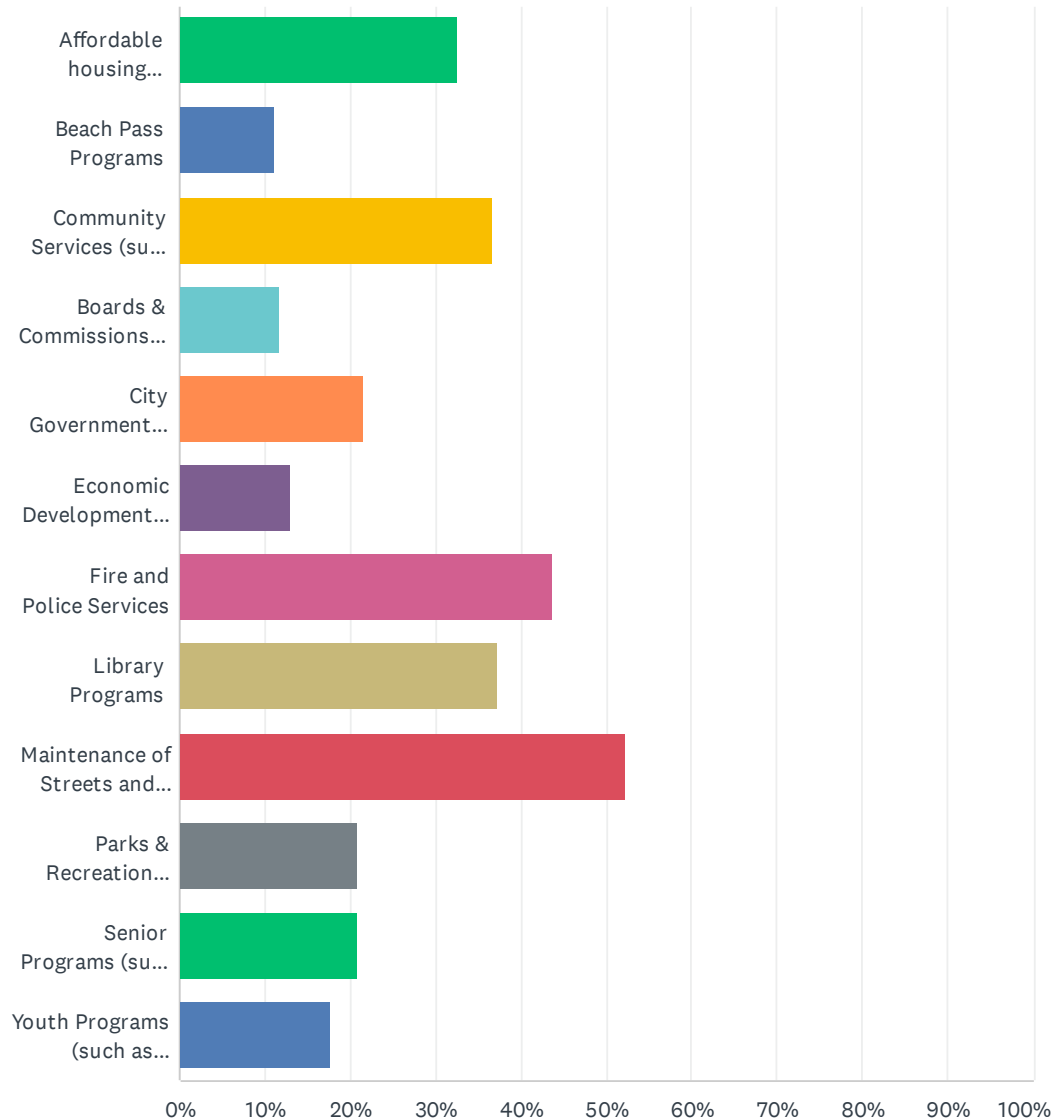Answered: 153 Skipped: 11




City of Evanston ADA Transition Plan Update Survey

ANSWER CHOICES	RESPONSES	
Affordable housing programs	32.68%	50
Beach Pass Programs	11.11%	17
Community Services (such as Food Safety Licenses, Public Health Emergency Preparedness, Waste Management)	36.60%	56
Boards & Commissions (such as Racial Equity Diversity Inclusion [REDI] Commision, Zoning Committee)	11.76%	18
City Government (such as City Website, City Council Meetings)	21.57%	33
Economic Development (such as COVID-19 Small Business Program, Small Business Mentoring Program)	13.07%	20
Fire and Police Services	43.79%	67
Library Programs	37.25%	57
Maintenance of Streets and Public Areas	52.29%	80
Parks & Recreation Classes	20.92%	32
Senior Programs (such as Levy Lecture Series, Mobile Driver Services)	20.92%	32
Youth Programs (such as Mayor's Summer Youth Employment Program, Summer Camps)	17.65%	27
Total Respondents: 153		

Q9 Are there additional programs and services that you utilize?

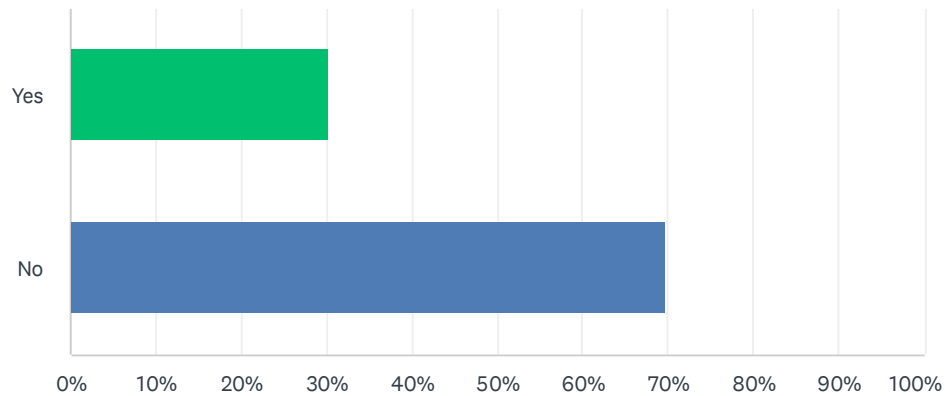Answered: 119 Skipped: 45



ANSWER CHOICES	RESPONSES	
Yes	30.25%	36
No	69.75%	83
TOTAL		119


#	IF YES, PLEASE PROVIDE THE NAME OF THE PROGRAM OR SERVICE.	DATE
1	"City government" covers just about everything. And of course we all use streets and public areas.	12/17/2021 5:29 PM
2	Dog Parks	12/17/2021 9:21 AM
3	Clean air is very important--free of chemicals beyond the obvious smoke and fragrances.	12/16/2021 8:17 PM
4	Metra Trains not stopping at Main on Weekdays requiring transfer at Davis either North or South require extra step climbing. This change took place on last schedule. Central and Main or isolated to make public train easy and safer from connecting to another train.	12/16/2021 6:49 PM
5	Recycling and garbage pickup	12/15/2021 1:36 PM
6	Good job	12/14/2021 10:45 AM
7	Library, city goverment, volunteer in MRC	12/10/2021 4:36 PM
8	Human Resource Service	12/10/2021 12:09 PM
9	Enforce sidewalk snow clearance rules so I can go to/from grocery, doctors, etc. Stop snowplows blocking intersections with materials gathered from streets.	12/9/2021 6:06 PM
10	Library, senior and youth services (just couldnt select them because they werent my top three choices)	12/9/2021 5:27 PM
11	Levy Center	12/9/2021 2:58 PM
12	BECAUSE THEY ARE SYSTEMATICALLY COST PROHIBITIVE. I WANT A WEBSITE LIKE THE CITY OF CHICAGO WEBSITE JUST BEFORE MAYOR LIGHTFOOT GOT ELECTED AND 24 HR. 211 OPERATORS. INSTEAD OF VOICEMAILS AND IGNORED EMAIL REQUESTS .	12/8/2021 8:02 PM
13	I use the sidewalks when they are available. As long as there are parts of the city without sidewalks, you are failing me.	12/8/2021 3:09 PM

City of Evanston ADA Transition Plan Update Survey

14	311 Center	12/8/2021 2:35 PM
15	Youth programs, Downtown Evanston, MDM, Central Street	12/6/2021 8:25 AM
16	Beaches, city website for information, etc.	12/3/2021 8:21 PM
17	farmer's market	12/2/2021 10:03 PM
18	I have the benefit card which helps me pay for Lyft if I'm unable to drive.	12/2/2021 9:44 PM
19	Levy Senior Center; James Park; Lakefront Parks; Library; Public transit	12/2/2021 9:24 PM
20	Northshorevillagenerwork	12/2/2021 8:52 PM
21	public schools. I wish my local school had elevators	12/2/2021 7:28 PM
22	The gift of music from Northwestern. The gift of storytellers from the library	12/2/2021 5:47 PM
23	Have appreciated the Community Outreach worker who helped a relative of mine.	12/2/2021 5:38 PM
24	The Central St train station needs an elevator for so many going to 1000 Central bldg for PhysTher & medical appts	12/2/2021 5:28 PM
25	Health Department: Vaccination Clinics	12/1/2021 9:48 PM
26	Snow removal	12/1/2021 4:41 PM
27	CTA stops need to be more accessible	12/1/2021 4:13 PM
28	Please improve the violence prevention and victim services; add mobile crisis response	11/30/2021 5:31 PM
29	Day care outside of Evanston	11/24/2021 9:32 PM
30	The purple line needs an elevator. The CTA/City of Evanston need to clear bus stops in the winter.	11/24/2021 2:09 PM
31	All of the above	11/22/2021 11:54 AM
32	Schools	11/19/2021 10:35 AM
33	Our sidewalk network is highly unrecognized and needs to be prioritized and maintained.	11/19/2021 9:42 AM
34	Transit 4 All	11/19/2021 8:59 AM
35	beach pass, fire/police, parks	11/19/2021 7:51 AM
36	Walking on Crown Center path above rink	11/18/2021 5:45 PM
37	In the name of equity and accessibility to our public resources, I appreciated the extension of free beach days this summer.	11/18/2021 11:05 AM

Q10 How often do you use the City's website?

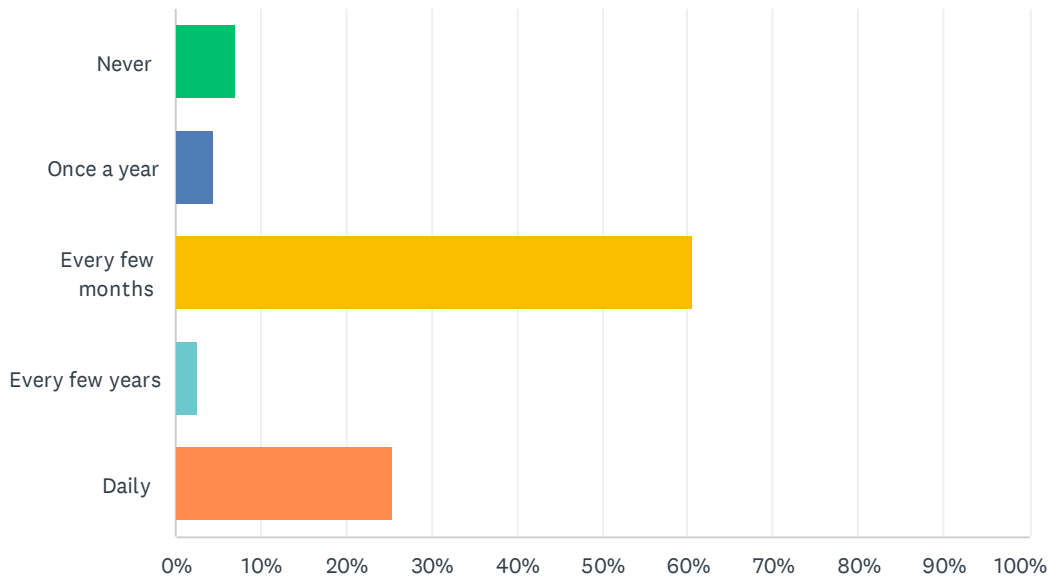Answered: 157 Skipped: 7



ANSWER CHOICES	RESPONSES	
Never	7.01%	11
Once a year	4.46%	7
Every few months	60.51%	95
Every few years	2.55%	4
Daily	25.48%	40
TOTAL		157

Q11 What online services would you like to have provided that are currently not available?

Answered: 52 Skipped: 112


#	RESPONSES	DATE
1	The website needs to be cleaned up, updated, made easier to browse & search—then adapted for low vision & blind.	12/17/2021 5:29 PM
2	I assume choice 4 in the previous question intended to say "Every few weeks" not "Every few years". Online registration for Levy classes is really foggy.	12/17/2021 12:32 PM
3	311 app	12/17/2021 6:47 AM
4	Expanded parking passes for residents ineligible for parking stickers. There's only permit parking in my neighborhood, but my address is ineligible for parking permits. My family can't have guests visit by car or a second car as a result. Just because my building has a parking lot doesn't mean that there are spaces for residents (it's all reserved parking for only half the units).	12/16/2021 5:46 PM
5	A way to request crosswalk repainting/better signage	12/15/2021 1:36 PM
6	no	12/15/2021 10:35 AM
7	city	12/15/2021 10:27 AM
8	no	12/15/2021 10:21 AM
9	I am not shure	12/14/2021 10:47 AM
10	Happy job	12/14/2021 10:45 AM
11	Not part of the park district	12/14/2021 10:41 AM
12	Online classes	12/14/2021 10:30 AM
13	Use weekly (but not a choice above)	12/10/2021 4:36 PM
14	2nd Ward Zoom Meetings	12/10/2021 12:09 PM
15	Levy Senior Center online services	12/10/2021 6:25 AM
16	I want to see a full report of EPD's activities, including how many tickets they write for each type of violation	12/9/2021 8:11 PM
17	local news and events on Google ; do not use Facebook	12/9/2021 7:30 PM
18	ask a question and have it answered	12/9/2021 6:35 PM
19	More advice on recycling electronics, etc. Detailed directions on how to get to recycling stations from buses.	12/9/2021 6:06 PM
20	Don't know. Perhaps a phone directory of city services.	12/9/2021 2:58 PM
21	Progress reports on ADA advancement	12/9/2021 2:35 PM
22	Now that the water bills are all online, I no longer get detailed information about my household's water usage. Why isn't that available online?	12/9/2021 9:20 AM
23	Website that works for sight impaired,more 311 hours	12/9/2021 3:41 AM
24	I'd like to have staff phone numbers which go directly to the person I am trying to get to rather than 311	12/8/2021 10:09 PM
25	PLEASE SEE THE ANSWER FOR QUESTION 9.	12/8/2021 8:02 PM
26	A weekly update on how the city is addressing the problem of lack of sidewalks in many	12/8/2021 3:09 PM

City of Evanston ADA Transition Plan Update Survey

	neighborhoods.	
27	no	12/7/2021 11:06 AM
28	updates of sidewalks cleared (or not cleared)of snow for accessibility to folks on scooters or wheelchairs.	12/4/2021 2:01 PM
29	Can't think of any!	12/3/2021 8:21 PM
30	Can't think of one	12/3/2021 1:24 PM
31	Make ALL ward/council meetings available on zoom.	12/3/2021 10:59 AM
32	Is there an "ask a city employee a question" function? Sort of an online 311. Questions and answers could be posted. Also, a problem solving function, a resident can write in for advice, like what should I do about a noisy neighbor, and city employee who is a good problem solver that keeps everyone's interest in mind would answer. Not involving the police. Sort of an Evanston advice column, like Ann Landers.	12/2/2021 10:03 PM
33	Up to date local news and a central place for any outages.	12/2/2021 9:44 PM
34	Evanston emergency services. Caregivers	12/2/2021 8:52 PM
35	Crime alerts. I am gay and afraid of Evanston tolerance of mentally ill, criminal anti-GLBT Evanston residents	12/2/2021 7:38 PM
36	It does not provide resource referrals for domestic and or gender based violence	12/2/2021 7:28 PM
37	can't think of any at the moment	12/2/2021 6:18 PM
38	Champaign uses a method on sidewalks that is worth emulating.	12/2/2021 5:38 PM
39	nothing	12/2/2021 1:52 PM
40	Would love City Council Meeting notes and agendas to be more accessible, easier to navigate.	12/2/2021 10:04 AM
41	Access to actual staff not via 311	12/1/2021 11:49 PM
42	Facial recognition to pay for things...the current way is sometimes too cumbersome	12/1/2021 9:46 PM
43	senior activity	12/1/2021 9:20 PM
44	b	12/1/2021 5:32 PM
45	A feedback form and online complaint process - it's not just something needed for EPD.	11/30/2021 5:31 PM
46	Progress / schedule updates and visuals of key proposals such as ADA Plan, 5th Ward Tiff plan, city staff thinking about Morton Civic Center & large city owned vacant property, etc. Heads up notice online, then followed by hard copy fliers in mailbox; include progress of ADA plan & it's implementation schedule.	11/24/2021 9:32 PM
47	More easily and readily available contact information. It's not always easy trying to find contact information for a specific department, and the format could be standardised for each subpage (so it's easy to know if contact information is available/unavailable)	11/24/2021 1:21 PM
48	Better resources on parks and their amenities; more information on locations with accessible facilities; better-updated information on fire stations and the fire department in general	11/24/2021 12:31 PM
49	Order guest parking passes (maybe already can!)	11/22/2021 11:54 AM
50	Registering for FREE handicapped street parking without the threat of parking tickets.	11/18/2021 8:42 PM
51	All facilities described on the city website should have an accessibility statement (e.g., are there elevators in the building, etc.); as it stands, each facility needs to be called to determine if it's accessible prior to visiting.	11/18/2021 7:24 PM
52	I would like to see a description on the city's homepage of the reason behind every neighborhood warning siren. Recently, I had called the local fire department to ask what they were warning us, and was told they didn't know. I had checked the city's website and twitter and I'm signed up for emergency emails. I was disappointed that is was so hard to find clarity on this.	11/18/2021 11:05 AM

Q12 Rate the City's efforts in providing accessible programs, services, and activities (1 being poor to 5 being excellent).

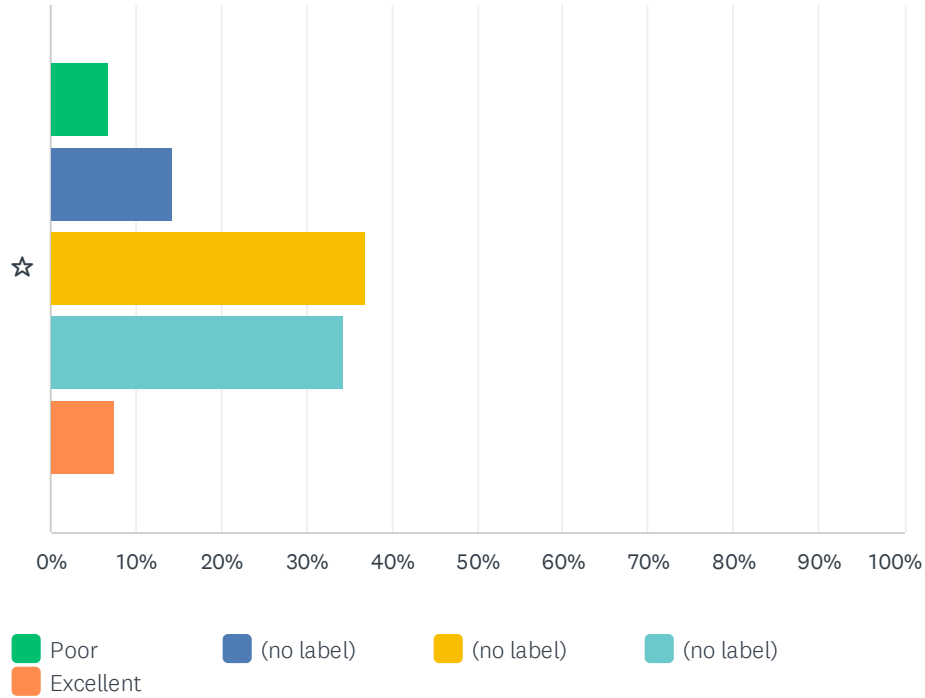
Answered: 146 Skipped: 18



	POOR	(NO LABEL)	(NO LABEL)	(NO LABEL)	EXCELLENT	TOTAL	WEIGHTED AVERAGE
☆	6.85% 10	14.38% 21	36.99% 54	34.25% 50	7.53% 11	146	3.21

Q13 Rate the City's efforts in providing an accessible website (1 being poor to 5 being excellent).

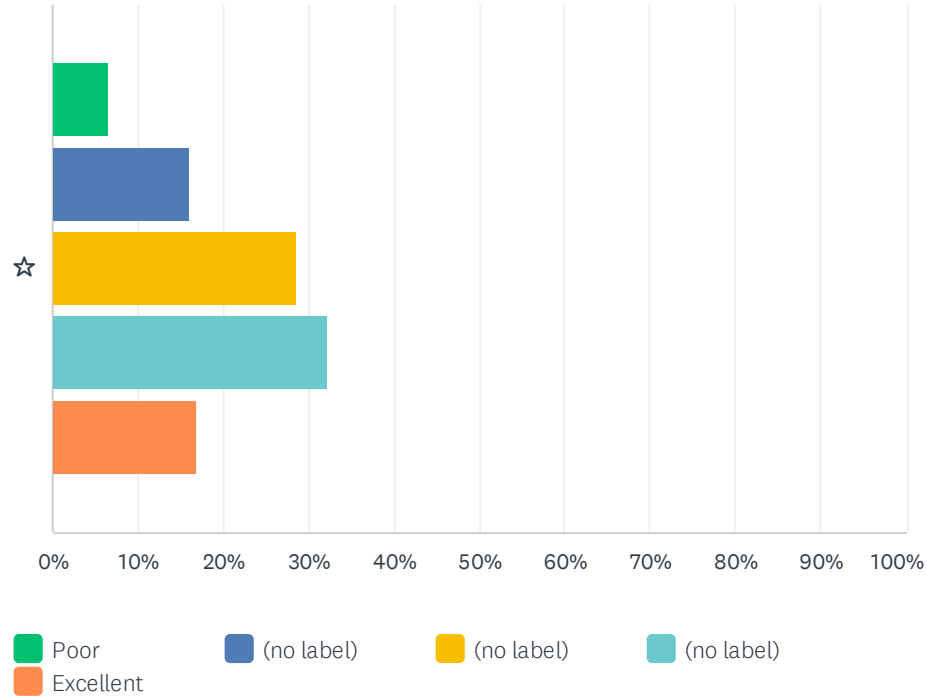
Answered: 137 Skipped: 27



	POOR	(NO LABEL)	(NO LABEL)	(NO LABEL)	EXCELLENT	TOTAL	WEIGHTED AVERAGE
☆	6.57% 9	16.06% 22	28.47% 39	32.12% 44	16.79% 23	137	3.36

Q14 Rate the City's efforts in providing accessible city-owned buildings (1 being poor to 5 being excellent).

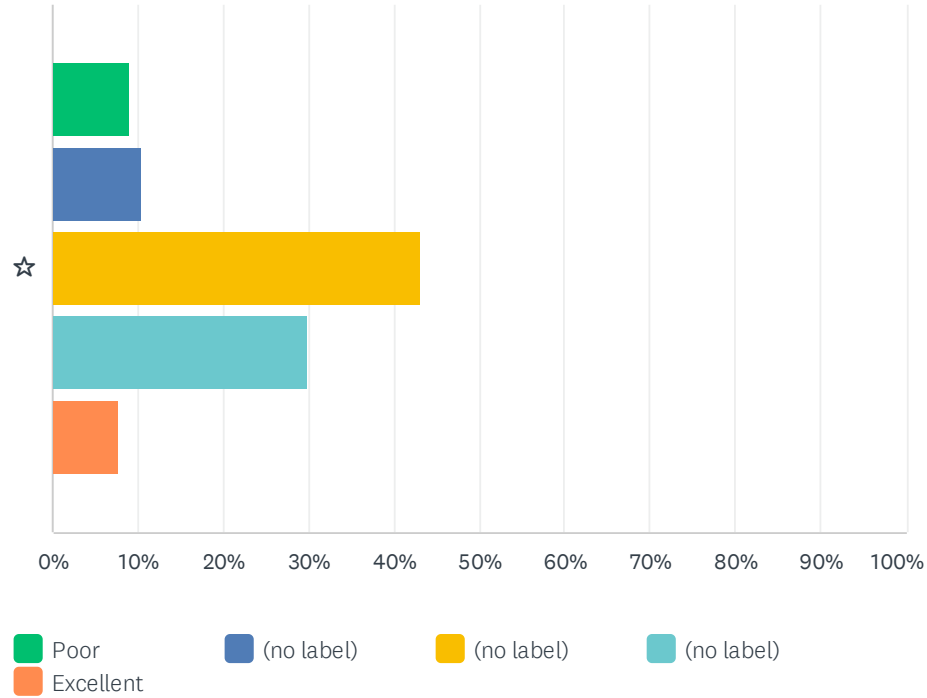
Answered: 144 Skipped: 20



	POOR	(NO LABEL)	(NO LABEL)	(NO LABEL)	EXCELLENT	TOTAL	WEIGHTED AVERAGE
☆	9.03% 13	10.42% 15	43.06% 62	29.86% 43	7.64% 11	144	3.17

Q15 Rate the City's efforts in providing accessible parks (1 being poor to 5 being excellent).

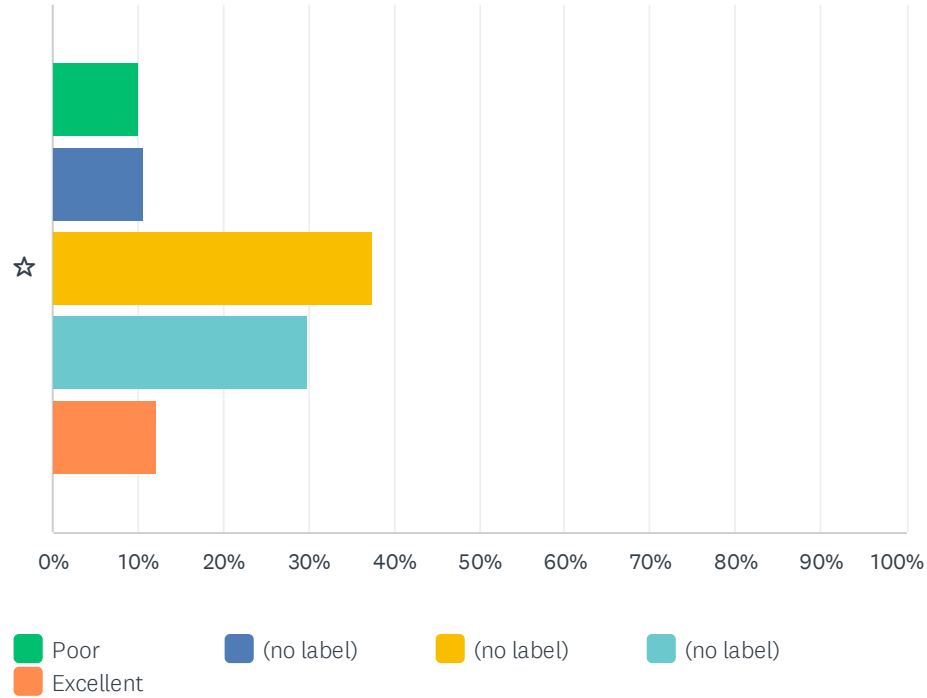
Answered: 141 Skipped: 23



	POOR	(NO LABEL)	(NO LABEL)	(NO LABEL)	EXCELLENT	TOTAL	WEIGHTED AVERAGE
☆	9.93% 14	10.64% 15	37.59% 53	29.79% 42	12.06% 17	141	3.23

Q16 Rate the City's efforts in providing accessible rights-of-way (1 being poor to 5 being excellent).

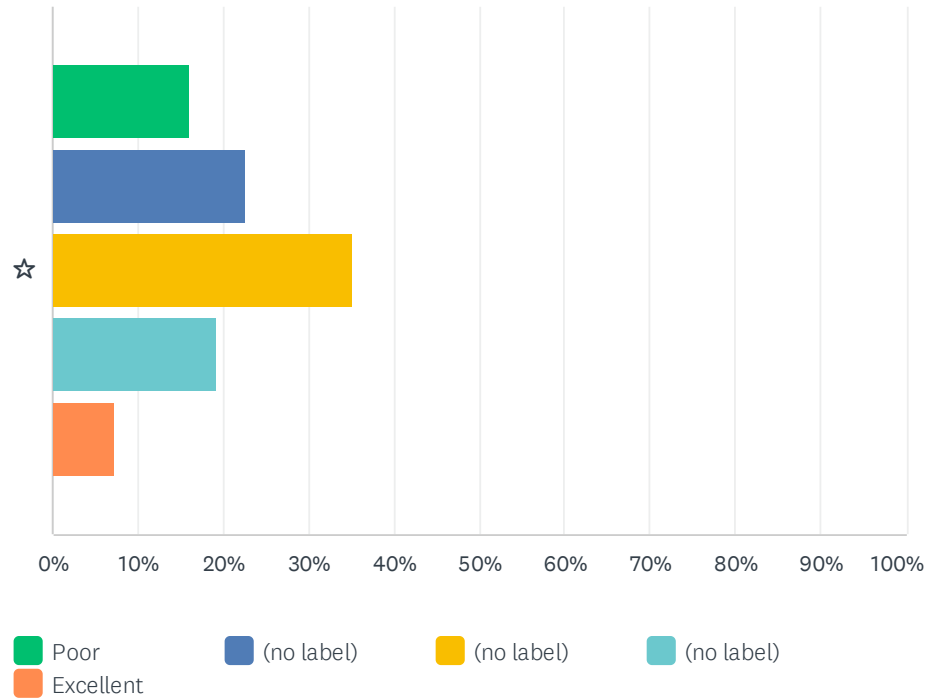Answered: 151 Skipped: 13



	POOR	(NO LABEL)	(NO LABEL)	(NO LABEL)	EXCELLENT	TOTAL	WEIGHTED AVERAGE
☆	15.89% 24	22.52% 34	35.10% 53	19.21% 29	7.28% 11	151	2.79

Q17 What could the City do that's impactful to show the City is serious about its commitment to ADA compliance?

Answered: 107 Skipped: 57

#	RESPONSES	DATE
1	Establish an ongoing panel of accessibility advisors — representing a variety of disabilities (including low vision).	12/17/2021 5:29 PM
2	Audible stop lights.	12/17/2021 12:32 PM
3	update access at bus stops	12/17/2021 9:21 AM
4	Benches, on the street rest-somewhere to sit when walking and become fatigued	12/16/2021 11:31 PM
5	What is ADA?	12/16/2021 8:50 PM
6	Create ADA compliant stations at Metra and L Train locations. It's decrepit and completely inaccessible to handicapped persons at multiple locations.	12/16/2021 8:29 PM
7	Just do it.	12/16/2021 8:17 PM
8	Provide benches at bus stops. It is very hard for people to stand for 30 minutes between buses.	12/16/2021 6:07 PM
9	Make the disabled parking spaces closer to the block meter boxes.	12/16/2021 5:44 PM
10	Don't pile snow on crosswalks.	12/15/2021 4:48 PM
11	Fix the cracked and bumpy sidewalks	12/15/2021 1:36 PM
12	no	12/15/2021 10:35 AM
13	go away.	12/15/2021 10:27 AM
14	no idea	12/15/2021 10:21 AM
15	more street work.	12/14/2021 10:47 AM
16	Happy	12/14/2021 10:45 AM
17	Try to make it more accessible so people with disabilities so can move around easily.	12/14/2021 10:41 AM
18	Provide support for people with disabilities according to metra transportation	12/14/2021 10:30 AM
19	Stop cars and trucks from parking on sidewalks and on or near crosswalks.	12/13/2021 8:11 AM
20	Snow clearing in winter including Curb cuts and fining non-compliant residents and businesses quickly. Or doing the clearing and charging it back.	12/12/2021 12:37 PM
21	Stop the plow trucks from blocking sidewalks with snow. Why must snow be accumulated on cut corners and uncut corners are clear?	12/12/2021 7:46 AM
22	better public transportation for disabled. As a home health nurse I frequently meet patients at their care providers appointments and it is VERY difficult for those patients dependent on public transportation (Wheelchair bound) to arrive at their appointments on time, even when they allow plenty of time. They use public, and Pace paratransit.	12/10/2021 4:36 PM
23	Make the business districts well-rounded. Encourage diverse small businesses to open.	12/10/2021 12:57 PM
24	Additional 311 services.	12/10/2021 12:09 PM
25	Get planned projects done, done well and within budgeted costs	12/10/2021 6:25 AM
26	Accessible parking near the entrance to the Robert Crown Community Center/Library. Drive-up drop box so that library materials can be returned by driver without having to park or exit vehicle. Curbside pickup for library materials, with designated waiting spot.	12/10/2021 1:58 AM

City of Evanston ADA Transition Plan Update Survey

27	Ban leaf blowers so that people can breathe. Take air quality seriously. Take noise pollution seriously. Educate local property managers and landscapers about alternative methods of leaf removal, and provide incentives for non-polluting, non-noisy methods. Set sensible noise limits. Stop CAUSING disabilities such as hearing loss and asthma.	12/9/2021 8:11 PM
28	Put pressure on CTA to update Evanston L station	12/9/2021 8:03 PM
29	Coordinate with RTA to create handicap access at Main and Central El stops	12/9/2021 7:30 PM
30	No one has addressed the problems for wheel chair users that must exit a van on streets with bike lanes. Either exit into the street and oncoming traffic or exit into a bike lane, unable to reach a curb, and travel to the end of the block where there may be a cutout. A ramped van cannot park and extend all the way over and across a bike lane to the curb!!	12/9/2021 7:17 PM
31	All methods of transit need to be accessible. All stop lights and cross walks need speakers and accessibility for the blind.	12/9/2021 6:43 PM
32	The sidewalks and crosswalks are not ADA accessible. We live near central street and it's so difficult to cross Green Bay Road.	12/9/2021 6:26 PM
33	Clear the snow barriers thrown up by snowplows at intersections.	12/9/2021 6:06 PM
34	Not silo this as a separate issue. Would love to see them being thoughtful about disability by default, and take accommodations for disabled neighbors into account by default in every decision they make. To make this happen, there would need to be better education overall on disability rights and advocacy provided to decision makers. Also decision making should always include disabled stakeholders	12/9/2021 5:27 PM
35	Check city sidewalks that need repair. Check street and alley entrances for bushes that need to be trimmed back!	12/9/2021 2:58 PM
36	Conform to the latest compliance protocols!	12/9/2021 2:35 PM
37	Work with CTA to make Evanston stations accessible. I commuted on the Purple line for decades, but can no longer do the stairs at Central St. To use public transportation now, I have to take the bus to Howard (since the Davis St. elevator doesn't always work). With Evanston Hospital at Central, that CTA station should be made fully accessible ASAP!	12/9/2021 9:20 AM
38	Move the Civic Center so it is easier to access	12/9/2021 8:37 AM
39	Enforce no parking across sidewalks and crosswalks! Make intersections more pedestrian safe. Public transportation is also very lacking.	12/9/2021 7:16 AM
40	Sidewalk maintenance	12/9/2021 6:43 AM
41	A button on homepage banner for ADA help	12/9/2021 3:41 AM
42	Make all public transport facilities wheelchair accessible platforms! (buses, trains, and Els)	12/9/2021 1:28 AM
43	Create comprehensive 3-5-10 year plan to meet the ADA needs, have an ada site on the city site where residents contribute to to identify needs. Then budget money to make it happen to make sure it is implemented.	12/8/2021 10:09 PM
44	RACIST WORST TRANSPORTATION SYSTEM AND THE HIGHEST TAXES IN THE NATION BEING STRANDED FROM 2-30- 6:30 AM. NO AFFORDABLE/ SUBSIDIZED/ SECTION 8 HOUSING/ VOUCHERS NO BENCHES-TOUTUROUS AND SADISTIC TO THE ELDERLY AND INFIRMED.NO BENCHES/ FEW BUS SHELTERS I LEAN ON POLES AND SIT ON BASES OF POLES WITH SIGNS AND ON CONCRETE. I SAW A SENIOR SITTING ON THE CURB FOR HER TAX DOLLAR. YOU DON'T HAVE AND BENCHES/ SHELTERS BECAUSE YOU HATE HOMELESS PEOPLE WELL POLITICAL SOCIOPATHS STOP MANUFACTURING HOMELESS PEOPLE ! I AM FORCED TO LEAN ON POLES AND SIT ON CEMENT BASES OF POLES FOR SIGNS , WINDOW SEALS. THIS IS IS SADISTIC TO THE ELDERLY AND INFIRMED. I DON'T WANT TORTURE BENCHES. INSTEAD ABOLISH THE POLITICAL SOCIOPATHS THAT MANUFACTURE UNHOUSED TAXPAYING CITIZENS . CTA DELAYS ENSURE YOU MISS THE LAST TRAIN. CTA DELAYS TRAINS JUST OUTSIDE THE HOWARD STATION AND WON'T HOLD THE LAST PURPLE LINE TRAIN PASSAGERS ! WE DEMAND A 24 HR TRANSPORTATION SYSTEM FOR THE HIGHEST TAXES IN THE NATION: https://www.americanbar.org/groups/crsj/publications/human_rights_magazine_home/human_r	12/8/2021 8:02 PM

City of Evanston ADA Transition Plan Update Survey

ghts_vol34_2007/summer2007/hr_summer07_brenma/ <https://kinder.rice.edu/2017/02/08/new-study-examines-how-historic-racism-shaped-atlantas-transportation-network>
<https://www.rvarapidtransit.org/blog/segregation-by-transportation>
<https://project.wnyc.org/backofthebus/> <https://slate.com/news-and-politics/2015/02/americas-transportation-system-discriminates-against-minorities-and-poor-federal-funding-for-roads-buses-and-mass-transit-still-segregates-americans.html>
<https://www.npr.org/2020/07/05/887386869/how-transportation-racism-shaped-america>
<https://www.sciencedirect.com/science/article/abs/pii/S0166046218301066>
<https://chi.streetsblog.org/2020/01/21/how-chicagos-legacy-of-segregation-has-pushed-black-people-into-transit-and-job-deserts/> <https://cmt-stl.org/public-transit-as-a-tool-for-reducing-urban-segregation/> <https://www.reimaginerpe.org/node/308> WE WANT TRANSIT EQUITY:
<https://utc.uic.edu/research/deficiencies-in-public-transit-accessibility-of-healthcare-facilities-in-chicago/> <https://onlinelibrary.wiley.com/doi/full/10.1111/cag.12708> <https://www.metro-magazine.com/10112340/chicago-regions-transportation-fails-people-with-disabilities-seniors-study> <https://trid.trb.org/view/1722200>
<https://www.chicagotribune.com/business/transportation/cta-biz-disabled-transit-accessibility-cta-metra-pace-getting-around-20191202-vjbrsr6lengqhkugadewrzepre-story.html>
<https://www.wbez.org/stories/report-fragmented-transit-system-shortchanges-some-in-chicago-region/1bf86bbc-1e16-4e59-85e7-007863612897>
https://www.metroplanning.org/work/project/43?utm_source=%2fUniversalMobility&utm_medium=web&utm_campaign=redirect
<https://www.elevatedchicago.org/>
<https://chicago.suntimes.com/platform/amp/2017/6/12/18320616/chicago-youth-jobs-report-highlights-need-for-better-public-transit>
<https://journals.sagepub.com/doi/abs/10.1177/0308518X211047872>
<https://www.planning.org/planning/2018/feb/inclusivemobility/> <https://nextcity.org/urbanist-news/how-chicago-could-build-equity-into-transportation> <https://www.cnt.org/transportation-equity-network> <https://voorheescenter.red.uic.edu/wp-content/uploads/sites/122/2017/10/2009-transit-equity-matters.pdf> <https://chi.streetsblog.org/2021/05/01/cmap-analyzes-equity-impact-of-transportation-fees-fines-and-fares/> <https://jmbarras.com/tag/mobility-justice/>
<https://sharedusemobilitycenter.org/mobility-hub-news-summit-speakers-the-new-mobility-justice-spotlight/> <https://chi.streetsblog.org/2021/08/03/a-closer-look-at-cdot-plans-to-close-chicagos-transportation-equity-gap/> <https://www.metroplanning.org/work/project/47>
<https://www.metroplanning.org/news/8913/Mobility-is-Justice-Centering-equity-in-transportation-planning> <https://chicagopolicyreview.org/2020/04/03/how-cities-model-transit-equity/>
<https://www.ideals.illinois.edu/handle/2142/105537>
<https://www.smartcitiesdive.com/news/chicago-equity-transit-oriented-development-plan/585317/> <https://www.worldtransitresearch.info/research/8060/>
<https://www.vtpi.org/equity.pdf> <https://ascelibrary.org/doi/abs/10.1061/9780784483541.038>
<https://www.wbez.org/stories/chicago-releases-equity-focused-strategic-plan-for-transportation/46557ed4-5a7b-4bf3-a97a-f6e39396be67> <https://www.ef.org/story/paving-an-equitable-transportation-path-in-the-midwest/> <https://equitycaucus.org/about-equity-caucus/our-partners> https://scholar.google.com/scholar_url?url=https://api.taylorfrancis.com/content/books/mono/download%3FidentifierName%3Ddoi%26iidentfierValue%3D10.4324/9780815377047%26type%3Dgooglepdf&hl=en&sa=X&ei=096rYZHZHobmyQSw5K_oDA&scisig=AAGBfm1gQ9o9jCvV84nAaEXea2bcTNjclg&oi=scholar
<https://chi.streetsblog.org/2020/12/19/atas-transit-justice-talk-discussed-the-relationship-between-transit-deserts-and-food-insecurity/>
https://www.cnt.org/sites/default/files/publications/CNT_TransitDesertsCookCounty_0.pdf
https://www.researchgate.net/publication/277583023_Transit_Deserts_The_Gap_between_Demand_and_Supply <https://blog.rtachicago.org/2021/10/05/oboi-reed-calls-on-the-transit-system-to-reckon-with-racial-equity-and-mobility-justice/> <https://podcasts.apple.com/us/podcast/s2-ep-1-olatunji-oboi-reed-mobility-justice-in-chicago/id1494325835?i=1000496666138>
<https://chi.streetsblog.org/2020/01/28/mobility-justice-leaders-we-need-to-look-at-whos-in-the-room-when-planning-is-happening/> <https://blockclubchicago.org/2021/05/18/moving-freely-exhibit-at-west-side-mini-museum-explores-how-transportation-access-impacts-racial-equity/>
<https://youtu.be/kiSk03rfUU> <https://www.equiticity.com/oboi>
<https://www.accessliving.org/newsroom/policy-positions-and-legal-cases/access-living-issues-public-comment-increased-law-enforcement-is-not-a-cure-all/> <https://equitycaucus.org/about-equity-caucus/our-partners> <https://www.cnt.org/events/mobility-justice-in-chicago-ending-racialized-enforcement-inequities> <https://www.metroplanning.org/multimedia/video/984>
https://books.google.com/books?id=veArDwAAQBAJ&pg=PT165&lpg=PT165&dq=chicago+mobility+justice+and+transit+desert&source=bl&ots=qTK3_MIWXP&sig=ACfU3U3_QsyMQgu0kdTKpWHW_kLIDMTJcQ&hl=en&

City of Evanston ADA Transition Plan Update Survey

sa=X&ved=2ahUKEwjDrKWWjcv0AhW9lIkEHQavBQE4FBD0AXoECB0QAQg
<https://archive.curbed.com/2020/7/2/21308773/ayanna-pressley-free-transit-equity> Artfully Gifted is a 501c3 nonprofit organization that supports and promotes artists with disabilities. The organization provides an avenue for disabled artists to show and sell their work. Artfully Gifted is currently located at the Illinois Center for Rehabilitation and Education at Roosevelt (ICRE-R) in Chicago. I seen CTA drivers pass up wheelchair-bound disabled tax pay citizens on Western Avenue late at night. <https://chi.streetsblog.org/2021/03/03/food-mobility-justice-advocates-join-forces-at-the-chicago-food-justice-summit/>
<https://www.chicagotribune.com/columns/ct-transit-deserts-met-20140804-column.html>
<https://www.wbez.org/stories/closing-the-gap-on-transportation-solving-transit-deserts/70a805d1-d514-4be6-94a3-7ffc493070f2>
<http://uchicagogate.com/articles/2014/10/31/watering-the-deserts-how-transit-future-can-connect-400000-chicago-residents/> <https://www.citytech.org/students-develop-new-solutions-to-increase-public-transit-usage> <https://www.transitdeserts.org/>
<https://minds.wisconsin.edu/handle/1793/78984>
<https://www.eventscribe.net/2021/ICTDPavements21/fsPopup.asp?Mode=presInfo&PresentationID=870836> <https://www.itskrs.its.dot.gov/node/209295>
<https://www.chicagobusiness.com/crains-forum-transportation/transit-deserts-limit-job-prospects> <https://www.linkedin.com/pulse/amorita-falcon-chicagos-transit-desert-mirage-james-o-shea> <https://www.vox.com/2015/8/10/9118199/public-transportation-subway-buses>
<https://news.wttw.com/2021/04/06/federal-funds-seen-key-reviving-public-transit>
<https://www.builtinchicago.org/2020/08/11/lyft-1m-free-rides-covid19-racial-justice>
<https://qz.com/2048165/american-cities-are-experimenting-with-free-public-transit/>
<https://www.nytimes.com/2020/01/14/us/free-public-transit.html>
<https://www.cnbc.com/2020/03/02/free-public-transportation-is-a-reality-in-100-citiesheres-why.html> <https://www.wvlp.com/news/state-politics/mayor-michelle-wu-introduces-fare-free-public-transportation/> <https://cities-today.com/what-benefits-can-cities-expect-from-fare-free-transport/> <https://sustainablemobility.iclei.org/free-public-transportation/>
<https://youtu.be/feCQPD9DSOA>
<https://www.washingtonpost.com/transportation/interactive/2021/public-transportation-free-fare-future/> <https://theappeal.org/public-transportation-should-be-free/>
<https://mobile.twitter.com/peopleformj> <https://youtu.be/feCQPD9DSOA>
<https://youtu.be/kiSk03rfUU>

45	Keeping the sidewalks and crosswalks clear in any weather.	12/8/2021 4:11 PM
46	Provide sidewalks on every block, both sides of the street, everywhere in the city. It is unfathomable that we have space for cars that are very expensively maintained and inaccessible for many with disabilities while we don't have space for pedestrians and people who need assistive mobility devices.	12/8/2021 3:09 PM
47	Enforce the no biking rule on sidewalks in downtown Evanston and other business districts. They are a menace to all but especially folks with limited mobility. Paved pathways in the parks.	12/8/2021 2:35 PM
48	The cracks in the park are hard everyone and make people trip and there are too many sticks. The restaurants could be more accessible.	12/7/2021 11:06 AM
49	Engage with groups like Access for third party validation or improvement of current practices.	12/6/2021 8:25 AM
50	You got rid of the Inclusion Specialist position in 2010 to save money but never took the work that person did seriously. The person knew the ADA better then anyone because they had a disability and knew what was needed. But Accessibility has never been a priority in many areas of the city	12/5/2021 2:14 PM
51	Keep sidewalks in excellent repair.	12/4/2021 2:01 PM
52	(1) Accessible curb cuts where they don't currently exist, (2) more accessible crosswalks - especially those that are not at controlled intersections, (3) extending the sidewalk on the east side of Dodge across McCormick to provide an accessible right-of-way to the North Channel Trail and Ladd Arboretum.	12/3/2021 8:21 PM
53	Don't block crosswalks when snow plowing. Clear them. I am 81 and walk, don't drive, and snow and ice confine me to home. Enforce removal of snow and ice on private property.	12/3/2021 4:49 PM
54	fix sidewalks	12/3/2021 1:24 PM
55	Replace bus shelters, ensure some access during construction when replacing sidewalks at all	12/3/2021 12:31 PM

City of Evanston ADA Transition Plan Update Survey

	four corners of intersections	
56	Add ASL interpreters to meetings.	12/3/2021 10:59 AM
57	Provide accessible paths/ beach entrances at Lee or South Blvd. Provide accessible public transportation, i.e, Purple line station for the neighborhoods south of Downtown.	12/2/2021 10:39 PM
58	Have local community members who knowledge and experience in this area, e.g., physical therapist	12/2/2021 10:05 PM
59	The city could have representatives and average people with disabilities rate the various settings, activities every 6-12 months. Eg, include people with limited vision, hearing impaired, wheelchair bound, walking impaired, emotionally impaired, intellectually impaired people do a periodic evaluation. That way, facilities and services can be constantly improved.	12/2/2021 10:03 PM
60	Give regular updates on social media.	12/2/2021 9:44 PM
61	Publicize and record events in which people with a variety of disabilities would "test" various parks, buildings, intersections, etc., for Accessibility. Publicize the "test"results and set priorities and completion dates for improvements.	12/2/2021 9:24 PM
62	Stop allowing harassing criminals to line up in front of out groceries, coffee shops, PHARMACIES! They are threats to our GLBT, elderly communities. .	12/2/2021 7:38 PM
63	Mental health and social services by professionals not police available through something like a 311. Many people with disabilities can get where they need to be and access basic medical care but they do not have equal access to the kinds of things that raise their quality of living. Many people rely on opioids for pain management not as a first choice but because their insurance doesn't cover other things that help keep it manageable such as acupuncture, ongoing physical therapy, massage therapy, or cannabis. I doubt the city can move insurance providers but perhaps we could subsidize these costs. If we don't already have it, I would also love to see grants for home remodels to make living spaces more accessible. It would be especially meaningful if these could apply to costly mobile equipment that renters need.	12/2/2021 7:28 PM
64	Provide FREE motorized rides to any person over 70 by E-Mailing or calling 311 to be picked up and driven anywhere from Chicago loop to Waukegan to Shaumburgh and back by calling. In Evanston also available to and from destination.	12/2/2021 7:08 PM
65	This is best answered by someone who needs accommodations.	12/2/2021 6:18 PM
66	Please update bathrooms at the lake side parks.	12/2/2021 5:47 PM
67	Improve sidewalks	12/2/2021 5:38 PM
68	Fix sidewalks in residential neighborhoods that are broken or uneven.	12/2/2021 5:36 PM
69	Sinking and uneven sidewalk resurfacing in those residential areas where large trees had been removed.	12/2/2021 5:36 PM
70	Work with CTA/RTA to keep elevators accessible via code entered by on-duty CTA/RTA clerk - - keep vagrant poopers OUT of elevators (not disabled, no kid strollers, no walkers=NO ADMITTANCE TO ELEVATOR AT ANY TIME)	12/2/2021 5:28 PM
71	How about even talking about accessibility every time we talk about DEI? It does not appear to be on the radar of anyone at the City. People with disabilities are not ever discussed in Evanston, especially those who have so-called invisible disabilities.	12/2/2021 5:23 PM
72	Parking. I have mobility problems and cannot walk easily or quickly to the pay boxes. I am shopping in other communities to avoid this problem.	12/2/2021 5:11 PM
73	Better curb ramps downtown. Business license should be dependent on ADA compliance. It's impossible to get in/out of Chipotle, many other businesses downtown. Why is that allowed?	12/2/2021 5:29 AM
74	Insure accessible doors to restaurants etc.	12/1/2021 11:49 PM
75	Improve the ability to walk safely in my neighborhood.	12/1/2021 9:48 PM
76	Helping those with disabilities who desire to work--this doesn't get the attention that sidewalks, parks, etc. receive and in many ways it's the most important.	12/1/2021 9:46 PM
77	?	12/1/2021 9:20 PM

City of Evanston ADA Transition Plan Update Survey

78	This survey is an excellent start. Compiling the results and taking action is important.	12/1/2021 5:11 PM
79	Fix broken sidewalks Push button walk signals	12/1/2021 4:41 PM
80	Make more crosswalks and fix broken sidewalks and alleyways.	12/1/2021 4:13 PM
81	Provide alternative formats for visual presentations	12/1/2021 3:03 PM
82	No matter what the final work will be, keep this in the public eye. Provide signage as work is progressing and after it's completed, as well. Once installed this type of work becomes invisible and taken for granted.	11/30/2021 7:30 PM
83	Include accessibility options for all City events; add an ASL interpreter at council meetings; keep hybrid public meeting options - these have been so helpful for people with all sorts of disabilities; help nonprofit organizations with funding to retrofit their entrances on old buildings.	11/30/2021 5:31 PM
84	Do more for noise pollution in the city. As an autistic person, every time I leave my house there are leaf blowers, loud trucks, construction on every corner. There should be designated hours for these types of activities, because I can rarely leave my house without ear defenders or headphones.	11/28/2021 12:20 PM
85	Keep working on problem areas to completion following a step by step plan.	11/26/2021 2:15 PM
86	Inform & Listen; react quicker to resident's suggestions such as need for curb cuts and tactile pathways; deice key pathways / stairways with 'green' deicer material	11/24/2021 9:32 PM
87	Require that all buildings be ADA compliant vs. allowing older buildings to be grandfathered into compliance.	11/24/2021 4:57 PM
88	Make purple line accessible. Clear bus stops.	11/24/2021 2:09 PM
89	See below.	11/24/2021 1:50 PM
90	Ensuring all streetscapes are accessible	11/24/2021 1:21 PM
91	Making public meetings truly ADA accessible. Crime prevention - many of us disabled cannot drive and should not have to be accosted by panhandlers daily.	11/24/2021 12:51 PM
92	Invest in pilot programs for accessibility. Have sit-down meetings with community members that have a range of different disabilities.	11/24/2021 12:31 PM
93	Insist that all of the public transportation facilities including Purple Line stations, Metra Stations and bus stops. It is disgraceful that the stations that serve our two local hospitals are not accessible!	11/23/2021 10:14 AM
94	Commit to adding more raise crosswalks	11/20/2021 10:01 PM
95	make all sidewalks accessible improve the accessibility of the public-facing website include accessibility in discussions of all diversity and inclusion efforts ensure that the city's procurement officials understand their role in ensuring that purchase contracts for services, programs, activities, digital content, etc., include language that requires the vendor to provide an accessible product use the results of this survey to inform next steps	11/19/2021 10:35 AM
96	Sign language interpreters at city counsel meetings Prioritize pedestrians before motor vehicles, to now only allow accessibility but independence for people of limited mobility (wheel chairs, walkers, strollers, scooters). Bike lanes should be designed for accessible bikes (hand operated).	11/19/2021 9:42 AM
97	Ensure that all public transit is accessible to all riders (bus stops, train stations, sidewalks). Improve lighting for individuals who walk and use public transit. Ensure snow removal in all areas of the city. Implement traffic slowing strategies so pedestrians and public transit users are safer.	11/19/2021 8:59 AM
98	Find a better system for maintaining sidewalks. This is the most fundamental need of people with disabilities. It is currently impossible to walk anywhere in the city with a wheelchair without great difficulty.	11/19/2021 7:51 AM
99	Talk to disabled people!!!	11/18/2021 10:43 PM
100	Recognize that some disabled people rely on their cars + their mobility devices so don't penalize them with yet more costs in the form of parking tickets. Does the City know that it's	11/18/2021 8:42 PM

City of Evanston ADA Transition Plan Update Survey

	expensive enough to be mobility impaired???	
101	Keep sidewalks as clear as possible once snow starts—mobility devices will appreciate that	11/18/2021 8:27 PM
102	They Cap program at the Leavy Center. So	11/18/2021 6:45 PM
103	Fix sidewalks. Make sure every public building has a Family bathroom so caregivers can accompany family members of another sex!	11/18/2021 5:45 PM
104	Maintain accessible features so they can be depended upon (working elevators, unbroken ramps, etc). This is a general comment, not necessarily about any one City facility	11/18/2021 5:38 PM
105	Your parking system is not helpful to those who are handicapped and don't have smart phones. Too hard to find pay boxes and navigate the system. Parking garages can be easier but too far from a store. Put yourself in a wheelchair and try to navigate broken sidewalks, ramps, or bumpy walkways.	11/18/2021 5:16 PM
106	Maintain sidewalks so they are navigable for individuals that utilize wheelchairs. Enforce snow removal so that there's clear passage for persons with mobility concerns. Connect with community organizations that serve people with disabilities when completing major projects that might effect participants.	11/18/2021 3:30 PM
107	Do all of our city buildings have fire alarms that also flash to indicate the warning to our deaf and hard of hearing neighbors? I would like to see bumpy sidewalks paved promptly so that users of wheelchairs, strollers, adult walkers, and more can have smooth access to public space. Is it possible to pave a path at Clark Square between the parking lot and paved section beside the rocks? I also see accessibility as providing plenty of bike racks to support residents who depend on this transportation.	11/18/2021 11:05 AM

Q18 Please provide any other thoughts you have about ADA accessibility in Evanston or any other opinions regarding the Study.

Answered: 73 Skipped: 91

#	RESPONSES	DATE
1	Lack of sidewalks on certain streets make navigation difficult. Examples include Sherman Ave between Lake and Greenwood, and Elmwood Ave between Davis and Grove. Pedestrian buttons at crosswalks often have trashcans and planters placed right in front of them. I often see this in the Fountain Square area.	12/18/2021 7:07 PM
2	This survey seems unlikely to yield much insight. Why ask people to programs and facilities in order of importance? Why ask everyone to respond to this, whether or not they have any insight or experience with disabilities? Even from a legal perspective, it would be important to know where there are especially big frustrations or obstacles — and you won't know respondents' background from this survey.	12/17/2021 5:29 PM
3	Elevators in all buildings or anywhere with stairs	12/16/2021 11:31 PM
4	What is ADA? I did not see this spelled out anywhere on the form.	12/16/2021 8:50 PM
5	Repeating request for clean air. As someone who is chemically sensitive, many locations, especially meetings, are not accessible to me. Zoom and similar options have opened many doors previously closed to me.	12/16/2021 8:17 PM
6	Please take onto account accessible vans.	12/15/2021 4:48 PM
7	Better lit intersections (blinking lights embedded in the crosswalks are also good); street lights that face downwards in order to actually illuminate people on the ground and reduce light pollution	12/15/2021 1:36 PM
8	no	12/15/2021 10:35 AM
9	X.	12/15/2021 10:27 AM
10	no	12/15/2021 10:21 AM
11	don't know	12/14/2021 10:47 AM
12	Good	12/14/2021 10:45 AM
13	Better for people with disabilities.	12/14/2021 10:41 AM
14	Providing ramps for people with wheelchairs	12/14/2021 10:30 AM
15	Sidewalks are not safe to use when vehicles are parked on them. Crosswalks are not safe to use when vehicles are parked on them or close to them.	12/13/2021 8:11 AM
16	Some "accessible" parking spots are actually inaccessible because they have planters or bike racks in the way of opening ramps, e.g. southwest corner of Davis and Chicago. There should be someone (or two) with a disability to "test" disability access.	12/12/2021 12:37 PM
17	Clearing snow from curb ramps (see my answer to question 4 above).	12/11/2021 9:40 AM
18	Affordable access to Mental Health services.	12/10/2021 12:09 PM
19	We missed the covid vaccine clinic at the Levy Center today -- even though I had been checking email hourly for any notice. Nothing on the CoE vaccine web pages either. We are registered on the booster survey. Could the City send text messages or recorded phone calls to inform us when a clinic will happen, if we need to register for a time?	12/10/2021 1:58 AM
20	Start actually enforcing leash laws so that people can feel safe taking their children to city parks and walking down city streets. Start collecting and publishing statistics on dog bites, and set specific goals for preventing them. People with disabilities are especially vulnerable in public spaces where dog owners don't control their dogs.	12/9/2021 8:11 PM

City of Evanston ADA Transition Plan Update Survey

21	See last answer. Once again the disabled community was overlooked in preference of bikers!!!!	12/9/2021 7:17 PM
22	Clearly CTA/RTA is waiting for Evanston to help fund elevators or ramps at CTA train stations. Ridiculous that no elevator at Central/Evanston Hospital. I resent that CTA keeps trying to close Dempster Station and doesnt maintain it well.	12/9/2021 6:06 PM
23	I wish there was more info on why this is being done, and who is spearheading this effort. I would love to make sure that actually disabled professionals are working on this, I couldnt find this information anywhere so Im assuming not :(	12/9/2021 5:27 PM
24	Providing a bench to sit, stop, rest on neighborhood walks.	12/9/2021 2:58 PM
25	Excuses for prior lack of initiating changes will no longer be tolerated!	12/9/2021 2:35 PM
26	The City should share costs w/businesses seeking to remediate old structural elements!	12/9/2021 1:28 AM
27	We need to have a city bus that circulates frequently to all community buildings and transportation spots, and not just for seniors. This cost money but it would support our residents ability to use facilities and support our bus. districts.	12/8/2021 10:09 PM
28	RACIST WORST TRANSPORTATION SYSTEM AND THE HIGHEST TAXES IN THE NATION BEING STRANDED FROM 2-30- 6:30 AM. NO AFFORDABLE/ SUBSIDIZED/ SECTION 8 HOUSING/ VOUCHERS NO BENCHES-TOUTUROUS AND SADISTIC TO THE ELDERLY AND INFIRMED. NO BENCHES/ FEW BUS SHELTERS I LEAN ON POLES AND SIT ON BASES OF POLES WITH SIGNS AND ON CONCRETE. I SAW A SENIOR SITTING ON THE CURB FOR HER TAX DOLLAR. YOU DON'T HAVE AND BENCHES/ SHELTERS BECAUSE YOU HATE HOMELESS PEOPLE WELL POLITICAL SOCIOPATHS STOP MANUFACTURING HOMELESS PEOPLE ! I AM FORCED TO LEAN ON POLES AND SIT ON CEMENT BASES OF POLES FOR SIGNS , WINDOW SEALS. THIS IS SADISTIC TO THE ELDERLY AND INFIRMED. I DON'T WANT TORTURE BENCHES. INSTEAD ABOLISH THE POLITICAL SOCIOPATHS THAT MANUFACTURE UNHOUSED TAXPAYING CITIZENS . CTA DELAYS ENSURE YOU MISS THE LAST TRAIN. CTA DELAYS TRAINS JUST OUTSIDE THE HOWARD STATION AND WON'T HOLD THE LAST PURPLE LINE TRAIN PASSAGERS ! WE DEMAND A 24 HR TRANSPORTATION SYSTEM FOR THE HIGHEST TAXES IN THE NATION: https://www.americanbar.org/groups/crsj/publications/human_rights_magazine_home/human_rights_vol34_2007/summer2007/hr_summer07_brenma/ https://kinder.rice.edu/2017/02/08/new-study-examines-how-historic-racism-shaped-atlantas-transportation-network https://www.rvarapidtransit.org/blog/segregation-by-transportation https://project.wnyc.org/backofthebus/ https://slate.com/news-and-politics/2015/02/americas-transportation-system-discriminates-against-minorities-and-poor-federal-funding-for-roads-buses-and-mass-transit-still-segregates-americans.html https://www.npr.org/2020/07/05/887386869/how-transportation-racism-shaped-america https://www.sciencedirect.com/science/article/abs/pii/S0166046218301066 https://chi.streetsblog.org/2020/01/21/how-chicagos-legacy-of-segregation-has-pushed-black-people-into-transit-and-job-deserts/ https://cmt-stl.org/public-transit-as-a-tool-for-reducing-urban-segregation/ https://www.reimaginerpe.org/node/308 WE WANT TRANSIT EQUITY: https://utc.uic.edu/research/deficiencies-in-public-transit-accessibility-of-healthcare-facilities-in-chicago/ https://onlinelibrary.wiley.com/doi/full/10.1111/cag.12708 https://www.metro-magazine.com/10112340/chicago-regions-transportation-fails-people-with-disabilities-seniors-study https://trid.trb.org/view/1722200 https://www.chicagotribune.com/business/transportation/cta-biz-disabled-transit-accessibility-cta-metra-pace-getting-around-20191202-vjbrsr6lengqhkugadewrzepre-story.html https://www.wbez.org/stories/report-fragmented-transit-system-shortchanges-some-in-chicago-region/1bf86bbc-1e16-4e59-85e7-007863612897 https://www.metroplanning.org/work/project/43? utm_source=%2fUniversalMobility&utm_medium=web&utm_campaign=redirect https://www.elevatedchicago.org/ https://chicago.suntimes.com/platform/amp/2017/6/12/18320616/chicago-youth-jobs-report-highlights-need-for-better-public-transit https://journals.sagepub.com/doi/abs/10.1177/0308518X211047872 https://www.planning.org/planning/2018/feb/inclusivemobility/ https://nextcity.org/urbanist-news/how-chicago-could-build-equity-into-transportation https://www.cnt.org/transportation-equity-network https://voorheescenter.red.uic.edu/wp-content/uploads/sites/122/2017/10/2009-transit-equity-matters.pdf https://chi.streetsblog.org/2021/05/01/cmap-analyzes-equity-impact-	12/8/2021 8:02 PM

City of Evanston ADA Transition Plan Update Survey

of-transportation-fees-fines-and-fares/ <https://jmbarajas.com/tag/mobility-justice/>
<https://sharedusemobilitycenter.org/mobility-hub-news-summit-speakers-the-new-mobility-justice-spotlight/> <https://chi.streetsblog.org/2021/08/03/a-closer-look-at-cdot-plans-to-close-chicagos-transportation-equity-gap/> <https://www.metroplanning.org/work/project/47>
<https://www.metroplanning.org/news/8913/Mobility-is-Justice-Centering-equity-in-transportation-planning> <https://chicagopolicyreview.org/2020/04/03/how-cities-model-transit-equity/>
<https://www.ideals.illinois.edu/handle/2142/105537>
<https://www.smartcitiesdive.com/news/chicago-equity-transit-oriented-development-plan/585317/> <https://www.worldtransitresearch.info/research/8060/>
<https://www.vtpi.org/equity.pdf> <https://ascelibrary.org/doi/abs/10.1061/9780784483541.038>
<https://www.wbez.org/stories/chicago-releases-equity-focused-strategic-plan-for-transportation/46557ed4-5a7b-4bf3-a97a-f6e39396be67> <https://www.ef.org/story/paving-an-equitable-transportation-path-in-the-midwest/> <https://equitycaucus.org/about-equity-caucus/our-partners> https://scholar.google.com/scholar_url?url=https://api.taylorfrancis.com/content/books/mono/download%3FidentifierName%3Ddoi%26identifierValue%3D10.4324/9780815377047%26type%3Dgooglepdf&hl=en&sa=X&ei=096rYZHZHobmyQSw5K_oDA&scisig=AAGBfm1gQ9o9jCvV84nAaEXea2bcTNjclg&oi=scholar
<https://chi.streetsblog.org/2020/12/19/atas-transit-justice-talk-discussed-the-relationship-between-transit-deserts-and-food-insecurity/>
https://www.cnt.org/sites/default/files/publications/CNT_TransitDesertsCookCounty_0.pdf
https://www.researchgate.net/publication/277583023_Transit_Deserts_The_Gap_between_Demand_and_Supply <https://blog.rtachicago.org/2021/10/05/oboi-reed-calls-on-the-transit-system-to-reckon-with-racial-equity-and-mobility-justice/> <https://podcasts.apple.com/us/podcast/s2-ep-1-olatumji-oboi-reed-mobility-justice-in-chicago/id1494325835?i=1000496666138>
<https://chi.streetsblog.org/2020/01/28/mobility-justice-leaders-we-need-to-look-at-whos-in-the-room-when-planning-is-happening/> <https://blockclubchicago.org/2021/05/18/moving-freely-exhibit-at-west-side-mini-museum-explores-how-transportation-access-impacts-racial-equity/>
<https://youtu.be/kiSk03rfUU> <https://www.equiticity.com/oboi>
<https://www.accessliving.org/newsroom/policy-positions-and-legal-cases/access-living-issues-public-comment-increased-law-enforcement-is-not-a-cure-all/> <https://equitycaucus.org/about-equity-caucus/our-partners> <https://www.cnt.org/events/mobility-justice-in-chicago-ending-racialized-enforcement-inequities> <https://www.metroplanning.org/multimedia/video/984>
<https://books.google.com/books?id=veArDwAAQBAJ&pg=PT165&lpg=PT165&dq=chicago+mobility+justice+and+transit+desert>
<https://www.chicagotribune.com/columns/ct-transit-deserts-met-20140804-column.html>
<https://www.wbez.org/stories/closing-the-gap-on-transportation-solving-transit-deserts/70a805d1-d514-4be6-94a3-7ffc493070f2>
<http://uchicagogate.com/articles/2014/10/31/watering-the-deserts-how-transit-future-can-connect-400000-chicago-residents/> <https://www.citytech.org/students-develop-new-solutions-to-increase-public-transit-usage> <https://www.transitdeserts.org/>
<https://minds.wisconsin.edu/handle/1793/78984>
<https://www.eventscribe.net/2021/ICTDPavements21/fsPopup.asp?Mode=presInfo&PresentationID=870836> <https://www.itskrs.its.dot.gov/node/209295>
<https://www.chicagobusiness.com/crains-forum-transportation/transit-deserts-limit-job-prospects> <https://www.linkedin.com/pulse/amorita-falcon-chicagos-transit-desert-mirage-james-o-shea> <https://www.vox.com/2015/8/10/9118199/public-transportation-subway-buses>
<https://news.wttw.com/2021/04/06/federal-funds-seen-key-reviving-public-transit>
<https://www.builtinchicago.org/2020/08/11/lyft-1m-free-rides-covid19-racial-justice>
<https://qz.com/2048165/american-cities-are-experimenting-with-free-public-transit/>
<https://www.nytimes.com/2020/01/14/us/free-public-transit.html>
<https://www.cnbc.com/2020/03/02/free-public-transportation-is-a-reality-in-100-citiesheres-why.html> <https://www.wvlp.com/news/state-politics/mayor-michelle-wu-introduces-fare-free-public-transportation/> <https://cities-today.com/what-benefits-can-cities-expect-from-fare-free-transport/> <https://sustainablemobility.iclei.org/free-public-transportation/>
<https://youtu.be/feCQPD9DSOA>

City of Evanston ADA Transition Plan Update Survey

<https://www.washingtonpost.com/transportation/interactive/2021/public-transportation-free-fare-future/> <https://theappeal.org/public-transportation-should-be-free/>
<https://mobile.twitter.com/peopleformj> <https://youtu.be/feCQPD9DSOA>
<https://youtu.be/kiSk03rfUU>

29	Ensure 100% sidewalk coverage ASAP.	12/8/2021 3:09 PM
30	I don't know of anything.	12/7/2021 11:06 AM
31	My hope is that the project opens the door for better communication on the issue with the business community. Evanston has work to do in better educating its business community about the benefits of being accessible. If you can be a tree city USA winner, you could strive for more inclusion	12/5/2021 2:14 PM
32	I don't know enough about this topic to comment. As a non disabled person, I guess I haven't noted deficiencies in services and infrastructure other than ramps, handicapped parking, and the like.	12/5/2021 1:27 AM
33	Keep up the good work!	12/3/2021 8:21 PM
34	Please work with the CTA to make the L stations ADA compliant	12/3/2021 7:53 PM
35	Make winter streets and cross walks accessible for seniors. I am 81 and my friends have similar complaints.	12/3/2021 4:49 PM
36	To have many of the park rest rooms closed during the cold months is a terrible decision.	12/3/2021 10:59 AM
37	I think there should be more emphasis on pedestrian safety. I was hit by a car several years ago at Ridge and Madison. I think the driver was looking at his cell phone, because he said he did not see me, though it was a 10 among a sun filled day. My broken pelvic ramus still bothers me, though my broken wrist healed fully.	12/2/2021 10:03 PM
38	As a volunteer, I briefly assisted with the Age-Friendly Evanston project. I was proud that Evanston had participated in this 5-year project.	12/2/2021 9:24 PM
39	Clean up our destroyed city!	12/2/2021 7:38 PM
40	Bikers should be stopped at intersections when the red stop light is on. Agate my come down at the bike lane intersection to stop them. Today they ignore the red lights and anyone crossing the intersection. Elderly (as well as others) step off the curb to cross and are in danger of being hit by the bicyclist.	12/2/2021 7:08 PM
41	I know you welcome all city residents to respond but I felt at a disadvantage because currently I do not need accommodations.	12/2/2021 6:18 PM
42	Evanston schools need to have more updates to improve accessibility! many places are not easily accessible my wheelchair, and often you would have to go out of the way to get handicapped facilities.	12/2/2021 5:39 PM
43	There are many places that do the minimum required, rather than really trying to promote accessibility.	12/2/2021 5:38 PM
44	More focus on accessibility for wide body wheelchairs. Many older doorways are not wide enough for wide body wheelchairs.	12/2/2021 5:36 PM
45	The city does a great job in terms of accessibility.	12/2/2021 5:36 PM
46	Not sure if this falls within the accessibility constraints of the ADA, but the library was not at all helpful about continuing curbside pick up for those who are immunocompromised. I now get all my books at Wilmette because the services there are far superior--esp around curbside pick up. At Evanston it was impossible to figure out, and didn't continue.	12/2/2021 5:23 PM
47	Please don't move the Farmers Market downtown. That will make it completely inaccessible for me.	12/2/2021 5:11 PM
48	Curb ramps suck. Broken concrete, big bumps. Sidewalks downtown are uneven and sloping. Many businesses are impossible to get in/out w wheelchair. Coffee places have one table w ADA symbol- but it's always occupied by non disabled, so nowhere for wheelchair user to go	12/2/2021 5:29 AM
49	I believe the area behind Sam's club is in bad shape and is ignored by the alderman and the city in general. I talk to the last city manager about this and he did next to nothing or made	12/1/2021 9:48 PM

City of Evanston ADA Transition Plan Update Survey

improvements that benefit the businesses but not the citizens of the area (ie. sidewalks on the south side of Main street more or less stop at Hartrey - walking to Dodge is dangerous. The sidewalk at Hartrey and Washington was removed instead of improved. The Bench at Hartrey and Cleveland has never been replaced. The side walk just west of there on Cleveland is dangerous to even walk. The crosswalk on Oakton at Hartrey was removed even with the bus stop on Oakton by the school on Dodge removed from service. It is impossible to walk on sidewalks from Washington to Main on Hartrey and the same on Washington from Grey towards Dodge. Anyone in a wheelchair in this area should sue the city for lack of accessibility.

50	Thank you for this survey. It is important to people like me. It prevents us from taking advantage of this beautiful town.	12/1/2021 5:11 PM
51	I have serious issues with my wrists and I can't open the exterior doors of some of the city buildings. I also struggle with interior doors, including restroom doors. Some doors have door closers that make the doors very "heavy". Round knobs are the worst, followed by small vertical "loop" handles, especially if the handle is set very high or low on the door. The best handle is a flat "paddle"-style handle that doesn't turn more than 45 degrees. I can open those with my elbow. Automatic door openers are great, but they aren't always kept in good repair. I dislike the "call buttons" because I'd rather be able to open the door myself. It's a serious problem when door handles are chosen for "style" instead of function.	12/1/2021 4:44 PM
52	There is no way in this survey to indicate that you don't think any improvements are needed.	12/1/2021 4:30 PM
53	My main personal struggle is with accessibility with small children - strollers, changing rooms, etc	12/1/2021 3:47 PM
54	While the focus here is on upgrades and improvements, I ask that you not neglect the existing sidewalks and curb cuts. Many residential sidewalks are difficult to travel in a wheelchair because of upheaval by tree roots and broken cement. This isn't very "sexy" but it's essential to wheelchair users here in Evanston.	11/30/2021 7:30 PM
55	You placed the awful bike lanes on Dodge and the lanes aren't wide enough for adult tricycles, a popular option for people with disabilities. Council should be cautious about advocating for an Evanston that is focused on walking/biking as the key to dealing with parking or lakefront issues - it's ideal on the one hand, but it's also ableist. people who use wheelchairs need vehicles or buses to transport.	11/30/2021 5:31 PM
56	Consider autism and neuro divergence in your facility planning. Studies have shown that planning facilities with autism/OCD/ADHD in mind creates a safe space for everyone.	11/28/2021 12:20 PM
57	Work harder at cooperative approach for prompt maintenance of pedestrian pathways - stairs, sidewalks, transit stations, bus stops, etc	11/24/2021 9:32 PM
58	More downtown Disabled Parking	11/24/2021 4:57 PM
59	This study does not even begin to address my accessibility needs. First, the audio introduction without a transcript is 100% inaccessible to many people. (That, alone, tells me that the city's commitment to accessibility is extremely superficial.) Second, this survey only focuses on mobility issues. Many disabilities are NOT mobility related. To make Evanston city buildings accessible to me, it would be necessary to only use fragrance-free cleaning supplies and to ensure that there are no "air fresheners" used anywhere in the buildings. Another way to make buildings more accessible would be instituting a policy requiring employees to be fragrance-free. Also, all videos put out by the city should have transcripts (not YouTube transcripts, but real ones created by actual humans) easily available without a special request. If you focus solely on mobility accessibility, you miss the needs of the majority of disabled people. Please learn more about cognitive disabilities, hearing impairment, visual impairment, chemical sensitivities, and ALL the other many, many ways that people can be disabled while having full mobility. Anything less is not in compliance with the ADA. I look forward to seeing the city become fully accessible to everyone.	11/24/2021 1:50 PM
60	see above	11/24/2021 12:51 PM
61	Areas of Evanston have very poorly maintained sidewalks or have one-sided sidewalks. It's mostly okay, but there are some areas that are severely neglected.	11/24/2021 12:31 PM
62	Many injuries would be avoided if sidewalks could be created without seams. I don't know how this would be done. People who use wheelchairs should be employed to evaluate and design	11/23/2021 10:14 AM

City of Evanston ADA Transition Plan Update Survey

curb cuts. Mid block curb cuts should be considered. If a parking spot near a curb cut is not available a person using a wheelchair must navigate rolling in automobile traffic after exiting their vehicle. The signage on the Davis Street Metra station needs to be replace. In some areas it has been painted over. In others it is peeling. The cross walk in front of 1718 Oak Ave. is unsafe! Cars often do not stop for pedestrians!. Car frequently speed drastically when traveling between the intersections Ridge Ave. and Clark st., and Oak Ave. and Church St. A bike path needs to be added along Chicago Ave. connecting Evanston and Chicago.

63	I think the Study is great. The city prides itself in being one of the most livable cities in the country but I don't think that the folks who award that recognition take into account the livability of individuals who are mobility impaired or have sensory impairments	11/19/2021 10:35 AM
64	Often, the greatest hindrance to a person with a disability's independence is transportation. Many of these individuals cannot drive--the City needs to go beyond only providing "accessible parking" to better supporting other modes of transit, so all persons have safe options for moving about the city. When thinking about ADA accessibility, the COE needs to consider the challenges faced by individuals with cognitive impairments as well as physical ones.	11/19/2021 8:59 AM
65	Delighted you are looking into this. Have been very frustrated with my inability to get my 91 yo wheelchair bound mother out of her house due to poor sidewalks, cuts, etc.	11/19/2021 7:51 AM
66	Please include mobility device users (and folks with visual and auditory disabilities)in this planning	11/18/2021 8:27 PM
67	Curious why elevators are not included in the "elements within a building" category. There's no focus on beaches here, yet most of Evanston's beaches are inaccessible to those with mobility disabilities. The city's website ADA/Disability page uses person-first language despite the fact that the overwhelming majority of actually disabled people prefer identity-first language. Asking disabled people to select "three most important" from a list of items where any one of the items would make the building inaccessible is ridiculous. What do I care if you fix three of the items if I still can't go there if I need four items fixed for it to be accessible?	11/18/2021 7:24 PM
68	To have elevators at every L Stop. To help more people to get around.	11/18/2021 6:45 PM
69	Remind homeowners to trim back bushes that overhang sidewalks. People walking at night or who are vision impaired can be impaled by sharp branches.	11/18/2021 5:45 PM
70	There is a lack of consistent sidewalk coverage, especially in the 8th ward. There are often gaps in the sidewalk in front of multiple properties or on street segments. For example, there are no sidewalks on Ashland between Brummel and the bus stop on Howard, forcing me to walk in the street (heavy traffic due to daycare center) to use the bus. A sidewalk with gaps is a useless sidewalk	11/18/2021 5:38 PM
71	"Walk a Mile" in a handicapped person's shoes. For example, if there is a curb on your side of the car it makes it 2X as hard to get out as your knees are too bent. You need to be far enough away so your feet are on the ground, but then there are rules about how far away from the curb you can park. Put a cast on your leg and an arm and see how it goes. Also try the rest rooms. Are the hand grips in a good location? Are the toilets HIGH enough?	11/18/2021 5:16 PM
72	Overall, Evanston is a fairly welcoming community to individuals with disabilities. However, more outreach from the city would be appreciated. During the month of October, there was a major construction project on Dempster that made it near impossible for accessible transit to reach our program and greatly impacted our ability to get individuals out into the community.	11/18/2021 3:30 PM
73	I am concerned that your use of "accessibility" here is not defined and appears to be limited to physical accessibility, when this is a broad term of inclusion and equal access. I am a licensed Sign Language Interpreter and I would like to see an Interpreter present at all city events to provide open access to Evanston's deaf residents. Where do we have braille on outdoor posted signs for our low-vision neighbors? Please provide captions when possible on recorded events. Accessibility also includes elevators where possible. Thanks for your consideration.	11/18/2021 11:05 AM

Q19 Please include your email address if you want to be informed of any ADA Transition Plan updates, project milestones, and engagement opportunities!

Answered: 71 Skipped: 93

#	RESPONSES	DATE
1	fsbilimoria@gmail.com	12/18/2021 7:07 PM
2	wendy.pollock@gmail.com	12/17/2021 5:29 PM
3	helloashluna@gmail.com	12/17/2021 12:59 PM
4	clariongroup@comcast.net	12/16/2021 8:50 PM
5	kitsullivann@gmail.com	12/16/2021 5:45 PM
6	Sarahsjst0823@gmail.com	12/15/2021 4:48 PM
7	cole.dobrowolski@gmail.com	12/15/2021 1:36 PM
8	no	12/15/2021 10:35 AM
9	nazimuddinrogersparkusa@gmail.com	12/15/2021 10:27 AM
10	no	12/15/2021 10:21 AM
11	no thanks	12/14/2021 10:47 AM
12	Happy job	12/14/2021 10:45 AM
13	katyprincesspink@gmail.com	12/14/2021 10:41 AM
14	shuman.rebecca90@gmail.com	12/14/2021 10:30 AM
15	j.huppert@gmail.com	12/13/2021 8:11 AM
16	Schechtmanb@gmail.com	12/12/2021 12:37 PM
17	Alejandralule@yahoo.com	12/12/2021 7:46 AM
18	milt@chicagobooth.edu	12/11/2021 9:40 AM
19	joanncbarnett@gmail.com	12/10/2021 4:36 PM
20	whatadaywhataday7@gmail.com	12/10/2021 12:09 PM
21	Bmrldy@mac.com	12/10/2021 6:25 AM
22	ekaehler@att.net	12/10/2021 1:58 AM
23	jacrihfield@gmail.com	12/9/2021 7:17 PM
24	jtbisgrove@gmail.com	12/9/2021 6:43 PM
25	vivaucrania@gmail.com	12/9/2021 5:27 PM
26	lindafred@ameritech.net	12/9/2021 2:35 PM
27	jgraham@luc.edu	12/9/2021 9:20 AM
28	Mblurie@gmail.com	12/9/2021 8:37 AM
29	brucewhirsch@comcast.net	12/9/2021 1:28 AM
30	Maryrosinski@ gmail.com	12/8/2021 10:09 PM

City of Evanston ADA Transition Plan Update Survey

31	ALLABOUTTHEBUSINESS777@GMAIL.COM	12/8/2021 8:02 PM
32	bursztyn@sbcglobal.net	12/5/2021 1:27 AM
33	declanryan22@gmail.com	12/4/2021 2:01 PM
34	gketterson@aol.com	12/3/2021 4:49 PM
35	sittlerbarbara@gmail.com	12/3/2021 2:30 PM
36	edie523@comcast.net	12/2/2021 10:05 PM
37	ftmeyer@yahoo.com	12/2/2021 9:24 PM
38	81rightnow@gmail.com	12/2/2021 8:52 PM
39	sarah.brown3@northwestern.edu	12/2/2021 7:28 PM
40	jcroegaert2@comcast.net	12/2/2021 5:38 PM
41	siegfriedt2@comcast.net	12/2/2021 5:11 PM
42	kt_ford@yahoo.com	12/2/2021 4:32 AM
43	estherber@aol.com	12/1/2021 11:49 PM
44	The best update is to correct these issues - not send emails!	12/1/2021 9:48 PM
45	jgoodgold@aol.com	12/1/2021 9:46 PM
46	4arbitator@msn.com	12/1/2021 9:20 PM
47	nancy.ryan39@gmail.com	12/1/2021 5:11 PM
48	ephicks@fastmail.net	12/1/2021 4:44 PM
49	lenoreweissmann@gmail.com	12/1/2021 4:41 PM
50	jhwright @northwestern.edu	12/1/2021 4:30 PM
51	lesmotsdujour@sbcglobal.net	12/1/2021 4:16 PM
52	ghbmfk@earthlink.net	12/1/2021 3:41 PM
53	sue@classicalcollector.com	11/26/2021 2:15 PM
54	kjohnast@gmail.com	11/24/2021 9:32 PM
55	Echols.pat@gmail.com	11/24/2021 4:57 PM
56	fniazi2009@gmail.com	11/24/2021 1:21 PM
57	kalmangabriel04@gmail.com	11/24/2021 12:31 PM
58	jmorthorst@independentfutures.com	11/23/2021 10:14 AM
59	blanchgrov@comcast.net	11/22/2021 11:54 AM
60	djruswick@outlook.com	11/20/2021 10:01 PM
61	perry_tamara@yahoo.com	11/19/2021 10:35 AM
62	cawallin@sbcglobal.net	11/19/2021 8:59 AM
63	versenyi@gmail.com	11/19/2021 7:51 AM
64	Nsreenan@Ameritech.net	11/18/2021 8:42 PM
65	akzrust@gmail.com	11/18/2021 8:27 PM
66	kristenscotti@u.northwestern.edu	11/18/2021 7:24 PM
67	Keychainleff@gmail.com	11/18/2021 6:45 PM
68	dmtuba@gmail.com	11/18/2021 5:38 PM

City of Evanston ADA Transition Plan Update Survey

69	abulgrin@search-inc.org	11/18/2021 3:30 PM
70	cirelgourley2024@u.northwestern.edu	11/18/2021 2:42 PM
71	dana.phelan@gmail.com	11/18/2021 11:05 AM

Appendix 2 - Website Review Report

Index – City of Evanston Accessibility Audit

- [City of Evanston Web and PDF Links](#)
- [Complex Interactions and Best Practices Report](#)
- [WCAG 2.1 Report](#)
- [City of Evanston PDF Accessibility Audit](#)
- [Blind/Low Vision User Testing](#)

City of Evanston Web and PDF Links

Webpages

1. www.cityofevanston.org
2. www.cityofevanston.org/government/departments/health-human-services/coronavirus-disease
3. <https://www.cityofevanston.org/government/departments/health-human-services/covid-19-vaccinations>
4. <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/lakefront-and-beaches>
5. <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/beach-admissions>
6. <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/beach-status-and-closings>
7. <https://www.cityofevanston.org/government/city-council/reparations>
8. <https://www.cityofevanston.org/residents/parks-rec>
9. <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/robert-crown-center>
10. <https://www.cityofevanston.org/how-to/make-a-payment>
11. <https://www.cityofevanston.org/government/departments/administrative-services/human-resources>
12. <https://www.cityofevanston.org/residents/parking/wheel-tax>
13. <https://www.cityofevanston.org/how-to/311>
14. <https://www.cityofevanston.org/government/city-clerk/voting>
15. <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/concerts>
16. <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/summer-camps>
17. <https://www.cityofevanston.org/government/city-council>
18. <https://www.cityofevanston.org/residents/farmers-market>
19. <https://www.cityofevanston.org/government/departments/public-works/services/street-cleaning>
20. <https://www.cityofevanston.org/residents/parking>
21. <https://www.cityofevanston.org/government/agendas-minutes/city-council-agendas-and-minutes>
22. <https://www.cityofevanston.org/business/bids-proposals>
23. <https://www.cityofevanston.org/about-evanston/events>
24. <https://www.cityofevanston.org/government/departments/public-works/services/trash-recycling-and-yard-waste-services/special-pick-ups-and-bulk-collection>
25. <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/facilities/levy-senior-center>
26. <https://www.cityofevanston.org/government/departments/police>
27. <https://www.cityofevanston.org/residents/permits-licenses>
28. <https://www.cityofevanston.org/government/city-council/5th-ward>
29. <https://www.cityofevanston.org/government/departments/public-works/services/waste-services>
30. <https://www.cityofevanston.org/residents>
31. <https://www.cityofevanston.org/government/agendas-minutes>

Complex Interactions and Best Practice Report

City of Evanston

The goal of this report is to provide summary defect information to the customer on complex objects such as a menu, carousel, modal dialog form, et cetera. The intent is to pull together all defects related to an object saving the remediation team time in aggregating and interpreting the many WCAG success criteria. In addition, this report will include best practices, supplementary information, and testing methodology when appropriate. And finally, the audit performed consisted of both manual and automated testing. As an industry-standard, automated testing only catches between 30% to 40% of errors. Automated testing is useful when identifying technical failures that can be directly compared to a standard such as HTML. Manual testing is using the same assistive technologies and techniques as a person with a disability. For this evaluation, auditors used the following technologies:

Include		Platform	Browser / Platform	Disability / General Testing	AT
X	Desktop / Laptop	Windows	Firefox	Vision: Blind / Low Vision	NVDA
X	Desktop / Laptop	Windows	Chrome	Mobility, Vision: Low Vision, Vision: Color Blind	Keyboard

Note: The team uses a variety of other manual evaluation tools, but these are not considered assistive technology.

This is a supplementary report and should be used in conjunction with the detail reports, which contains all errors.

Customer Information:

Customer: City of Evanston

Client Site: City of Evanston - <https://www.cityofevanston.org/>

Auditors:

- Jamaar Cormier – Audit Lead
- Josh Swatosh – Auditor

Advisory Information

Focus Indication:

Notices:

FOCUS INDICATION NOTICE:

Under WCAG 2.0 and 2.1, default focus indication is deemed compliant. Currently, under the ***proposed*** WCAG 2.2 standard, default focus indication will not be allowed. The City of Evanston site as it stands is compliant with noted exceptions.

Main Menu

Users wishing to get to site features, such as the section specific sub-navigation menu, must go through over 55 links and other interactive objects to get there. This is due to the menu implementing an outdated focus management system that activates sub items on user agent focus rather than requiring user to explicitly expand sub menu items. As such the user must tab through each preceding menu item and all included the sub items to reach any specific menu content.

It is highly recommended that the developers consider implementing a menu system based on the W3C pattern provided in the WAI-ARIA Authoring Practices 1.1. This pattern allows keyboard users to open, close and navigate through the menu as would a sighted person using a mouse.

Observed Pages:

- All

WCAG:

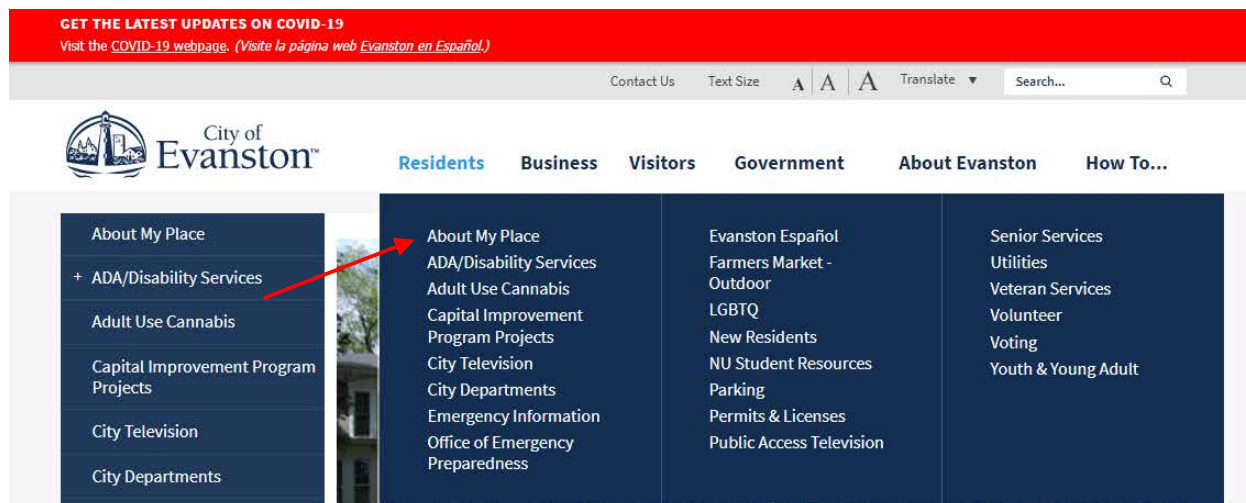
- 2.4.1 Bypass Blocks
- 4.1.2 Name, Role, Value

Impacted Users:

- Mobility
- Vision - Blind

Best Practices:

- 3.15 Menu or Menu Bar - <https://www.w3.org/TR/wai-aria-practices-1.1/#menu>



Sidebar Menu

For users navigating the sidebar menu, the exact functionality of each menu may be unclear and will not be consistent between pages. This is due to the menu implementing a different expandable content triggering based on the page or submenu level. Some pages feature menu items that expand in-page without navigating to a new section of the site, while others navigate the user to the menu subsection before expanding the submenu items. Each version features the expandable menu signifier (+/- text) preceding the menu item content visibly and in the DOM order so it may not be clear initially which interactive pattern the user should expect.

It is highly recommended that the developers consider unifying the multiple sidebar menu implementations into a single version that expands the submenu within the current page. Disclosure widget markup for the expandable menu item link (the plus/minus symbol in the current implementation) would aid users in setting expectations for interacting with the sidebar menu content.

Observed Pages:

- All – excluding homepage

WCAG:

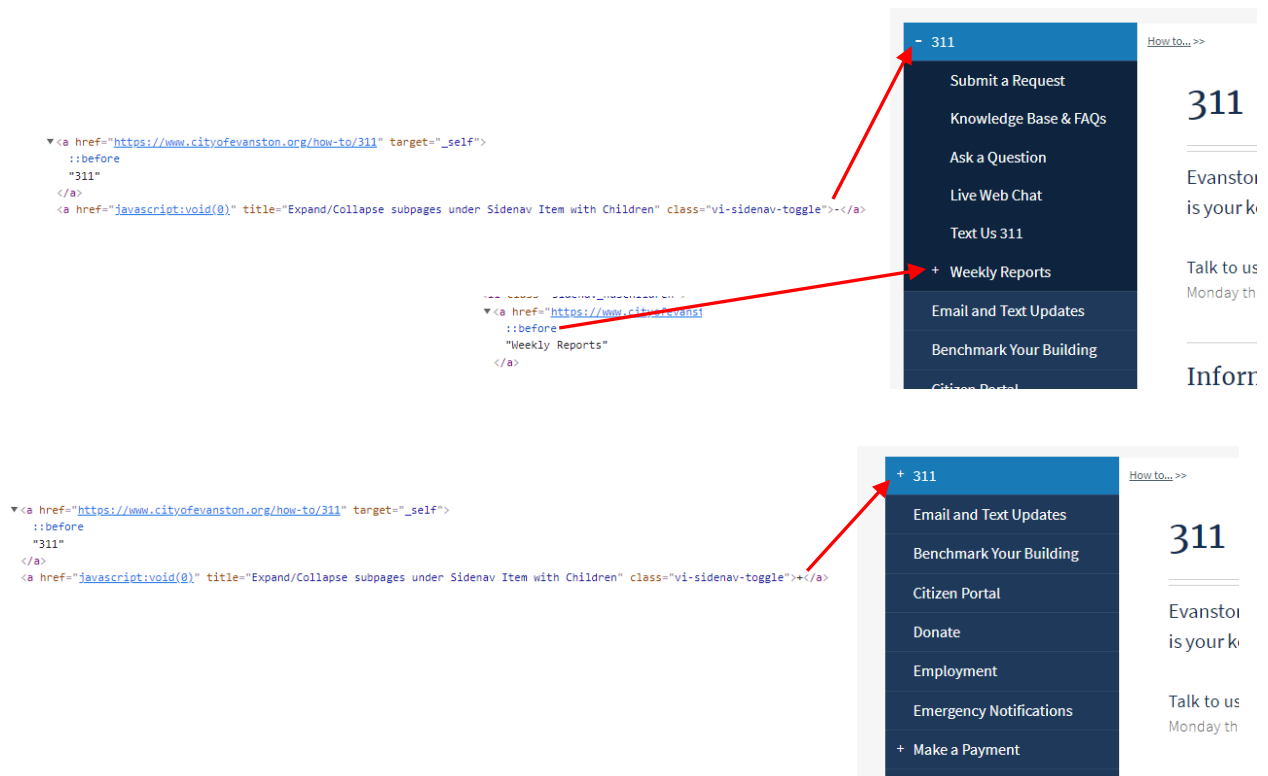
- 3.2.4 Consistent Identification
- 4.1.2 Name, Role, Value

Impacted Users:

- Cognitive

Best Practices:

- WAI-ARIA Authoring Practices 1.1 - 3.10 Disclosure (Show/Hide)- <https://www.w3.org/TR/wai-aria-practices-1.1/#disclosure>



Carousel

Carousels are one of the most challenging types of web modules. As indicated below, the current carousel module has substantial issues for people who rely on assistive technologies such as a screen reader. The carousel content may not be easily translatable as images. Additionally, users must be able to pause or stop auto updating content to avoid distractions.

It is highly recommended that the developers consider implementing carousel structures, interaction patterns and controls based on the W3C pattern provided in the WAI-ARIA Authoring Practices 1.1. This pattern allows users to pause auto-rotating menu implementations, as well as providing navigation controls and enhanced labeling for image content.

Observed Pages:

- <https://www.cityofevanston.org/>
- <https://www.cityofevanston.org/government/departments/health-human-services/covid-19-vaccinations>

WCAG

- 1.1.1 Non-text Content

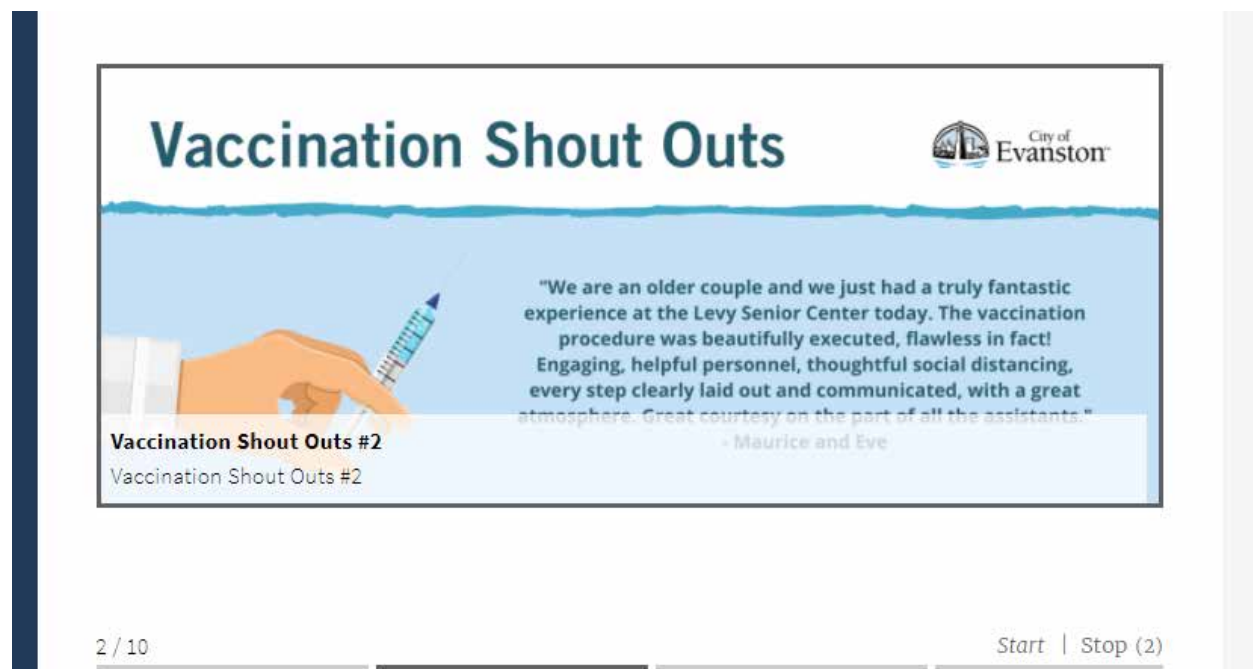
- 2.1.1 Keyboard
- 2.2.2 Pause, Stop, Hide
- 4.1.2 Name, Role, Value

Impacted Users:

- Mobility
- Vision - Blind
- Vision - Low Vision
- Cognitive

Best Practices:


- WAI-ARIA Authoring Practices 1.1 - 3.6 Carousel (Slide Show or Image Rotator) - <https://www.w3.org/TR/wai-aria-practices-1.1/#carousel>



Issue: The graphics are images of text that should be implemented with HTML, or have matching alt text values

Example:
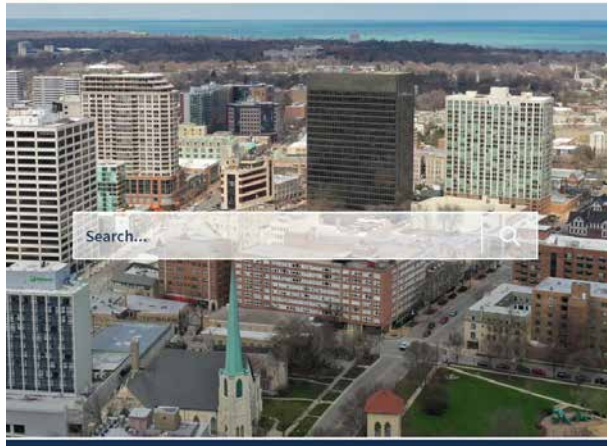
```
<a href="/home/showpublishedimage/14624/637511522579400000" target="_blank"></a>
```



Issue: The homepage carousel has no pause/stop controls. Users cannot interrupt the auto-playing hero image rotator behind the homepage search feature.

Vaccination Shout Outs

"I just wanted to thank the City for their organization and deployment of the vaccine. We got our second dose last week and are grateful for the communications we received as well as the competence at the site. In addition, a thank you to all of the staff who were caring and helpful, knowing that so many elders are anxious. We are hoping that enough vaccines continue to come to Evanston so everyone who wants to be vaccinated can do so."
- Harriet and Gil

Vaccination Shout Outs #5

Vaccination Shout Outs #5

```
<div class="ad-prev-image" style="opacity: 0.7;display: block;"></div> <div class="ad-next-image" style="opacity: 0.7;display: block;"></div>
```

```
<span class="ad-slideshow-start">
  "Start"
  ::after
</span>
<span class="ad-slideshow-stop">Stop</span>
```

6 / 10

Start | Stop (1)

```
<div class="ad-back" style="opacity: 0.6;"></div> <div class="ad-forward" style="opacity: 0.6;"></div>
```

Issue: The carousel controls are not keyboard operable or do not follow the expected interaction pattern. The next/previous/play/pause carousel controls are semantically neutral HTML elements that

do not naturally take user agent focus. The carousel pager items are sequentially focusable regardless of the visible state of the pager item content.

Calendar

The calendar functionality features standard HTML5 table and form control markup which relates a decent amount of accessible information and functionality, though there are missing form field labels and an overuse of labeling attributes that do not convey any information. Small screen versions of the calendar rely on tooltip widgets to display the event content that are not operable by non-pointer users and lack state and attribute markup.

It is highly recommended that the developers implement button and tooltip widget markup for the small screen version of the calendar widget and related popup content. The W3C patterns provided in the WAI-ARIA Authoring Practices 1.1 would allow keyboard users to operate the tooltip triggering controls and convey the tooltip relationship and state to assistive technology users. Calendar filter controls should have accessible labels added to convey the control purpose more clearly to users once a value has been selected.

Observed Pages:

- <https://www.cityofevanston.org/about-evanston/events>

WCAG

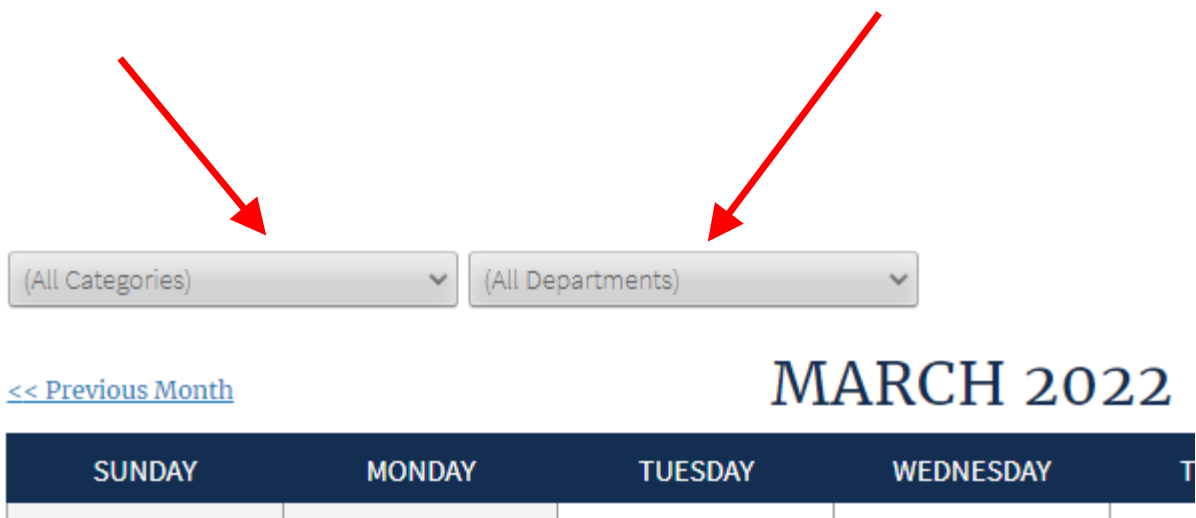
- 1.4.10 Reflow
- 2.1.1 Keyboard
- 2.4.6 Headings and Labels
- 3.2.2 On Input
- 3.3.2 Labels or Instructions

Impacted Users:

- Mobility
- Cognitive

Best Practices:

- WAI-ARIA Authoring Practices 1.1 - 3.24 Tooltip - <https://www.w3.org/TR/wai-aria-practices-1.1/#tooltip>




Issue: Calendar filter fields lack accessible label values. All fields require properly associated label values using top-level label attribution.

Issues: Calendar filter fields submit on user selection. User cannot filter the calendar content by multiple dimensions in a single page load.



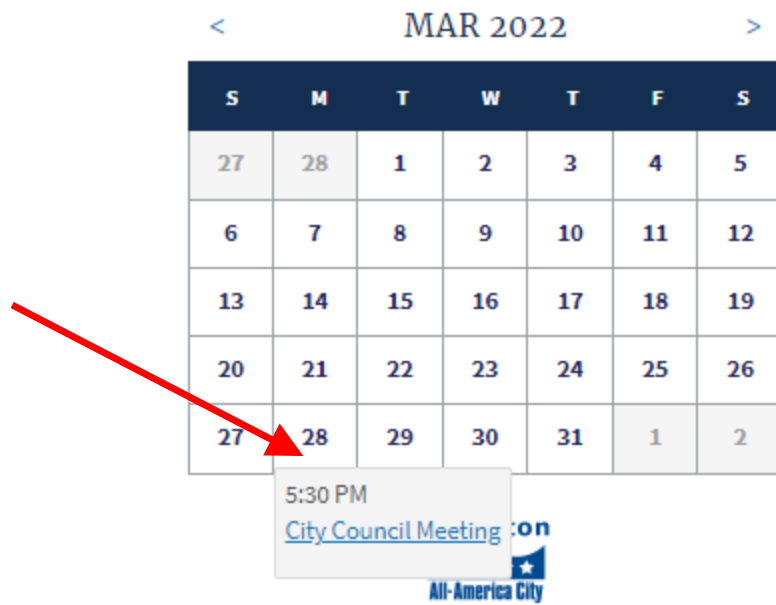Issues: Calendar table cells employ aria-label values to create a full date value, but the contained text content (beginning with the date number) along with the day of the week table header association creates the same context for users. Most are not exposed to the label value on the table cell in normal table navigation.



Issues: Small screen version of calendar employs hover-based tooltips to display the event item content. Screen reader and keyboard users cannot activate the tooltip or perceive the collapsed event item content in each date cell.

Headings

Heading markup and nesting is used by assistive technology users to quickly navigate content based on sectional labels. Each page should have a single heading level one element that describes the page topic. Subsequent page section headings should use heading levels one through six markup to convey the relationship between the content sections. Headings are used consistently across the site pages and have minor issues with nesting and empty heading elements existing within site content.

It is recommended that developers remove the visually hidden heading level one element that exists in every page in the page header. It should remain on the frontpage, which lacks an in-content heading level one, but should be removed on all internal pages that have a visible heading level one element.

Site content managers should review source input in WYSIWYG editors for extraneous HTML markup. Copy and pasted content may contain hidden HTML markup from other programs. Additionally, WYSIWYG editors may insert empty HTML markup on editing heading markup.

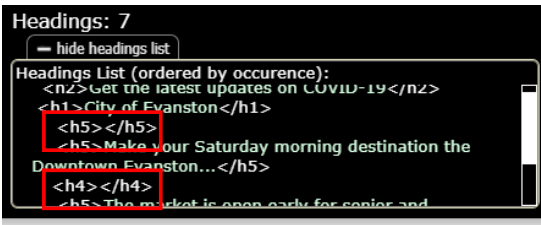
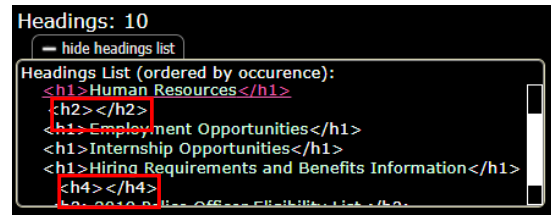
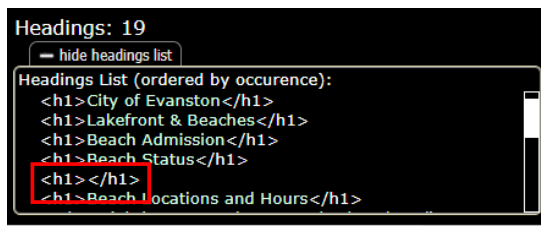
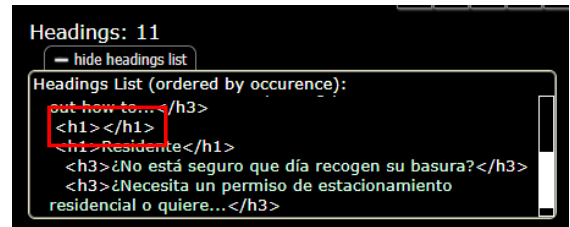
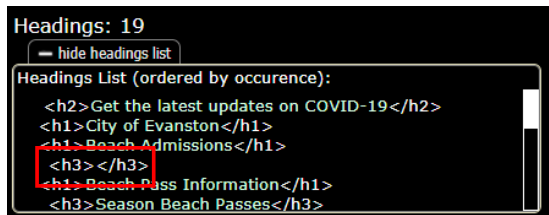
Observed Pages: All

WCAG:

- 1.3.1 Info and Relationships
- 2.4.6 Headings and Labels
- 4.1.1 Parsing

Impacted Users:

- Vision – Blind
- Vision – Low Vision



Issues: Empty heading level elements appear in some pages. Headings should contain descriptive content regarding the content following it.

Headings: 20

— hide headings list

Headings List (ordered by occurrence):

```
<h2>Get the latest updates on COVID-19</h2>
<h1>City of Evanston</h1>
<h1>Vaccinations</h1>
<h2>Get Your Shot</h2>
<h2>Vaccine Booster Survey</h2>
<h3>Resources</h3>
```




Headings: 13

— hide headings list

Headings List (ordered by occurrence):

```
<h2>Get the latest updates on COVID-19</h2>
<h1>City of Evanston</h1>
<h1>Special Pick-Ups and Bulk Collection</h1>
<h3>Special Pick-Ups</h3>
<h4>What is the cost of a special pick-up?</h4>
<h3>Bulk Trash Collection</h3>
```




Headings: 7

— hide headings list

Headings List (ordered by occurrence):

```
<h2>Get the latest updates on COVID-19</h2>
<h1>City of Evanston</h1>
<h1>Voting</h1>
<h2>Voter qualifications</h2>
<h2>Online Tools</h2>
<h3>NEW:</h3>
```



Issues: Most pages have multiple heading level one elements. A visually hidden heading level one element exists in the site header and most pages have an additional visible heading level one.

Landmarks

Landmarks provide assistive technology (AT) users, such as screen reader users, with the same contextual representation as a sighted person perceives for different visually apparent page sections. Currently, the site does not provide main landmark elements to aid users in navigating the page. It does delineate banner and contentinfo regions using <header> and <footer> HTML markup

As a best practice, we recommend adding the missing landmarks and accessible label values to each site page and existing landmark region. This will greatly improve the AT user experience and provide equal contextual information.

Landmarks are optional since they serve as a means to bypass blocks of information. **However**, if you use ANY landmarks, then you must adhere to the HTML5 and ARIA rules, which require **all content** to be in landmark regions. Currently, the page has orphaned content that does not appear in a landmark region and fails under 1.3.1 Info and Relationships and 4.1.1 Parsing

Observed Pages:

- All

WCAG:

- 1.3.1 Info and Relationships
- 2.4.1 Bypass Blocks
- 4.1.1 Parsing

Impacted Users:

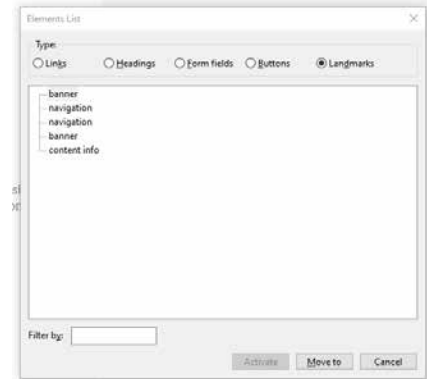
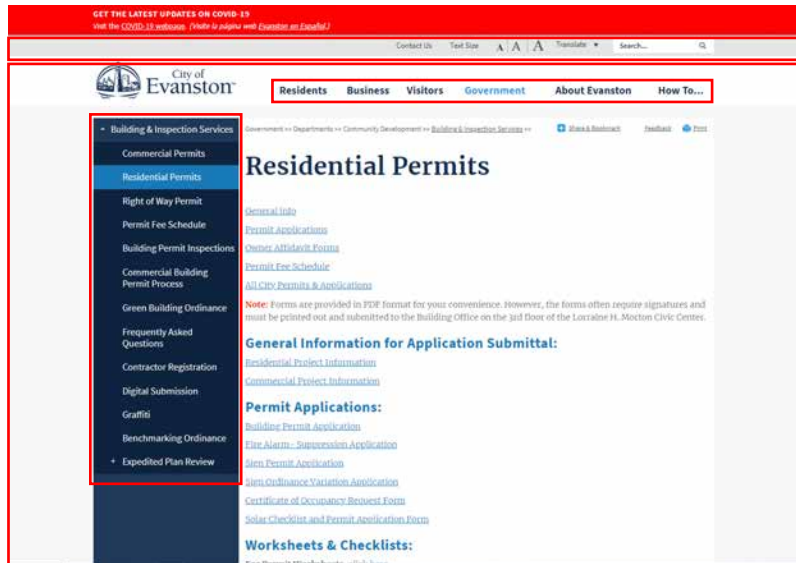
- Vision – Blind
- Vision – Low Vision

Accessibility Checklist Guidance

- W3C ARIA 1.1 Best Practices for HTML5 Sectioning Elements and ARIA Landmarks
<https://www.w3.org/TR/2017/NOTE-wai-aria-practices-1.1-20171214/examples/landmarks/HTML5.html>
- ARIA Landmark Roles
https://www.w3.org/TR/wai-aria-1.1/#landmark_roles

Recommendation:

- Create a main landmark region for each page that encompasses the main content as the visual layout.
- Ensure that all landmarks that require labels have appropriate accessible label values.



HTML5	ARIA Role	Number of Occurrences Per Page	Requires Label (if more than one)
<header>	role="banner"	Once	No
<nav>	role="navigation"	Multiple	Yes
<main>	role="main"	Once	No
<footer>	role="contentinfo"	Once	No
<aside>	role="complementary"	Multiple	Yes
none	role="search"	Multiple	Yes
<form>	role="form"	Multiple	Yes
<section>	role="region"	Multiple	Yes
none	role="application"	Multiple	Yes

Audio Description

Audio description is one of the most challenging video accessibility issues to catch and correct. In the “Building an Election: Election Day” video, you can see moments that information is displayed on the screen but is not conveyed audibly. These issues for this sparsely narrated video are not insignificant and serve as a reminder that video production has a variety of accessibility requirements and that remediating issues like audio description is both expensive and time-consuming.

The most common audio description implementation involves a secondary video track that pauses to allow for reading of onscreen information. Hosted video platforms, such as YouTube and Vimeo, do not generally have the functionality to support audio description tracks in this manner. It is recommended that site managers include transcripts, including descriptions of onscreen text, that users can access in addition to the video. This will not satisfy the audio description requirement (the track must be synchronized) but will make the information available to users until a video player platform that supports audio descriptions can be implemented.

Observed Pages:

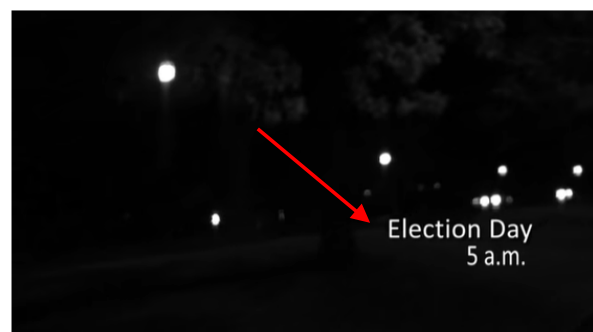
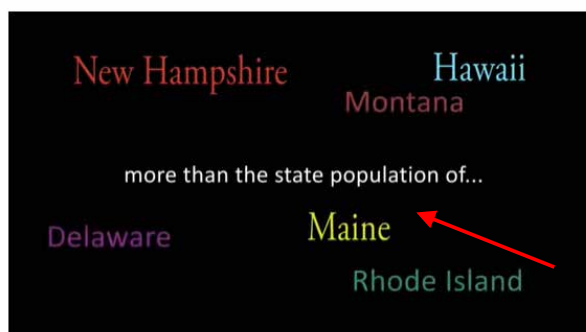
- <https://www.cityofevanston.org/government/departments/health-human-services/coronavirus-disease>
- <https://www.cityofevanston.org/government/city-clerk/voting>
- <https://www.cityofevanston.org/residents/parking/snow-parking-regulations>
- <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/facilities/levy-senior-center>

WCAG


- 1.2.3 Audio Description or Media Alternative (Prerecorded)

Impacted Users:

- Vision – Blind



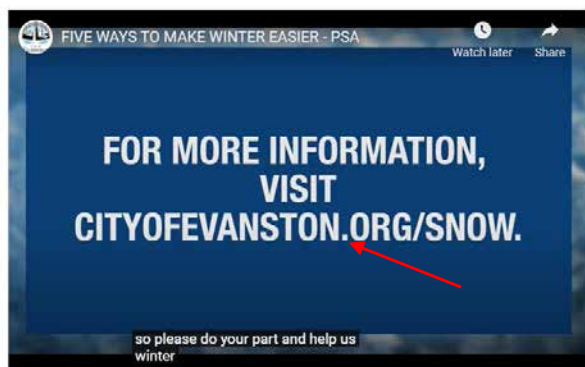Content in “Building an Election: Election Day” was not audibly conveyed.



Content in “Five Ways to Make Winter Easier - PSA” was not audibly conveyed.



Content in “Levy Senior Center” was not audibly conveyed.

FAQ-style Accordion

Accordion content requires state attribute markup to alert users to the existence of further content and to convey the current expanded status of each accordion item and its controlled content section. The site accordions only visually hide collapsed section content which may affect tracking navigation for keyboard users as well as requiring assistive technology users to navigate the entire page content regardless of the visible state.

It is highly recommended that the developers implement accordion widget markup according to the W3C patterns provided in the WAI-ARIA Authoring Practices 1.1. This markup would include properly hiding the collapsed content, reducing navigation for non-pointer users.

Observed Pages:

- www.cityofevanston.org/government/departments/health-human-services/coronavirus-disease
- <https://www.cityofevanston.org/government/city-council/reparations>
- <https://www.cityofevanston.org/government/departments/health-human-services/covid-19-vaccinations>
- <https://www.cityofevanston.org/government/departments/public-works/services/waste-services>

WCAG:

- 1.3.1 Info and Relationships
- 2.4.7 Focus Visible
- 4.1.2 Name, Role, Value

Impacted Users:

- Vision – Blind
- Vision – Low Vision
- Mobility

Best Practices:

- WAI-ARIA Authoring Practices 1.1 - 3.1 Accordion (Sections With Show/Hide Functionality) - <https://www.w3.org/TR/wai-aria-practices-1.1/#accordion>

Confirmed Cases >

Communication Updates >

Task Force Updates >

Symptoms >

How it Spreads >

Prevention >

Testing >

Vaccinations >

What to Do if You are Sick >

Travel Information >

FAQs >

Resources >

```
<div class="accordion-item" role="button" id="Testing" data-index="7">
  <div class="accordion-heading" tabindex="0">
    <div class="title">Testing</div>
    <div class="icon"></div>
  </div>
  <div class="accordion-content" aria-expanded="false" style="transition-duration: 200ms; height: 80px;"></div>
</div>
<div class="accordion-item state-open" role="button" id="Vaccinations" data-index="8">
  <div class="accordion-heading" tabindex="0">
    <div class="title">Vaccinations</div>
    <div class="icon"></div>
  </div>
  <div class="accordion-content" aria-expanded="true" style="transition-duration: 200ms; height: 48px;">
    Visit the City's COVID-19 Vaccinations page for information.
  </div>
</div>
```

Issues: Accordion widget lacks the suggested state attribute markup. Non-sighted users are not fully conveyed the state of the expandable content.

Issues: The collapsed accordion content is still perceivable for AT users. Keyboard and screen reader users have to navigate through all accordion content to reach other page content.

Font-size Selector

Text content should allow for 200% text zoom without loss of content or functionality. Users can set text zoom in-browser and the site style sheets do not override browser text settings, so the site text zoom functionality is unneeded.

Observed Pages:

- All

WCAG:

- 1.4.4 Resize Text

Impacted Users:

- Vision – Low Vision



Issues: Font size selector options do not maximize at 200% text zoom. The largest font size increase available via the widget is 168%.

Tabs

The site tabs widget implementation lacks some relationship, role, and state attribute markup. The widget content requires role and state attribute markup to alert users to the relationships between the tabs items and the visible content, as well as to convey the currently selected item in the tablist.

It is recommended that the developers fully implement tabs widget markup according to the W3C patterns provided in the WAI-ARIA Authoring Practices 1.1. The site implementation is partially correct but lacks the tablist role element, aria-selected and aria-controls attributes suggested in the specification.

Observed Pages:

- <http://www.cityofevanston.org/>

WCAG:

- 1.3.1 Info and Relationships
- 4.1.2 Name, Role, Value

Impacted Users:

- Vision – Blind

Best Practices:

- WAI-ARIA Authoring Practices 1.1 - 3.22 Tabs - <https://www.w3.org/TR/wai-aria-practices-1.1/#tabpanel>

The image shows a comparison between HTML code and a web UI. On the left, the HTML code for a tabbed interface is shown. On the right, the corresponding UI is shown. Red arrows indicate the mapping between the code and the UI elements.

HTML Code (Left):

```
<ul class="nav nav-tabs nav-justified">
  ::before
  <li role="presentation" class="active">
    ::before
    <a href="#tabpanel-1" role="tab" data-toggle="tab" aria-expanded="true">...</a>
  </li>
  <li role="presentation" class">
    <a href="#tabpanel-2" role="tab" data-toggle="tab" aria-expanded="false">Meetings</a>
  </li>
  ::after
</ul>
<!-- Tab panes -->
<div class="tab-content">
  <div role="tabpanel" class="tabpanel-1 tab-pane fade active in">...</div>
  <div role="tabpanel" class="tabpanel-2 tab-pane fade">...</div>
</div>
</div>
```

UI Screenshot (Right):

The UI shows a section titled "Events | Meetings". Below the title is a list of events:

- NOV 23**: Reimagining Public Safety Committee Meeting Virtual (04:00 PM - 05:00 PM)
- NOV 27**: Small Business Saturday (All Day)
- NOV 29**: Menorah Lighting (05:30 PM - 06:30 PM)
- DEC 04**: Gun Buyback (11:00 AM - 03:00 PM)

Red arrows point from the HTML code to the UI elements: one from the "active" class to the "Events" tab, and another from the "Meetings" tab to the "Meetings" section of the UI.

Issues: Tabs widget lacks active state, fully implemented role and relationship attribute markup

Modal Dialog

The sitewide modal dialog widgets display most of the suggested attribute markup but do not represent the inert nature of the main page content for AT users. Some of the contained form content is not logically ordered which may lead to form error submission, but the ordering issue is minor.

It is recommended that the developers fully implement modal dialog widget markup according to the W3C patterns provided in the WAI-ARIA Authoring Practices 1.1. The current modal implementation lacks the suggested aria-modal attribute to convey the inert nature of the remaining page content when the modal is visible and allows users to navigate to the background content.

Observed Pages:

- <https://www.cityofevanston.org/business/bids-proposals>
- <https://www.cityofevanston.org/government/departments/health-human-services/coronavirus-disease>
- <https://www.cityofevanston.org/government/departments/parks-recreation-community-services/facilities/levy-senior-center>
- <https://www.cityofevanston.org/government/departments/public-works/services/street-cleaning>
- <https://www.cityofevanston.org/residents/parking/snow-parking-regulations>

WCAG:

- 1.3.1 Info and Relationships
- 3.3.2 Labels or Instructions
- 4.1.2 Name, Role, Value

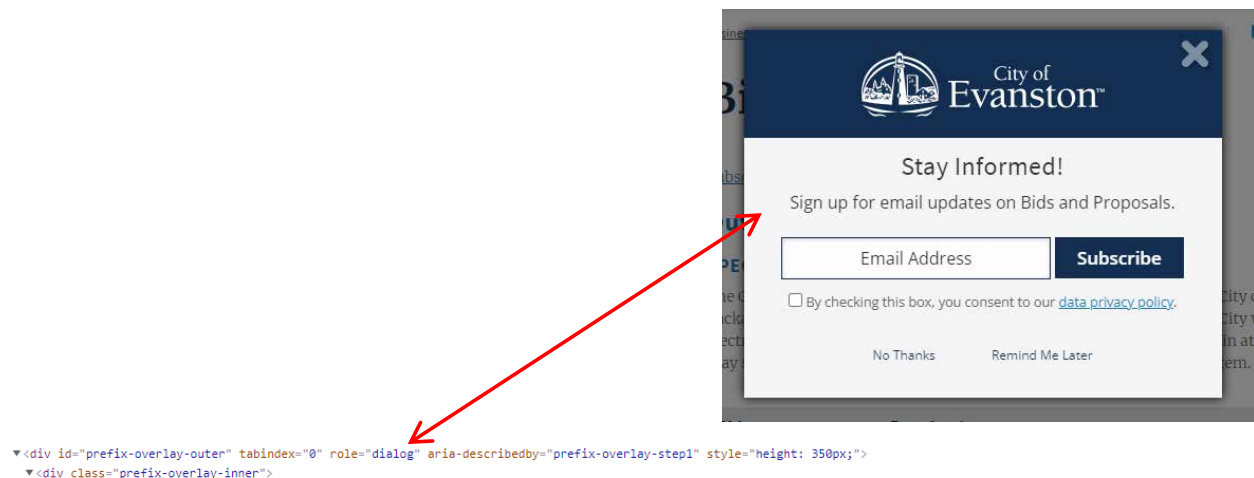
Impacted Users:

- Vision – Blind
- Mobility

Best Practices:

- WAI-ARIA Authoring Practices 1.1 - 3.9 Dialog (Modal) - https://www.w3.org/TR/wai-aria-practices-1.1/#dialog_modal

Issues: Modal dialogs do not create a focus trap when open. User agent focus should loop through the open dialog content until the user explicitly closes the dialog window.



Issues: Modal dialog widgets lack aria-modal attribute values. Some assistive technologies may use this attribute to distinguish non-modal dialog windows that do not display the main content as visibly inert.

Info Dashboard

The Covid-19 related information dashboard widgets represent a combination of complex interactions. The dashboards exhibit tabs widget like behavior along with content that consists of data visualizations, sliders, map content, expandable disclosure content and <svg> based text elements.

Dashboard data visualizations should have tabular data formats available for non-sighted users, as visualizations have inherent issues with translation for screen reader users. Access to tabular data would allow all users to navigate the data and extrapolate trends shown in visual formats. The visible content controls should use semantic HTML elements, such as <button>s, to allow non-pointer users to fully operate the dashboard widget.

Observed Pages:

- <https://www.cityofevanston.org/government/departments/health-human-services/covid-19-vaccinations>
- <https://www.cityofevanston.org/government/departments/health-human-services/coronavirus-disease>
-

WCAG:

- 1.3.1 Info and Relationships
- 1.4.1 Use of Color
- 2.1.1 Keyboard
- 2.4.7 Focus Visible
- 3.3.2 Labels or Instructions

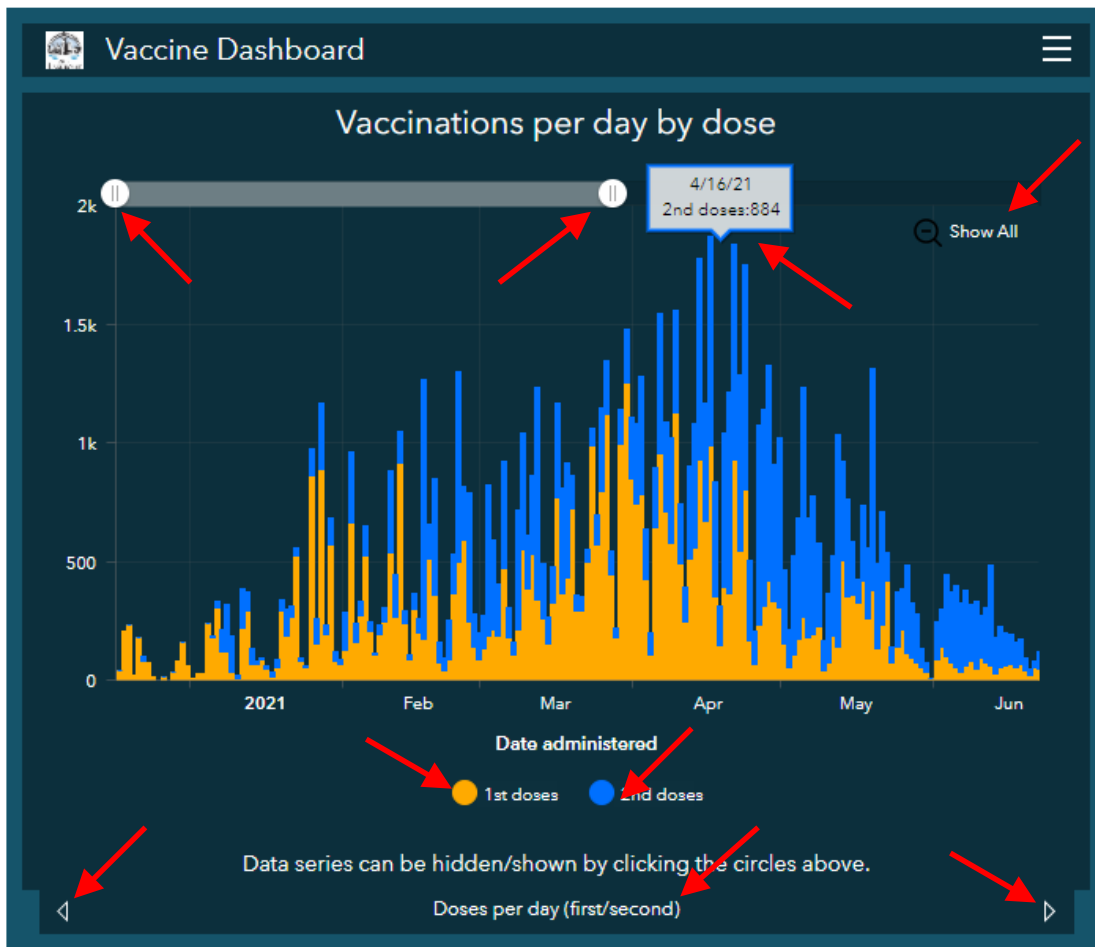
- 4.1.2 Name, Role, Value

Impacted Users:

- Vision – Blind
- Vision – Low Vision
- Mobility
- Vision – Color Blind
- Cognitive


Resources:

- WAI-ARIA Authoring Practices 1.1 - 3.22 Tabs - <https://www.w3.org/TR/wai-aria-practices-1.1/#tabpanel>
- WAI-ARIA Authoring Practices 1.1 - 3.19 Slider (Multi-Thumb)- <https://www.w3.org/TR/wai-aria-practices-1.1/#slidertwothumb>
- WAI-ARIA Authoring Practices 1.1 - 3.5 Button - <https://www.w3.org/TR/wai-aria-practices-1.1/#button>
- WAI-ARIA Authoring Practices 1.1 - 3.10 Disclosure - <https://www.w3.org/TR/wai-aria-practices-1.1/#disclosure>
- <https://fossheim.io/writing/posts/accessible-dataviz-d3-intro/>
- <https://www.betterment.com/resources/accessible-data-visualization/>
- <https://fossheim.io/writing/posts/accessible-dataviz-design/>



The dashboard now includes all Evanston residents who've received COVID-19 vaccinations as reported by the Illinois Department of Public Health (IDPH). This includes those who've received the vaccine at City

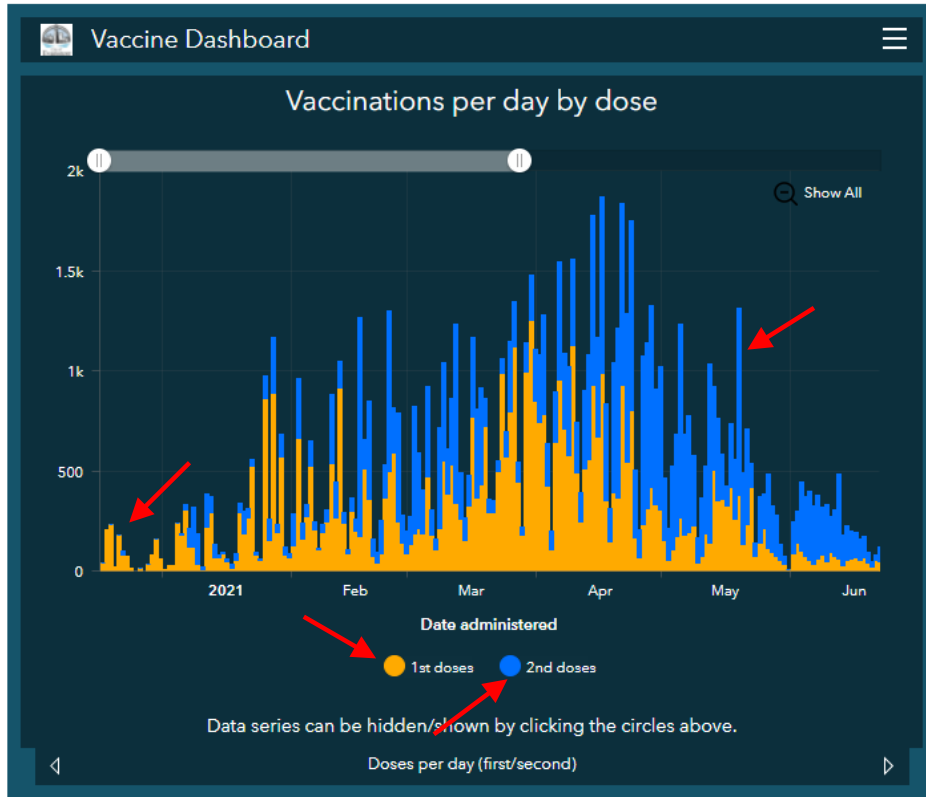Issues: Some dashboard controls are not keyboard operable. Many of the controls (menu toggle, pager controls, in chart slider controls, hover tooltips, etc.) are composed of `<svg>` child elements that have click event handlers implemented to allow interactivity. Assistive technology users would not be able to fully operate the dashboard content.



Issues: Data visualizations use color only to identify data categories. Color should not be the sole means of differentiating data categories or identify an interactive element.






Issues: The visible layout and functionality of the dashboard is a tabs widget, but assistive technology users cannot activate the controls. Users may be unsure how to interact with the widget, the active tab state and the implied layout due to the lack of relationship and state attributes markup.

Issues: Chart data is not available in an alternative tabular format. Data visualizations based on <svg> and <canvas> HTML elements are difficult to generate in a logical reading order and much of the child element information is not conveyed to users. Conveying the data relationships and detail often contained in hover tooltips is also difficult. Properly formatted tabular data as an alternative presentation is recommended as users can more easily perceive the relationships present in the data directly.

Issues: Non-active tabpanel content is perceivable and navigable. Non-active dashboard content is hidden using CSS rule opacity:0, which is still perceivable for assistive technology API's and keyboard users.

Issues: Dashboard content lacks visible focus indication. Non-pointer users rely on visible focus indication to show the current element that would be activated.

			The main menu parent items are expanded on user focus, similar to the hover behavior. This requires keyboard only users to navigate the entire preceding menu structure to reach any specific menu link. Dropdown menu content should not be instantiated on user focus but be explicitly activated by user input.	keypress event handlers to remove the child menu expansion on user focus. Implement keypress event handlers to allow users to expand the menu dropdowns using the enter or spacebar keys. If necessary, add a button to parent elements to allow expansion without activating the menu or each text resize link, add an aria-label attribute value to the <a> link to convey the link purpose to AT users. Visually hidden text may also be used as long as it is still perceivable for assistive technology APi's.			
COE-013	Main menu items expand on user focus	Global			2.1.1 Keyboard	A	High
COE-014	Text resize link icons lack alternative text content	Global	The contents of the text resize links at the top of every page are background images of the letter A. The links lack any other content or label values to describe the link purpose to assistive technology users, who may not be sure of the link purpose. multiple <nav> HTML elements, the main menu wrapper and the sidebar sectional menu wrapper, that are interpreted as navigation landmark regions. Multiple landmark regions of the same type require accessible labels, via an aria-label/aria-labelledby by attribute to distinguish the regions from each other when input has an associated HTML <label> element that is hidden using CSS rule display:none. This makes the content not the language switcher <select> input and the social media links in the footer lack sufficient focus indication. The language switcher lacks any visible indication and the social media link indications rely on an asterisk in the label text to convey their required state to users. The forms lack any legend information to explain the asterisk and rely on users familiarity to explain the the feedback form has a second associated HTML <label> element that contains a field level error message. The message is also associated with the field using the aria-describedby attribute, so the site alert banner is a feedback form validation error message area is a status message region that lacks any programmatic markup. The error message does not take focus, so the container should have a status message role to allow users to access the	For each navigation landmark region, ensure that and aria-label/aria-labelledby attribute value is added to distinguish the regions from one another. style rule, display:none, from the search inputs associated label. If visually hiding the Implement some visual indication of user agent focus for non-pointer users. An outline of sufficient color contrast and thickness is the most common and For each required form field, add attribute required or aria-required=true.	2.4.4 Link Purpose (In Context)	A	High
COE-015	Navigation landmark regions lack labels.	Global			1.3.1 Info and Relationships	A	Medium
COE-016	The search widget label content is not perceivable	Global			2.4.6 Headings and Labels	AA	High
COE-017	Language selection input field and social media icons lack sufficient visible focus indication	Global			2.4.7 Focus Visible	A	Medium
COE-018	Required fields lack programmatic indication	Global		Optionally, add legend text to the form to explain the markup of the field level error message to a semantically neutral HTML element, such as a <div>. Maintain the existing ID attribute value but remove the	3.3.2 Labels or Instructions	A	Low
COE-019	Feedback captcha field has multiple associated labels	Global		Add a status message role to the error message wrapper. An alert role is the most likely role needed for the message purpose. expandable menu item add attributes aria-haspopup=true and aria-expanded=false. Implement scripting to toggle the aria-expanded value to match the visual state of the	4.1.1 Parsing	A	Low
COE-020	The alert banner lacks a feedback form	Global		Add a status message role to the error message wrapper. An alert role is the most likely role needed for the message purpose. expandable menu item add attributes aria-haspopup=true and aria-expanded=false. Implement scripting to toggle the aria-expanded value to match the visual state of the	4.1.3 Status	AA	Low
COE-021	Feedback form error message text lacks status message role markup	Global			4.1.3 Status Messages	AA	Low
COE-022	The main menu items lack accessible state attributes	Global	Many of the main menu items have dropdown items, but lack any attribute values to convey the dropdown state or the existence of the expandable content to assistive technology users.	Fully implement tabs widget markup and interaction patterns as suggested by the WAI-ARIA Authoring Guidelines. See: https://www.w3.org/TR/wai-aria-practices-1.1/#tabpanel https://www.w3.org/TR/wai-aria-practices-1.1/examples/tabs/tabs-2/tabs.html	4.1.2 Name, Role, Value	A	High
COE-023	Events tabpanel widget has incomplete markup	Home	The events tabpanel on the homepage has incomplete attribute markup and keyboard interaction patterns. The widget lacks a tablist roleled element, aria-selected, aria-labelledby and aria-controls attributes. The keyboard interactions also do not follow the suggested patterns.	visual indication of user agent focus for non-pointer users. An outline of sufficient color contrast and thickness is the most common and	4.1.2 Name, Role, Value	A	Medium
COE-024	Button styled links lack sufficient visible focus indication	Global	across the site lack sufficient focus indication. The link indication is not sufficiently visible as it does not surround the entire element. All interactive elements must		2.4.7 Focus Visible	A	Medium

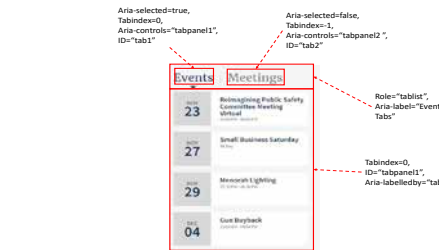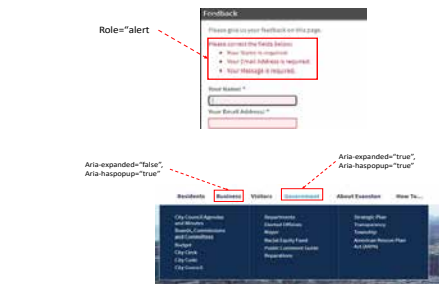

COE-025	Image rotator lacks user controls	Home	The homepage contains an image rotator that lacks user controls to pause or stop rotation. Keypress event scripting allows users to navigate the images using the arrow keys, but no mechanism exists to stop the image rotator from updating. Alternatively, implement full carousel widget markup and interaction patterns as suggested by the WAI-ARIA Authoring Guidelines.	2.2.2 Pause, Stop, Hide	A	Medium



COE-026	Decorative images have non-empty alternative text content	Home	There are several images in the homepage that are decorative, but have non-empty alt text attribute values. All images require an alt text value that describes the image content, or that is the empty string for images that are considered decorative. For each decorative image, change the alt text attribute to the empty string (alt="").	1.1.1 Non-text Content	A	Medium




COE-027	Multiple search fields share ID values	Home	The search inputs in the homepage header and hero image rotator have the same ID attribute value. All elements in a page should have unique ID values to pass HTML validation standards.	4.1.1 Parsing	A	Low
COE-028	The share link content is	Global	The visible text of the month/year text and next/previous links at the top of the event calendar table is a separate HTML table that is used for layout purposes only. Layout tables should have their default semantics removed so that user do not expect tabular data within the table structure. The caption content associated with the events table is "Calendar Grid 641055". Table captions The <select> element filter fields above the event calendar lack accessible label values. They rely on the selected option value	2.4.6	AA	High



COE-029	The event table header is a layout table	Events	For the table above the calendar table markup, add role=presentation to remove the table elements default semantics. Update the table caption content to be relevant to the table content rather than a label using the html <caption> element with Add a submit button	4.1.2 Name, Role, Value	A	Low


COE-030	Calendar events table caption is generic	Events	The table cells each have an aria-label value that is the expanded date text (i.e. "Tuesday, 2 November 2021"). The content of the table cell and associated header cell text is announced but user	2.4.6	AA	Low

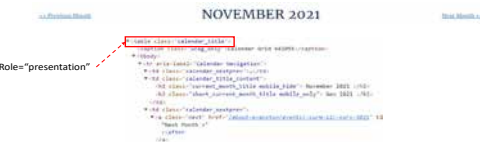

COE-031	Calendar filter fields lack accessible labels	Events	The events table cells each have an aria-label value that is the expanded date text (i.e. "Tuesday, 2 November 2021"). The content of the table cell and associated header cell text is announced but user	3.3.2 Labels	A	High

COE-032	Events filter fields reload	Events	The events table cells each have an aria-label value that is the expanded date text (i.e. "Tuesday, 2 November 2021"). The content of the table cell and associated header cell text is announced but user	3.2.2 On	A	Medium

COE-033	Events table cells have unnecessary label markup	Events	The content of the table cell and associated header cell text is announced but user	1.3.1 Info and Relationships	A	Low

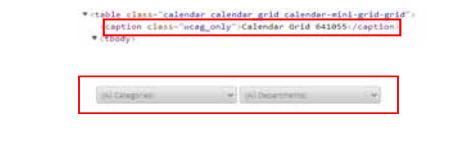

COE-034	Newsletter modal form consent input is after submit button	Bids-Proposals (Global)	The newsletter modal form has a consent checkbox that is after the newsletter submit button both visually and in the DOM order. A low vision or non-sighted user may be unaware of the required input before submitting the form. Rearrange the form controls so that that all form controls and important information is before the submit button in the DOM order	1.3.2 Meaningful Sequence	A	High



COE-035	Email input fields lack accessible labels	Bids-Proposals	newsletter signup modal lacks an accessible label value. It relies on the placeholder text and a non-existent aria-label by target object to provide context to users about the	3.3.2 Labels	A	High


COE-036	Newsletter modal does	Bids-Proposals	The newsletter signup for	4.1.2 Name, A	A	Medium



COE-037	Bids/Proposal table should be two separate tables	Bids-Proposals	The bids and proposal tables is a single HTML <table> element, but visually and logically should be two separate tables. The projects under evaluation section has a visible label and defined headers that signify a different set of tabular data. Users would likely be helped by separating the data into logical groupings. Separate the content of the Bids table into two distinct HTML <table> objects. Ensure that the projects under evaluation table has properly form header and caption markup, using the visually apparent caption and header content. See: https://www.w3.org/WAI/tutorials/tables/	1.3.1 Info and Relationships	A	Medium



COE-038	Sidebar navigation menu items lack stateful attribute markup	Bids-Proposals(Global)	menu consists of some expandable links that lack any programmatic markup to convey the state of the expandable content. The expandable control content is plus or minus sign text that exists after the main menu link content. The menu items function similarly to disclosure widgets and can use the same markup and interaction patterns. Items that are expandable within the page, and others that link to a new page with a different expandable menu. The only difference between the items is the plus/minus symbol in a separate link	widget markup and interaction patterns as suggested by the WAI-ARIA Authoring Guidelines. See: https://www.w3.org/TR/wai-aria-practices-1.1/#disclosure widget markup and interaction patterns for the in-page expandable menu items. Remove the plus symbol preceding the menu item for non-	4.1.2 Name, Role, Value	A	Low
COE-039	Similarly styled sidebar menu items function differently	Bids-Proposals(Global)			3.2.4 Consistent Identification	AA	Low

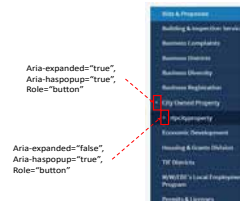


COE-040	The organization chart is an image with generic alternative text	Government	The organization chart that is the main content of the page is an image (mostly of text) that has generic alternative text. The alt text value is "big picture chart- 2018-page-001" which does not convey any of the information in the image.	Offer an alternative version, possibly a list or tabular data, of the organization chart that is not visually perceivable.	1.1.1 Non-text Content	A	Medium



COE-041	Application download links have unneeded text content	Government(Global)	The download application links at the bottom of the page have visually hidden text that is duplicative with the adjacent image text alternative. The visually hidden text can be removed as it does not add any new information.	Remove the visually hidden text content from the application download links. Alternatively, give each icon image an alt text value of the empty string (alt="").	2.4.4 Link Purpose (In Context)	A	Low




COE-042	Agenda and minutes links have negative tabindex values	Agendas-Minutes	The majority of the links in the agenda and minutes listing page have a tabindex attribute value of -1. This removes the links for the normal tab order, making them non-navigable by keyboard users. Non-zero tabindex values should generally not be used in directly writing HTML content.	Remove the tabindex values from the links in the agenda and minutes list.	2.1.1 Keyboard	A	High

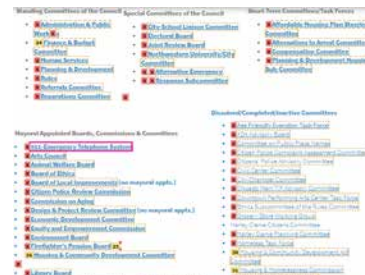

COE-043	Adjacent links are styled differently	Agendas-Minutes	Within the agendas and minutes link list, adjacent links are styled differently based on inline styles for some links. There does not appear to be any reason for the style changes so the links should be consistently displayed.	Remove the inline style rules from the links in the agendas and minutes listing	3.2.4 Consistent Identification	AA	Low



COE-044	Council agenda and minutes links have negative tabindex values	City-Council-Agendas-Minutes	Many of the links in the council agenda and minutes details page have a tabindex attribute value of -1. This removes the links for the normal tab order, making them non-navigable by keyboard users. Non-zero tabindex values should generally not be used in directly writing HTML content.	Remove the tabindex values from the links in the list.	2.1.1 Keyboard	A	High
COE-045	Links table is used for YouTube video iframe	City-Council-Agendas-Minutes	The links table that is used for the embedded YouTube video	Add attribute	1.3.1 Info and Bypass	A	High
COE-046				Ensure that all	2.4.1 Bypass	A	Low

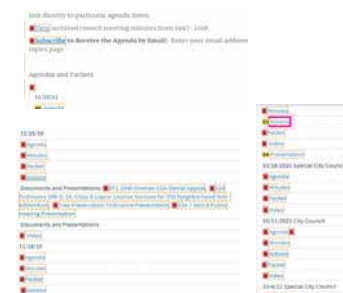

COE-047 Most content links have negative tabindex values City-Council

The majority of the links in the page content have a tabindex attribute value of -1. This removes the links for the normal tab order, making them non-navigable by keyboard users. Non-zero tabindex values should generally not be used in directly writing HTML content.

Remove the tabindex values from the links page content.

2.1.1 Keyboard A High

COE-048 The ward map is an image with generic alternative text City-Council

The ward map image used as the content of a link has generic alternative text. The alt text value is "wards_300x300" which does not convey any of the information in the image or what the link destination might be.

Change the image alternative text value to another, more descriptive value that describes the link destination.

2.4.4 Link Purpose (In Context) A Medium

COE-049 Council member table lacks header markup City-Council

The council member table has visibly styled row header cells that lack the programmatic markup or a table header cell. The content of the page is visible as a list of links with a heading, but lacks any of the markup for a list or any heading elements. The use of an unordered list and an appropriately leveled heading would aid users in understanding the relationships within the content. The date content for each archive item is an unordered list.

1.3.1 Info and Relationships A Low

COE-050 Archive listing has no programmatic structure

COE-051 Collapsed accordion

5Th-Ward Reparatio

Additionally remove the unordered list markup from the When collapsed, hide widget markup and interaction patterns as suggested by the WAI-ARIA Authoring Guidelines. See: <https://www.w3.org/TR/wai-aria-practices-1.1/#accordion> <https://www.w3.org/TR/wai-aria-practices-1.1/examples/accord>

1.3.1 Info and Relationships A Low

COE-052 The accordion widget lacks the suggested markup and interaction patterns

Reparatio ns(Global)

wrong elements or in incorrect combinations.

4.1.2 Name, Role, Value A Medium

COE-053 The top image is the only content of a link with generic alternative text Human-Resources

The top image collage is the only content of a link and has generic alternative text. The alt text value is "Untitled design (1)" which does not convey any of the information in the image or what the link destination might be.

Change the image alternative text value to another, more descriptive value that describes the link destination.

2.4.4 Link Purpose (In Context) A Medium

COE-054 Blue button styled link color fails contrast Human-Resources

The blue link background color (#4B8BB7) has a color contrast ratio of 3.7:1 with the white text color (#FFFFFF). This does not pass color contrast requirements and may cause difficulty for some users.

Use a darker background color to meet the 4.5:1 minimum contrast ratio required for text elements.

1.4.3 Contrast (Minimum) AA Low

COE-055 The top image collage has generic alternative text Covid-19-Vaccinatio ns

The top image collage has generic alternative text. The alt text value is "VaccineCollage2 (1)" which does not convey any of the information in the image.

Change the alt attribute value of the image to the empty string (alt="") to mark the image as decorative and remove it from perception.

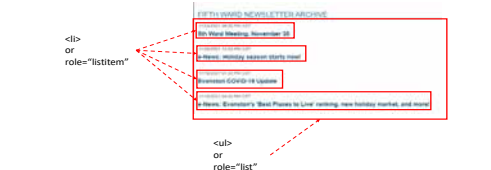

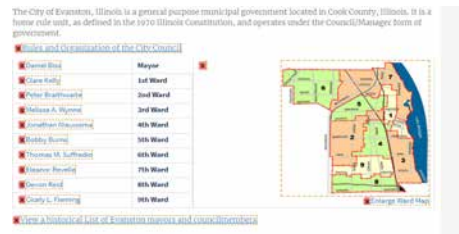
1.1.1 Non-text Content A Medium

COE-056 Vaccine shoutout carousel is mostly not operable or perceivable without a pointer device Covid-19-Vaccinatio ns

The vaccine shoutout carousel controls and content are not navigable or operable without a pointer device. The slide images have non-specific alt text values and the controls are made of semantically neutral HTML elements with click and hover event handlers implemented.

Implement carousel widget markup and interaction patterns as suggested by the WAI-ARIA Authoring Guidelines. See: <https://www.w3.org/TR/wai-aria-practices-1.1/#carousel> <https://www.w3.org/TR/wai-aria-practices-1.1/examples/carousel/carousel-1.html>

4.1.2 Name, Role, Value A Medium




Human Resources






View Employment Opportunities

For technical assistance with the application portal, you can contact HR or click [here](#)

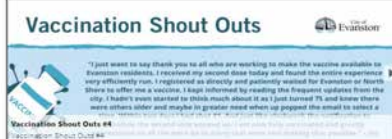View Seasonal Parks & Recreation Employment Opportunities




COE-057	Carousel images have generic alt text	Covid-19-Vaccinations	The carousel images have generic alternative text. The alt text value only give cardinal information but do not describe the text of the image.	Change the alt attribute value of the image to the content of the text in the image.	1.4.5 Images of Text	AA	Medium
COE-058	Non-visible dashboard content is navigable and perceivable	Covid-19-Vaccinations	The content of the various vaccination dashboard pages are navigable and perceivable when not visible. The content is hidden using opacity CSS rules which allow non-pointer users to navigate through the content.	When visibly hidden, apply CSS rules display:none or visibility:hidden to remove the content from perception completely.	2.4.7 Focus Visible	A	High
COE-059	Chart data is not perceivable in an ordered manner	Covid-19-Vaccinations	The vaccination dashboard charts lacks enough value and object labelling and structure to be understandable for some AT users. The axis text is announced in in rtl reading order but the structure or scale represented is not clear. The data points largely are not announced as <svg> shape objects with label attributes. Users would benefit from increased labelling of elements within charts and less reliance on <svg> content and tooltips.	practice to label data points (may be visually hidden) with charts for AT API's. Axes should also be labelled to provide scale context for users. Ensure that the data points and axes are arranged in a way to preserve meaning when announced in DOM order once perceivable. For each chart <svg>, ensure an aria-label or title attribute value have	1.3.1 Info and Relationships	A	High
COE-060	Dashboard slider controls, scroll controls and popup menu links are not keyboard operable	Covid-19-Vaccinations	The dashboard slider and scroll arrow controls and popup menu links are not operable by keyboard only navigation. The controls are composed of neutral <svg> elements and <a> links without href attribute values.	Ensure that each interactive element is navigable by keyboard only. Add attribute tabindex=0 to the element to add it to the normal tab order. Implement keypress event handlers to allow the control to be activated by keyboard only.	2.1.1 Keyboard	A	Medium
COE-061	Dashboard content lacks	Covid-19-Vaccinations	The interactive dashboard menu toggle button for the dashboard menu is a button that lacks any perceivable text content or accessible labels. Users may be unsure of the button purpose without any labelling	Implement some elements have a properly associated accessible label using the aria-label/aria-labelledby attribute value on the button input. If visually hiding an element	2.4.7 Focus	A	High
COE-062	Dashboard menu toggle lacks an accessible label	Covid-19-Vaccinations	The menu toggle button for the dashboard menu is a button that lacks any perceivable text content or accessible labels. Users may be unsure of the button purpose without any labelling	Implement some elements have a properly associated accessible label using the aria-label/aria-labelledby attribute value on the button input. If visually hiding an element	3.3.2 Labels or Instructions	A	High
COE-063	Decorative hero image has non-empty alt text	Beach-Admissions	The hero image at the top of the page is decorative in nature, but has a non-empty string alt text value. The image should have an alt text value of the empty string (alt="") to mark it as decorative and hide it from AT API's	Change the hero image alt text value to the empty string (alt="") to mark the image as decorative.	1.1.1 Non-text Content	A	Low
COE-064	Viply icon image lacks alternative text.	Beach-Admissions	The Viply icon is the only content of a link, but has an alt text value of the empty string. Decorative images are not conveyed to AT users, so the link would be announced by it's src attribute value which may not be informative for users	Add an alt text value to the Viply icon image.	1.1.1 Non-text Content	A	Medium
COE-065	Beach pass tables lack header markup	Beach-Admissions	The various tables in the beach admission page lack table header markup. The first row content is visually styled as a header row, but lacks the programmatic markup to convey this to all users. The embedded beach status frame lacks a title attribute. Assistive technologies use the title attribute value as a label, which users use to determine if the frame content is relevant to their search.	Change the first row table cell markup to table header markup. Use <th> elements or add attribute role="columnheader" to each first row cell.	1.3.1 Info and Relationships	A	Low
COE-066	Beach status iframe lacks a title attribute	Beach-Status-And-Closings	The embedded vaccine number text color (#999999) has a color contrast ratio of 2.8:1 with the white background color (#FFFFFF). This does not pass color contrast requirements and may	Ensure that all embedded iframes have an appropriate title attribute value. Ensure that all	2.4.1 Bypass Blocks	A	Low
COE-067	Vaccine data dashboard	Covid-19-Vaccinations			2.4.1 Bypass	A	Low
COE-068	Grey date and ext status text color fails contrast	Beach-Status-And-Closings		Use a darker text color to meet the 4.5:1 minimum contrast ratio required for text elements.	1.4.3 Contrast (Minimum)	AA	Low

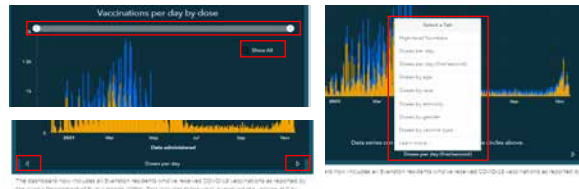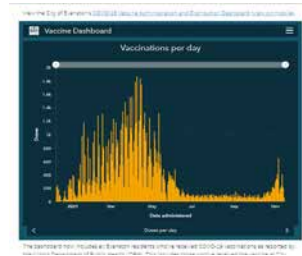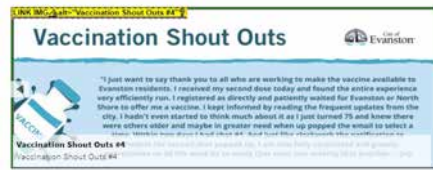

```


<div class="vaccine-dashboard">
  <div class="vaccine-dashboard-header">
    <h1>Vaccine Dashboard</h1>
  </div>
  <div class="vaccine-dashboard-content">
    <div class="vaccine-dashboard-chart">
      <img alt="Vaccine Dashboard Chart" data-bbox="500 480 830 500"/>
    </div>
  </div>
</div>
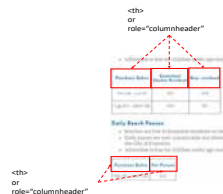
```



Lighthouse Beach	Closed - The water is closed for swimming for the season. Please stay out of the water. The sand portion of the beaches is open daily from 6:00am to 11:00pm.	Updated over 30 days ago	End 1
Clark St. Beach	Closed - The water is closed for swimming for the season. Please stay out of the water. The sand portion of the beaches is open daily from 6:00am to 11:00pm.	Updated over 30 days ago	End 2
Greenwood St. Beach	Closed - The water is closed for swimming for the season. Please stay out of the water. The sand portion of the beaches is open daily from 6:00am to 11:00pm.	Updated over 30 days ago	End 3

COE-069	Status image contrast fails	Beach-Status-And-Closings icon images (#EBE2E2) has a contrast ratio of 1.3:1 with the white background color (#FFFFFF). This does not pass color contrast requirements and may	Use a darker or more opaque image color to meet the 3.0:1 minimum contrast ratio required for non-text elements.	1.4.11 Non-text Contrast	AA	Low



COE-070	Decorative hero image has non-empty alt text	Concerts	The hero image at the top of the page is decorative in nature, but has a non-empty string alt text value. The image should have an alt text value of the empty string (alt="") to mark it as decorative and hide it from AT API's The movie schedule table has no visible content but has multiple row and column cells that have no content. Empty table rows and columns should be removed, with no table displayed if there is no contained content. The The Illinois Arts Council logo image has two additional links to the same content that have no visible content. The links are likely input errors and should be removed to reduce unnecessary	Change the hero image alt text value to the empty string (alt="") to mark the image as decorative. Remove the movie schedule table when no content is present. The heading can remain, and a message about no upcoming movies can replace the table layout, which is Remove the extra adjacent link elements from the Illinois Arts Council icon.	1.1.1 Non-text Content	A	Low
COE-071	Schedule table is only empty rows and columns	Concerts	The Illinois Arts Council logo image has two additional links to the same content that have no visible content. The links are likely input errors and should be removed to reduce unnecessary	Remove the extra adjacent link elements from the Illinois Arts Council icon.	1.3.1 Info and Relationships	A	Medium
COE-072	Illinois arts council logo has 3 links to the same content	Concerts	The Illinois Arts Council logo image has two additional links to the same content that have no visible content. The links are likely input errors and should be removed to reduce unnecessary	Remove the extra adjacent link elements from the Illinois Arts Council icon.	1.3.1 Info and Relationships	A	Medium

[illegible][illegible]

COE-073	Sponsor logo alt text is mostly generic	Concerts	The logo images for the concert sponsorships have generic alternative text content. The values seem to be based on the image src attribute values but does not describe the logo purpose.	Update the logo image alt text content to be more clear about the logo company name or purpose.	1.1.1 Non-text Content	A	Low

COE-074	The thank you image has generic alternative text	Concerts	The sponsor thank you image is mostly text but has generic alternative text. The alt text value is "Sponsor Thank You Starlight (1)" which does not convey any of the information in the image. The subscribe button in the newsletter subscribe modals perceivable focus indication is a change in border radius. Changes in shape or position alone are insufficient on their own and cannot be the only means of identifying an interactive element.	Update the image alt text content to match the content of the image more clearly. Implement some additional visual indication of user agent focus for non-pointer users. An outline of sufficient color contrast and thickness is the most common and expected form of	1.1.1 Non-text Content	A	Medium
COE-075	The newsletter subscribe button focus indication relies on a change in shape	Levy-Senior-Center (Global)			1.3.3 Sensory Characteristics	A	Medium

COE-076	YouTube embed is not keyboard navigable	Levy-Senior-Center	This does not allow keyboard users to navigate into the frame to activate	Remove the tabindex value from the video iframe object.	2.1.1	Keyboard	A	High

COE-077	Programs link has a negative tabindex value	Levy-Senior-Center	it non-navigable by keyboard users. Non-zero tabindex values should	Remove the tabindex value from the link.	2.1.1 Keyboard	A	High

COE-078	Decorative body content images have non-empty alt text	Levy-Senior-Center	The decorative images in the page body can be considered decorative, but have non-empty string values as alt text. The images should have alt text values of the empty string (alt="") to mark them as decorative and hide it from AT APIs.		Change the image alt text values to the empty string (alt="") to mark the images as decorative.	1.1.1 Non-Text Content	A	Low



```
* <iframe width="560" height="315" src="https://www.youtube.com/embed/oa2P7Wz_g" frameborder="0" allowfullscreen tabindex="-1">
```

the date of purchase.

Programs for seniors are held weekdays from 9:00 a.m. to 3:00 p.m. Programs for all ages are held in the evening and on the weekends. Programs that are included with your Levy Membership [Programs](#)

The Levi Senior Center's award-winning building is located in the southeast corner of James Park on

```

<div href="/home/chiuhai/attachment/15854/337328113878000" target="_blank" tabindex="1" style="word-spacing: 0.5em; letter-spacing: -0.5em; font-size: 1.2em; color: #000080;">

```



We Support the Senior Olympics

The Jay Senior Center has an active basketball program for men and women 55 and older who make an effort to send basketball teams to the bi-annual Jay's Seniors and Jay's Senior Olympics. If you are interested in playing, please call the Center for more information at 867-448-6282.



For Trip Scholarships/Free Assistance
 In the David L. Langley Award for Trip Scholarships, the Foundation helps subsidize trip costs for those in need. Applications are available at the front office and completely confidential. In addition, Langley Center members pay a discounted fee for classes offered at the Langley Center.

An aerial photograph showing a sandy beach on the left, a small white building with a dark roof in the center, and a large, mature tree to the right of the building. The background features a dense forest of trees with green and some autumn-colored foliage. A yellow label at the top reads "Shady Lake from the beach". There are some faint, illegible labels at the bottom of the image.

Beach Locations and Hours

<u>Lighthouse Beach</u>	<u>Lincoln Street Beach</u>
Currently closed for swimming on weekdays	~~XX~~ ~~Closed 24 hours under construction~~
Hours	Hours
Aug. 22 to September 8, 9 a.m. to 7:30 p.m.	Aug. 23 to September 8, 9 a.m. to 7:30 p.m.
Accessible swimming beach for people with disabilities	
<u>Clerk Street Beach</u>	<u>Greenwood Street Beach</u>
Currently closed for swimming on weekdays	Currently closed for swimming on weekdays
Hours	Hours
Aug. 22 to September 8, 9 a.m. to 7:30 p.m.	Aug. 23 to September 8, 9 a.m. to 7:30 p.m.
Accessible swimming beach for people with disabilities	
<u>Lee Street Beach</u>	<u>South Broadway Beach</u>
Currently closed for swimming on weekdays	Currently closed for swimming on weekdays
Hours	Hours
Aug. 23 to September 8, 9 a.m. to 7:30 p.m.	Aug. 23 to September 8, 9 a.m. to 7:30 p.m.
Accessible swimming beach for people with disabilities	Accessible swimming beach for people with disabilities

```
* include "ColumnContext" class=column webid,url =  
    @webid(url), @url(url) # @url(url) is valid  
# url class= twitter_feed mobile_list content_new class=""
```

Twitter

Evanston, IL Police
@EvanstonPD NOV 26
Watch today's press conference regarding the shooting that occurred on 8/2/16 at Green Bay & LaSalle Ave.
<https://t.co/WQW0V9U5Mq>

Evanston, IL Police
@EvanstonPD NOV 29
#EvanstonPD is investigating a shooting at
Green Bay & LaSalle Ave.

The screenshot shows a tweet from Evanston, IL Police (@EvanstonPD) dated Nov 24. The tweet text is: "Watch this year's conference regarding the shooting that occurred on 11/21 at Green Bay 161 (Arbery Ave.)". The link to the video is highlighted with a red box. Below the text is a video player thumbnail showing a street scene with a red car and a person walking. The video title is "Watch this year's conference regarding the shooting that occurred on 11/21 at Green Bay 161 (Arbery Ave.)". The video player controls are visible at the bottom of the tweet.

[illegible]

Stay on top of street cleaning!
Sign up for convenient email notifications.

Enter email address

No Thanks Remind Me Later

To sign up for SMS alerts, [click here](#) to send "SMS" text messages.

COE-088 Map images have adjacent empty links

Street-Cleaning(Global)

The map images in the page body content have an adjacent link that is empty of content to the same resource. The link is unnecessary and should be removed as a likely data entry error.

Remove the adjacent empty <a> link next to each map image in the page content.

2.4.4 Link Purpose (In Context)

A

Low



COE-089 Content image alt text is generic

Street-Cleaning(Global)

The in-content images in the page have generic alternative text content. The values seem to be based on the image src attribute values but does not describe the image purpose.

Update the image alt text content to be more clear about the image content or purpose.

1.1.1 Non-text Content

A

Low



COE-090 Decorative hero image has non-empty alt text

Special-Pick-Ups-And-Bulk-Collection

The hero image at the top of the page is decorative in nature, but has a non-empty string alt text value. The image should have an alt text value of the empty string (alt="") to mark it as decorative and hide it from AT APIs.

Change the hero image alt text value to the empty string (alt="") to mark the image as decorative.

1.1.1 Non-text Content

A

Low



COE-091 Bulk collection schedule tables lack header markup

Special-Pick-Ups-And-Bulk-Collection

The bulk pickup schedule tables in the page lack table header markup. The first row content is visually styled as a header row, but lacks the programmatic markup to convey this to all users.

Change the first row table cell markup to table header markup. Use <th> elements or add attribute role="columnheader" to each first row cell.

1.3.1 Info and Relationships

A

Low

<th> or role="columnheader"		<th> or role="columnheader"	
Fall 2021 Bulk Trash Collection:		Fall 2021 Bulk Trash Collection:	
If your normal trash collection day is:	Your bulk trash collection day is:	If your normal trash collection day is:	Your bulk trash collection day is:
Wednesday	Friday, April 2	Wednesday	Friday, September 17
Thursday	Friday, April 9	Thursday	Friday, September 24
Monday	Friday, April 16	Monday	Friday, October 1
Tuesday	Friday, April 23	Tuesday	Friday, October 8

COE-092 The accordion content has adjacent empty links

Waste-Services

The accordion content has two repetitive, adjacent links that are empty of content to the same resource. The links are unnecessary and should be removed as a likely data entry error.

Remove the adjacent empty <a> links in the accordion content.

2.4.4 Link Purpose (In Context)

A

Low



COE-093 Billing schedule tables lack header markup

Water-Ebiling

The e-billing schedule table in the page lacks table cell markup to table header markup. The first row content is visually styled as a header row, but lacks the programmatic markup to convey this to all users.

Change the first row table cell markup to table header markup. Use <th> elements or add attribute role="columnheader" to each first row cell.

1.3.1 Info and Relationships

A

Low

<th> or role="columnheader"		
Usage/Service Period	Bills Distributed	Payment Due
November - December	January	February
January - February	March	April
March - April	May	June
May - June	July	August

COE-094 Content image alt text is generic

Water-Ebiling

The in-content image in the page has generic alternative text content. The image is largely decorative and should be hidden from users with an empty string alt text value.

Update the image alt text attribute value to the empty string (alt="") to mark the image as decorative.

1.1.1 Non-text Content

A

Low



The first information table in the page is a layout table is not enhanced by tabular data relationship. The first column content are icon images that should be considered decorative and hidden from AT users.

311

1.3.1 Info and Relationships A

Low

Role="presentation"



The information icon images have non-empty alt text but are decorative

311

1.1.1 Non-text Content A

Low



Decorative hero image has non-empty alt text

Make-A-Payment

311

1.1.1 Non-text Content A

Low



Content image alt text is generic

Residents

311

1.1.1 Non-text Content A

Low



The page contains an alternate language section that lacks a lang attribute for the section. AT API's rely on language attributes to aid in pronunciation for users with different default language settings.

Residents

311

3.1.2 Language of Parts AA

Medium

<div lang="es" />

Need a residential parking permit or want to find out how to contest your parking citation? Check out the [FAQ](#) section.

Residente
¿Nuevo en la ciudad de Evanston?
¡Bienvenido a esta hermosa ciudad! Desde el momento en que llegas a esta ciudad, eres parte de Evanston.
¿No estás seguro que día recoges tu basura?
¡Aquí te lo contamos! ¿Quieres saber más sobre la recolección de basura y los servicios de mantenimiento?
¡Recibe un permiso de estacionamiento residencial o quiere saber cómo impugnar su multa de estacionamiento?

The hero image at the top of the page is decorative in nature, but has a non-empty string alt text value. The image should have an alt text value of the empty string (alt="") to mark it as decorative and hide it from AT API's.

Farmers-Market

311

1.1.1 Non-text Content A

Low



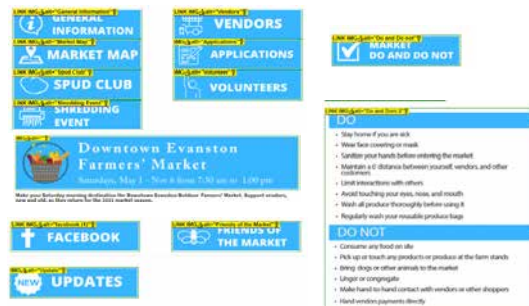
The alt text values of many of the images in the page does not match the image content, which are largely images of text. Most of the image presentation could be achieved with live text and should be converted to text with CSS styling. If not possible for some text images, update the alt text content to match the visible text in each image.

Farmers-Market

311

1.4.5 Images of Text AA

High



```

graph TD
    subgraph DO
        D1[Work hard, covering up mistakes]
        D2[Guarantee your work before entering the market]
        D3[Negotiate w/ distance between personal, emotions, and other considerations]
        D4[Lying to interviewers with others]
        D5[Avoid becoming too sure, honest, and reliable]
        D6[Watch all products thoroughly before using it]
        D7[Regularly visit your website product blog]
    end

    subgraph DO_NOT
        DN1[Consume any food any day]
        DN2[Allow other people to produce or produce at the time others intend]
        DN3[Being cheap or offer products to the market]
        DN4[Consume or overconsume]
        DN5[Make Report to hand contact with someone on other programs]
        DN6[Handwritten documents directly]
    end
  
```

The screenshot shows the HTML source code for a web page. At the top, there is a navigation bar with a logo and a list of links: "HOME", "ABOUT", "CONTACT", "APPLICATIONS", "GENERAL INFORMATION", and "VOLUNTEERS". The "APPLICATIONS" link is highlighted with a red box. Below the navigation bar, there is a section titled "GENERAL INFORMATION" with a blue header and a list of links: "HOME", "ABOUT", "CONTACT", "APPLICATIONS", "GENERAL INFORMATION", and "VOLUNTEERS". The "GENERAL INFORMATION" link is also highlighted with a red box.

Role="presentation"

Parking Garages and Lots - Current Availability

Real Time Parking Occupancy

Garages		
1800 Main North Entrance	Church Street North Entrance	Sherman Plaza North Entrance

[View Real Time Data](#)

Occupancy Availability Prediction

Lots		
Central Zone ¹ 100% availability	Main/Dempster Zone ² 100% availability	Downtown Zone ³ 100% availability

¹ Central Zone includes Lot 4, Lot 21, and Lot 56
² Main/Dempster Zone includes Lot 24 and Lot 50
³ Downtown Zone includes Lot 3, Lot 10, Lot 23, and Lot 27

Parking Regulations

No Parking Regulations

Information: Call 311

Street Cleaning

March 1 - June 15
1st Thursday
of Month
8am-1pm

Snow Emergency

After 4 inch Snowfall
Even Dates
8am-6pm

Follow the posted street signs for

Powered by [SmartSigns](#)

Sherman Plaza

No Parking Regulations

Information: Call 311

Street Cleaning




March 1–Dec 15
1st Thursday
of Month
9am–1pm






Snow Emergency

After 4-inch Snowfall
Even Dates
8am–6pm

Special Notes

COE-109	Two content links have a negative tabindex value	Wheel-Tax	There are two links in the main page content that have a tabindex attribute value of -1. This removes the link for the normal tab order, making it non-navigable by keyboard users. Non-zero tabindex values should generally not be used in directly writing HTML content.	Remove the tabindex value from the links.	2.1.1 Keyboard	A	High
COE-110	The in-page links have repeated content.	Parks-Rec	The three image links in the middle of the page have repetitive content due to the adjacent text and images with the same alt text value. As both values are available to users, the image is not adding information and should be marked as decorative.	Change the image alt text values to the empty string (alt="") to mark the images as decorative and remove the repetitive content	2.4.4 Link Purpose (In Context)	A	Low
COE-111	Most page links have negative tabindex values	Permits-Licenses	The majority of the links in the permits link listing page have a tabindex attribute value of -1. This removes the links for the normal tab order, making them non-navigable by keyboard users. Non-zero tabindex values should generally not be used in directly writing HTML content.	Remove the tabindex values from the links in the agenda and minutes list.	2.1.1 Keyboard	A	High
COE-112	Content image alt text is generic	Coronavirus-Disease	The in-content image in the page has generic alternative text content. The image is largely decorative and should be hidden from users with an empty string alt text value.	Update the image alt text attribute value to the empty string (alt="") to mark the image as decorative.	1.1.1 Non-text Content	A	Low
COE-113	The Communications update section has empty links	Coronavirus-Disease	The Communications Update accordion section has empty links adjacent to content that are likely data entry errors. The links are unnecessary and should be removed to reduce navigation for keyboard users.	Remove the empty adjacent links from the content that are unnecessary. If needed, ensure the links have perceivable content for AT users.	1.3.1 Info and Relationships	A	Low
COE-114	The case dashboard is a tabs widget without any of the markup or interaction patterns	Coronavirus-Disease	The coronavirus case dashboard is visible and functionally a tabs widget but lacks most of the markup and interaction patterns expected. The tabs are not keyboard navigable and lack any state or relationship markup to convey the widget state to users.	Implement tabs widget markup and interaction patterns as suggested by the WAI-ARIA Authoring Guidelines. See: https://www.w3.org/TR/wai-aria-practices-1.1/#tabpanel https://www.w3.org/TR/wai-aria-practices-1.1/examples/tabs/tabs-2/tabs.html	4.1.2 Name, Role, Value	A	High
COE-115	YouTube embed videos lack audio descriptions tracks	Global	The videos across the site contain visible text and actions that are not conveyed to non-sighted users via an audio description track. All pre-recorded audio content requires an audio description track to convey non-verbal content to users.	Upload an alternative audio description track to original YouTube video.	4.1.2 Audio Description (Prerecorded)	AA	Medium

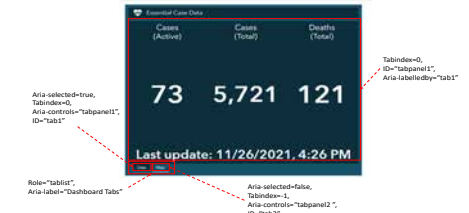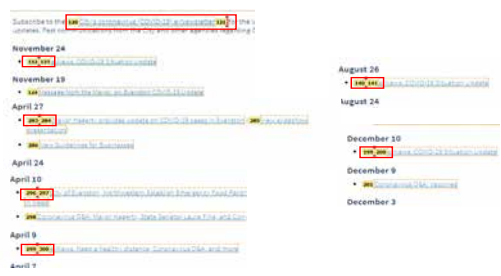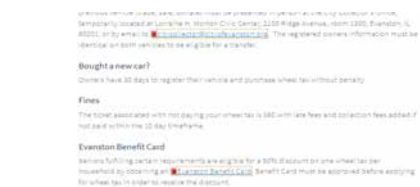

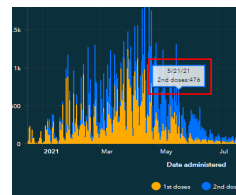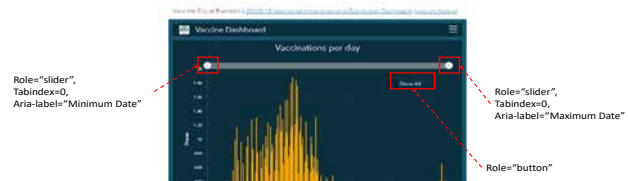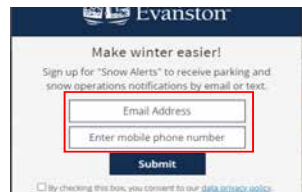[illegible]

Address	
Mid Identifier	800-224-00-20
Status	Active
Broadcast Date	11/11/2021
Expiry Date	12/30/2021
Mid Name	800-224-00-20
Address	
Mid Identifier	
Status	
Broadcast Date	
Expiry Date	
Mid Name	
Address	
Mid Identifier	800-224-00-20
Status	Active
Broadcast Date	11/11/2021
Expiry Date	12/30/2021
Mid Name	800-224-00-20
Address	
Mid Identifier	800-224-00-20
Status	Active
Broadcast Date	11/11/2021
Expiry Date	12/30/2021
Mid Name	800-224-00-20
Address	












```

* class [id="idnav_972_8_500" class="highlight sidebar mobile_list ul-sidebar-desktop"]
  <? class="mobile_only mobile_header" -- #?
    "Data to subpage..."
  </after>
  </?>
  <? class="highlight"
  </after>
  </?>

```

				Ensure that all pages allow for content reflow at smaller screen sizes without a loss of content.				
				The content of each calendar date in small screen mode is contained within a hover tooltip that is not keyboard operable. The content of the calendar table events is not navigable without a pointer device in this version. Screen reader users may not be able to activate the tooltip or perceive the unopen tooltip content. The tooltips in the small	Implement the preliminary tooltip widget markup and interaction patterns as suggested by the WAI-ARIA Authoring Guidelines. See: https://www.w3.org/TR/wai-aria-practices-1.1/#tooltip	1.4.10 Reflow	AA	Low
COE-126	The events calendar tooltips are not keyboard operable	Events				1.4.13	AA	
COE-127	Calendar tooltips are not	Events		hidden <h1> element, whose text content is "City of Evanston", before the home logo link in the header. Most pages also have a visible <h1> element as the page title in addition to this markup. Pages generally should be limited to a single <h1> element that describes the specific page topic or purpose. The hidden heading markup is useful for pages such as the homepage, that lack any other main heading markup, but is duplicative	For pages with a visible page heading level one element, remove or fully hide the visible hidden but perceivable <h1> element in the site header. Other <h1> markup in a page should be changed to a lower heading level (using attribute aria-level or changing the markup to an <h2>-<h6> element)	2.4.6	Headings and Labels	Medium
COE-128	Most pages have multiple heading level one elements	Global						
				The page markup contains empty heading element markup used for line breaks and possibly data entry error. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low
COE-129	Page contains empty heading markup	Summer-Camps						
				The page markup contains empty heading element markup used for line breaks and possibly data entry error. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low
COE-130	Page contains empty heading markup	Human-Resources						
				The page markup contains empty heading element markup used for line breaks. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low
COE-131	Page contains empty heading markup	Covid-19-Vaccinations						
				The page markup contains empty heading element markup used for line breaks. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low
COE-132	Page contains empty heading markup	Beach-Admissions						
				The page markup contains empty heading element markup used for line breaks. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low
COE-133	Page contains empty heading markup	Lakefront-And-Beaches						
				The page markup contains empty heading element markup used for line breaks. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low
COE-134	Page contains empty heading markup	Residents						
				The page markup contains empty heading element markup used for line breaks. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low
COE-135	Page contains empty heading markup	Farmers-Market						
				The page markup contains empty heading element markup used for line breaks. Heading markup should contain text content that is descriptive of the preceding content section.	Remove empty heading markup in the page. Use other HTML elements, such as <div>'s to create the line breaks or <hr> like content	2.4.6	Headings and Labels	Low

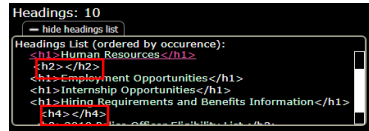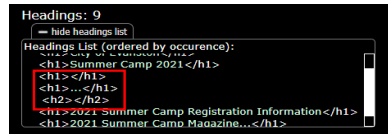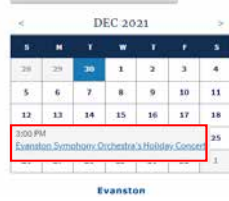

City of Evanston PDF Accessibility Audit

Document 1: BUILDINGPERMITPROCESSFINAL

Pages: 1

WCAG 1.1.1 Non-text Content – Level A

- There are paths and images in the document that should be artifacted.
- The flow chart needs to be tagged and alternate text added to the tag.
- The Logo needs to be tagged and alternative text added to the tag.

WCAG 1.3.1 Info and Relationships – Level A

- Tags within the tag tree have not all been nested underneath the overarching <Document> tag.
- Link “permitdesk@cityofevanston.org” does not have a Link OBJR tag.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.

WCAG 1.4.3 Contrast (Minimum) – Level AA

- Text Color Failures
 - o Staff Review Approved – White on Green (#94B554)
 - o Staff Review Approved and Committee Approved if Needed – White on Teal (#53A4C0)

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- Title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 2.4.7 Focus Visible – Level AA

- Link “permitdesk@cityofevanston.org” does not have a visual indicator.

Document 2: EBCBrochure

Pages: 2

WCAG 1.1.1 Non-text Content – Level A

- The Logo needs to be tagged and alternative text added to the tag.
- Paths in the document need to be artifacted.

WCAG 1.3.1 Info and Relationships – Level A

- Document is not marked as tagged document.
- Tags need to be added to the document.
- Link “aging@cityofevanston.org” does not have a Link OBJR tag.

- Link “www.cityofevanston.org/residents/senior-services/benefit-card-program” does not have a Link OBJR tag.
- Lists need to have proper structure.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set.
- Tab order is not set for the document.

WCAG 1.4.3 Contrast (Minimum) – Level AA

- Text Color Failures
 - o White on Orange (#F1981B)
 - o White on Green (#40B49F)

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- Title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 2.4.7 Focus Visible – Level AA

- Link “aging@cityofevanston.org” does not have a visual indicator.
- Link “www.cityofevanston.org/residents/senior-services/benefit-card-program” does not have a visual indicator.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

Document 3: Farmers Market Guidelines

Pages: 2

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Link “iogbo@cityofevanston.org” does not have a Link OBJR tag.
- Link “www.cityofevanston.org” does not have a Link OBJR tag.
- Link “Venmo” does not have a Link OBJR tag.
- Link “Apple Pay” does not have a Link OBJR tag.
- Lists need to have proper structure.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- A meaningful title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 2.4.7 Focus Visible – Level AA

- Link “iogbo@cityofevanston.org” does not have a visual indicator.
- Link “www.cityofevanston.org” does not have a visual indicator.
- Link “Venmo” does not have a visual indicator.
- Link “Apple Pay” does not have a visual indicator.

Document 4: FillableFeeAssistanceAppli

Pages: 1

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Document is not tagged.
- Document is not marked as tagged document.
- Form fields need to be tagged

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set.
- Tab order is not set for the document.

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- The title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.
- The labels for the form fields are not set properly.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

WCAG 3.3.2 Labels or Instructions – Level A

- Form fields need proper tooltips and labels.

Document 5: OffStreetParkingLotsMa

Pages: 1

WCAG 1.1.1 Non-text Content – Level A

- Alternative text is needed for the map.

WCAG 1.3.1 Info and Relationships – Level A

- Document is not tagged.
- Document is not marked as tagged document.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set.
- Tab order is not set for the document.

WCAG 1.4.1 Use of Color – Level A

- Color can not be the only indicator of the labels on the map.

WCAG 1.4.3 Contrast (Minimum) – Level AA

- Text Color Failures
 - Link text light blue (#6865FD) on white background.

WCAG 1.4.11 Non-text Contrast – Level AA

- Image Color Failures
 - Grey (#828282) street labels on the light grey (#DCDCDC) background.

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- The title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

Document 6: PetLicenseApplication

Pages: 1

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Document needs proper tags.
- Tags within the tag tree have not all been nested underneath the overarching Document tag.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set.

WCAG 1.4.3 Contrast (Minimum) – Level AA

- Text Color Failures
 - o Light blue (#5881B0) text on white background.
 - o White text on light blue (#CBD7EA) background.

WCAG 1.4.5 Image of Text – Level AA

- The text in the document needs to be recognized and tagged.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- The title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

Document 7: Revised121520TheCommunityM

Pages: 8

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Tags within the tag tree have not all been nested underneath the overarching Document tag.
- Tables need to have headers assigned.
- Link “www.cityofevanston.org” does not have a Link OBJR tag.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.

WCAG 1.4.3 Contrast (Minimum) – Level AA

- Text Color Contrast
 - o Red (#FF0000) text on white background.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- The title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 2.4.7 Focus Visible – Level AA

- Link “www.cityofevanston.org” does not have a visual indicator.

Document 8: Revised121520TheCommunityM

Pages: 3

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Tags within the tag tree have not all been nested underneath the overarching Document tag.
- Tables need to have headers assigned.
- Lists need to have the correct structure.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- The title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Correct headings need to be added to the structure of the document.

Document 9: SnowRoutes24000

Pages: 1

WCAG 1.1.1 Non-text Content – Level A

- Alternative text is needed for the map.

WCAG 1.3.1 Info and Relationships – Level A

- Document is not tagged.
- Document is not marked as tagged document.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set.

- Tab order is not set for the document.

WCAG 1.4.1 Use of Color – Level A

- Color cannot be the only indicator of the labels on the map.

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- The title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

Document 10: SnowShovelingAssistanceFor

Pages: 2

WCAG 1.3.1 Info and Relationships – Level A

- Tags within the tag tree have not all been nested underneath the overarching Document tag.
- Document needs proper tags.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set.
- Tab order is not set for the document.

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- Meaningful title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

Document 11: SpecialCityCouncilMeetingO

Pages: 3

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Document needs proper tags.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.

WCAG 1.4.5 Image of Text – Level AA

- The text in the document needs to be recognized and tagged.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

Document 12: StreetCleaning_TwoSided_Ma

Pages: 2

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.
- The Map needs alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Document needs proper tags.
- Link “www.cityofevanston.org/streetcleaning” does not have a link OBJR tag.
- Link “www.cityofevanston.org/mapdisclaimers.html” does not have a link OBJR tag.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.
- The tab order is not set to follow document structure.

WCAG 1.4.1 Use of Color – Level A

- Color cannot be the only indicator of the labels on the map.

WCAG 1.4.3 Contrast (Minimum) – Level AA

- Text Color Contrast
 - o Grey (#808284) text on white background on page 2.

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- Meaningful title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

Document 13: SubsidizedTransportationPr

Pages: 2

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Document needs proper tags.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.
- Tab order is not set for the document.

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 2.4.7 Focus Visible – Level AA

- Link “aging@cityofevanston.org” does not have a visual indicator.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

Document 14: WardsLetterColor

Pages: 1

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.
- The Map needs alternative text.

WCAG 1.3.1 Info and Relationships – Level A

- Document needs proper tags.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.
- Tab order is not set for the document.

WCAG 1.4.1 Use of Color – Level A

- Color cannot be the only indicator of the labels on the map.

WCAG 2.1.1 – Keyboard

- The tab order is not set to follow document structure.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- Meaningful title is not set in Properties.
- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 3.1.1 Language of Page – Level A

- The language is not set for the document.

Document 15: WheelTaxApplication2022

Pages: 2

WCAG 1.1.1 Non-text Content – Level A

- Logo needs to have alternative text.
- There are paths and images in the document that should be artifacted.

WCAG 1.3.1 Info and Relationships – Level A

- Document needs proper tags.
- Tags within the tag tree have not all been nested underneath the overarching Document tag.
- Tables need correct structure.

WCAG 1.3.2 Meaningful Sequence – Level A

- The reading order of the document is not set correctly.

WCAG 2.4.1 Bypass Blocks

- There are no headings tagged in the document.

WCAG 2.4.2 Page Titled – Level A

- Property to display Title is not set.

WCAG 2.4.6 Headings and Labels – Level AA

- Headings need to be added to the structure of the document.

WCAG 2.4.7 Focus Visible – Level AA

- Link “citycollector@cityofevanston.org” does not have a visual indicator.

Tagged/Untagged Documents

See the table below for details on the tagged/untagged documents.

Document	Pages	Tagged?
BUILDINGPERMITPROCESSFINAL	1	Yes
EBCBrochure	2	No
Farmers Market Guidelines	2	Yes
FillableFeeAssistanceAppli	1	No
OffStreetParkingLotsMa	1	No
PetLicenseApplication	1	Yes
Revised121520TheCommunityM	8	Yes
RightofWayApplication2020n	3	Yes
SnowRoutes24000	1	No
SnowShovelingAssistanceFor	2	Yes
SpecialCityCouncilMeetingO	3	Yes
StreetCleaning_TwoSided_Ma	2	Yes
SubsidizedTransportationPr	2	Yes
WardsLetterColor	1	No
WheelTaxApplication2022	2	Yes

32. <https://www.cityofevanston.org/residents/parking/snow-parking-regulations>
33. <https://www.cityofevanston.org/government/departments/community-development/residential-permits>
34. <https://www.cityofevanston.org/government/departments/public-works/services/water-ebilling>
35. <https://www.cityofevanston.org/government>

PDFs

1. <https://www.cityofevanston.org/home/showpublisheddocument/54055/637139236756500000>
2. <https://www.cityofevanston.org/home/showpublisheddocument/62959/637526155923800000>
3. <https://www.cityofevanston.org/home/showpublisheddocument/65430/637631756181070000>
4. <https://www.cityofevanston.org/home/showpublisheddocument/63353/637541897946400000>
5. <https://www.cityofevanston.org/home/showpublisheddocument/33363/636501398603100000>
6. <https://www.cityofevanston.org/home/showpublisheddocument/66731/637697304025770000>
7. <https://www.cityofevanston.org/home/showpublisheddocument/4216/637589173356000000>
8. <https://www.cityofevanston.org/home/showpublisheddocument/35809/637575310668770000>
9. <https://www.cityofevanston.org/home/showpublisheddocument/4196/636229249847530000>
10. <https://www.cityofevanston.org/home/showpublisheddocument/4797/637336247129570000>
11. <https://www.cityofevanston.org/home/showpublisheddocument/65228/637622887564830000>
12. <https://www.cityofevanston.org/home/showpublisheddocument/65230/637622906461170000>
13. <https://www.cityofevanston.org/home/showpublisheddocument/59917/637393136407870000>
14. <https://www.cityofevanston.org/home/showpublisheddocument/60956/637436364522930000>
15. https://content.govdelivery.com/attachments/ILEVANSTON/2020/04/22/file_attachments/1433790/Farmers%20Market%20Guidelines.pdf

Blind/Low Vision User Testing

Goal: Microassist auditor Josh Swatosh will provide experience feedback on the usability of the City of Evanston site.

Method: For this review, Josh will be given tasks to accomplish. The tasks will simulate real-world activities that any person, including people with disabilities, would perform on the site. The guide auditor, Jamaar Cormier, will only intercede in the event a task cannot be accomplished.

Assistive Technology: JAWS (Screen Reader)

Josh Swatosh – Josh is a visually impaired (blind) auditor who relies on assistive technologies to access information and communication technologies. He is proficient in a number of assistive technologies, including JAWS, NVDA, and a variety of other tools.

Jamaar Cormier – For the past six years, Jamaar has worked in the development, auditing, and remediation of accessible information and communication technologies. He currently holds CPACC, WAS, and CPWA certifications from the International Association of Accessibility Professionals (IAAP). He also holds a Trusted Tester certification from the Department of Homeland Security Office of Accessible Systems and Technology (OAST).

Appendix 3 - List of Facilities

Building Name	Address	Building Type
Ackerman Park Field House	Central & McDaniel	Recreation Field Houses
Ackerman Park		Neighborhood
Alexander		Neighborhood
Animal Shelter	2310 Oakton	Police and Fire Services
Baker Park	Keeney & Forest	Neighborhood
Baker Park Field House	Keeney & Forest	Recreation Field Houses
Beck (Eugene Park)		Community
Bent Park		Recreation Field Houses
Bent Park Field House	Harrison & Hastings	Recreation Field Houses
Branch Library at Robert Crown	1801 Main	Libraries
Brummel/Richmond		Tot Lot
Burnham Shores / Dempster StreetBeach		Community
Butler (Isabella Park)		Community
Cartwright (Charles Park)		Neighborhood
Chandler Park		Neighborhood
Chandler-Newberger Center	1028 Central	Community Centers
Church Street Self-Park	525 Church	Parking Garages
Civic Center Boiler Building	1223 Simpson	Operations Buildings
Clark Square		Community
Clark Street Beach / Centennial Park		Community
Clark Street Beach House	1811 Sheridan	Recreation Field Houses
Clyde-Brummel		Neighborhood
Congregational Park		Neighborhood
Crown- Crown Center (Robert Park)		Community
Currey, J. Seymour Park		Neighborhood
Dawes Park / Greenwood Beach		Community
Dempster Beach Aquatics Building	1251 Lake Shore	Recreation Field Houses
Dempster Beach Locker Building	1251 Lake Shore	Recreation Field Houses
Dobson/Brummel Park		Tot Lot
Eggleston		Neighborhood
Eiden (Charles B. Park)		Neighborhood
Ellingwood		Tot Lot
Elliott Park / Lee Street Beach		Community
Emerson Square		Neighborhood
Evanston Arts Center	2603 Sheridan Road	
Evanston Ecology Center	2024 McCormick	Community Centers
Evanston Public Library	1703 Orrington Avenue	Libraries
Evanston Water Plant	555 Lincoln Street	Operations Buildings
Fire #1	1332 Emerson	Police and Fire Services
Fire #2	702 Madison	Police and Fire Services
Fire #3	1105 Central	Police and Fire Services
Fire #4	1817 Washington	Police and Fire Services
Fire #5	2830 Central	Police and Fire Services
Fireman's Park		Tot Lot
Fitzsimons		Neighborhood
Fleetwood-Jourdain Community Center	1655 Foster	Community Centers
Foster Field		Neighborhood
Fountain Square		Community
Garden Park		Neighborhood
Gibbs Morrison Cultural Center	1823 Church	Community Centers
Gilbert Park		Tot Lot

Grandmother		Tot Lot
Greenwood Street Beach House	1401 Sheridan	Recreation Field Houses
Grey Park		Neighborhood
Grosse Point Lighthouse Park	2535 Sheridan Road	
Harbert, (Elizabeth Boynton Park)		Community
Harley Clark Mansion	2603 Sheridan	Mothballed
Harley Clark Mansion Coachhouse	2603 Sheridan	Mothballed
Harper Gardens		Neighborhood
Hinman	641 Hinman Avenue	Tot Lot
Hobart, (Marcus A. Park)		Tot Lot
Howard Street Police Outpost	633 Howard Street	
Howell Park		Neighborhood
Independence Park		Neighborhood
Ingraham, (Samuel Gilbert Park)		Neighborhood
James / Levy Center		Community
James Park Field House	2101 Mulford	Recreation Field Houses
Kelly Park		Tot Lot
Ladd Arboretum / Ecology Center		Community
Lagoon Building	1631 Sheridan Road	Recreation Field Houses
Lake-Dodge Park		Neighborhood
Larimer Park		Neighborhood
Lawson / Noah's Playground		Neighborhood
Leah Lomar Park		Neighborhood
Leahy Park		Neighborhood
Leahy Park Field House	1100 Lincoln	Recreation Field Houses
Lee Street Beach House	1111 Lake Shore Boulevard	Recreation Field Houses
Levinson		Neighborhood
Levy Senior Center	300 Dodge Avenue	Community Centers
Lighthouse Foghorn House North	2535 Sheridan	Recreation Field Houses
Lighthouse Foghorn House South	2535 Sheridan	Recreation Field Houses
Lighthouse Landing / LighthouseLanding Beach		Community
Lighthouse Landing Restroom	2605 Sheridan	Recreation Field Houses
Lorraine H. Morton Civic Center	2100 Ridge Avenue	Citywide Services
Lot 60	1200 Chicago	Parking Garages
Lovelace, Walter S. Park		Community
Lovelace Park Field House	2700 Gross Point	Recreation Field Houses
Lunt, (Cornelia Park)		Community
Maple Avenue Self-Park	1800 Maple Avenue	Parking Garages
Mason Park		Community
Mason Park Field House	1600 Church	Recreation Field Houses
McCormick Park		Neighborhood
McCulloch, (Catherine Waugh Park)		Neighborhood
Megowan, Vera Park		Tot Lot
Merrick Rose Garden		Community
Monroe	1200 Monroe	Tot Lot
Morris, Jennifer Park		Neighborhood
Municipal Service Center	2020 Asbury Avenue	Operations Buildings
North Branch Library	2026 Central Street	
North Standpipe	Gross Point Road north of Harrison	Operations Buildings
North Standpipe Storage Shed	Gross Point Road north of Harrison	Operations Buildings
Noyes Cultural Art Center	927 Noyes Street	Community Centers
Oldberg, (Arne and Mary Sloan Park)		Neighborhood

Patriot's Park		Community
Penny Park		Neighborhood
Perry, (Adam Park)	1741 Hovland Ct.	Neighborhood
Philbrick		Tot Lot
Police/Fire Headquarters	1454 Elmwood Avenue/ 909 Lake	Police and Fire Services
Porter, (Harry Hibbert Park)		Tot Lot
Quinlan Park		Neighborhood
Raymond Park		Neighborhood
Recycling Center	2222 Oakton Street	Operations Buildings
Robert Crown Community Center and Library	1701 Main Street	Community Centers
Salt Dome	2020 Asbury	Operations Buildings
Sargent, Celia Park		Tot Lot
Sherman Plaza Garage	1617 Benson	Parking Garages
Smith, (Elnora Park)		Neighborhood
Snyder, (Thomas E. Park)		Tot Lot
South Boulevard Beach		Community
South Boulevard Beach House	525 Sheridan Square	Recreation Field Houses
South Standpipe	640 Hartrey Avenue	Operations Buildings
South Standpipe Storage Garage	640 Hartrey Avenue	Operations Buildings
Southwest Park		Tot Lot
St. Paul Park North		Neighborhood
St. Paul Park South		Neighborhood
Stockham Place Park		Neighborhood
Tallmadge, (Thomas Eddy Park)		Community
Torgerson, (Frank S. Park)		Neighborhood
Trahan, (Benjamin Park)		Neighborhood
Twiggs, (William H. Park)		Community

Appendix 4 - Facility Assessment Reports

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	295	Exterior, Tennis Court, Outside, sidewalk to tennis court	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	662	Exterior, Park to field house	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	3	663	Exterior, Tennis Court, Outside	Accessible Route; 403.5.1 Clear Width.	Walking Surface - Clear width, less than 32 inches (for length of 24 inches)	1	Reconstruct the walking surface to provide a minimum clear width of 32 inches for a maximum length of 24 inches or remove existing barriers to provide the clear width.
	4	692	Exterior, Tennis Court, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	5	693	Exterior, Seating area to public Sidewalk, Seating area	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	6	856	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	888	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	8	1483	Exterior, Tennis Court, Outside, Bleacher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	9	1484	Exterior, Tennis Court, Outside, Bleacher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	10	1722	Play Area, Outside, Swings, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	11	1723	Play Area, Play scape, Outside, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

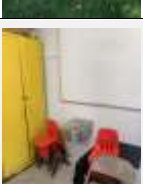
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	63	Restroom (Women), floor 1, Women, exterior to restroom	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	2	64	Restroom (Men), floor 1, exterior to restroom	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	3	65	Restroom (Men), floor 1, exterior to restroom	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	4	152	Restroom (Women), Outside	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	5	857	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	6	930	Lobby, floor 1	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	953	Exterior	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	8	1133	Lobby, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	9	1134	Lobby, floor 1, coat hooks	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	10	1136	Lobby, floor 1, Hand drier	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1138	Restroom (Women), floor 1, Women, archway	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	12	1291	Lobby, floor 1, Shelf over fireplace	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1292	Restroom (Men), floor 1, Archway	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	14	1793	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet compartment to provide a minimum width of 60 inches.
	15	1796	Restroom (Men), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet compartment to provide a minimum width of 60 inches.
	16	1902	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	17	1903	Restroom (Women), floor 1	Restroom (Multiple User); 404.2.4 Maneuvering Clearances, figure a.	Entrance Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	18	1904	Restroom (Men), floor 1	Restroom (Multiple User); 404.2.4 Maneuvering Clearances, figure a.	Entrance Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	2453	Lobby, Restroom (Men + Women), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	20	2454	Exterior, Restroom (Women), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	21	2455	Exterior, Restroom (Men), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	22	2475	floor 1	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	416	Exterior	Accessible Route; 405.8 Handrails.	Handrails, missing on ramp run with rise greater than 6 inches	1	Install compliant handrail that meets all size, mounting, and extension requirements. Ensure the ramp has compliant handrails on both sides of the ramp.
	2	497	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	3	498	Play Area, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	4	802	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	5	1733	Exterior, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	6	1739	Exterior, size: small	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	1	178	Lobby, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	2	179	Throughout, floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	3	181	Outside	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	4	182	Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
 No image available	5	183	Entrance, floor 1	Accessible Route; 404.2.5 Thresholds.	Door - New Threshold height, greater than 1/2 inch	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	6	184	Restroom (Unisex), floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	185	Entrance, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	8	186	Shelter, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	9	187	Exterior, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	10	529	Adoption room, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	11	530	Storage, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	12	531	Parking Lot, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	532	Parking Lot, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	14	1353	Kennel, floor 1, Hose bib	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1354	Adoption room, floor 1, A/C unit	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1355	Exterior, floor 1, Storage Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1367	floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1368	floor 1, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1369	Hallway, floor 1	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1607	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	21	1608	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.3 Access Aisle.	Access Aisle, missing	1	Construct compliant access aisle with slopes not to exceed 2% in all directions.
	22	2500	Kitchen, floor 1	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	10	Exterior	Accessible Route; 406 Curb Ramps.	Curb Ramp - Running Slope, steeper than 8.33% (1:12)	1	Reconstruct the curb ramp to have a running slope no greater than 8.33%.
	2	394	Exterior, Basketball Court	Accessible Route; 405.3 Cross Slope.	Ramp - Cross Slope, exceeds 2% (1:48)	1	Reconstruct the ramp with a maximum cross-slope of 2%.
	3	685	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	686	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	5	703	Exterior, Basketball Court, Pathway to assembly area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	797	Exterior, Baseball Field, bench looking to baseball field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	798	Exterior, Basketball Court, bench looking to basketball field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	799	Play Area, Outside, bench looking to playground	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	9	800	Exterior, bench looking to playground 2	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	10	1721	Exterior, size: small	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.
	11	1730	Play Area, Outside, size: large	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	12	1731	Play Area, Outside, size: large	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	69	Restroom (Unisex), floor 1, Unisex, lobby to restroom	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	2	70	Restroom (Women), floor 1, exterior to restroom	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	3	71	Restroom (Men), floor 1, exterior to restroom	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	4	153	Restroom (Unisex), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	5	154	Machinery Space, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	6	931	Exterior, floor 1	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	954	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	8	1143	Exterior Patio, floor 1, window shutters	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	9	1144	Restroom (Unisex), floor 1, Dispenser, miscellaneous dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	10	1294	Lobby, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1798	Restroom (Men), floor 1	Restroom (Multiple User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	12	1905	Restroom (Women), floor 1	Restroom (Multiple User); 603.2.1 Turning Space.	Common Area - Clearance - Turning Space , missing	1	Reconfigure the restroom to provide compliant turning space.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1906	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	14	1907	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar, missing	1	Install missing rear grab bar.
	15	1908	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar, missing	1	Install missing side grab bar(s).
	16	2177	Restroom (Unisex), floor 1	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	17	2268	Restroom (Unisex), floor 1	Restroom (Single User); 604.7 Dispensers.	Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	18	2269	Restroom (Unisex), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Distance from the rear wall , less than 12 inches	1	Relocate the grab bar(s) to be a maximum of 12 inches from the rear wall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	2270	Restroom (Unisex), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar - Length, less than 36 inches	1	Replace with compliant grab bar(s) that are a minimum of 36 inches in length.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	675	Play Area, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	2	676	Exterior, Street to park	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	3	698	Play Area, Outside, Pathway to play area	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	4	699	Play Area, Outside, Pathway to play area	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	5	713	Exterior, floor 1, Electrical room, exterior to interior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	794	Play Area, Outside, around play areas	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	795	Play Area, Outside, around play areas	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	892	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	9	1021	Play Area, Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space - Slope, steeper than the maximum allowed of 2% (1:48) in any direction	2	Reconstruct the walking surface of the clear floor space to ensure no slope exceeds the maximum allowable of 2% for a minimum of 30 inches by 48 inches. Ensure the clear floor space is connected to a compliant accessible route.
	10	1022	Play Area, Outside	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	11	1028	Exterior the maintenance building	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	12	1504	Exterior, behind building, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1620	Exterior	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.
	14	1725	Play Area, Outside, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	15	1726	Play Area, Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	16	1727	Play Area, Outside, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	17	1728	Play Area, Outside, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	18	1732	Exterior	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	2370	floor 1, Maintenance building , Restroom (Unknown)	Restroom (Single User); 604.2 Location.	Seat - Centerline Location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	20	2371	floor 1, Maintenance building , Restroom (Unknown)	Restroom (Single User); Advisory 606.1 General.	Paper Towel Dispenser - Operable Parts, not within permitted reach range	3	Relocate paper towel dispenser to be between 15 and 46 inches and ensuring that it is not a protruding object.
	21	2372	floor 1, Maintenance building , Restroom (Unknown)	Restroom (Single User); 609.4 Position of Grab Bars.	Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	22	2373	floor 1, Maintenance building , Restroom (Unknown)	Restroom (Single User); 306.3 Knee Clearance	Baby changing table - Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	23	2374	floor 1, Maintenance building , Restroom (Unknown)	Restroom (Single User); 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches.	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cascd opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	296	Exterior, Tennis Court, Outside, Gate	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	664	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	665	Exterior, Tennis Court, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	4	666	Exterior, Tennis Court, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	5	667	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	6	694	Exterior, Soccer Field , From pathway to soccer files	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	889	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space - Toe Clearance (Forward Approach) - Depth, not between 17 and 25 inches	2	Reconstruct or relocate dining/work surface to provide a compliant forward approach with knee and toe clearance.
	8	890	Exterior, table	Dining/Work Surface; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connects the dining/work surface to the rest of the facility.
	9	891	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	10	1018	Exterior, Tennis Court	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space - Slope, steeper than the maximum allowed of 2% (1:48) in any direction	2	Reconstruct the walking surface of the clear floor space to ensure no slope exceeds the maximum allowable of 2% for a minimum of 30 inches by 48 inches. Ensure the clear floor space is connected to a compliant accessible route.
	11	1019	Exterior	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space - Slope, steeper than the maximum allowed of 2% (1:48) in any direction	2	Reconstruct the walking surface of the clear floor space to ensure no slope exceeds the maximum allowable of 2% for a minimum of 30 inches by 48 inches. Ensure the clear floor space is connected to a compliant accessible route.
	12	1724	Play Area, Outside, size: large	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	127	Storage, floor 1, Out to storage	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	2	128	Restroom (Men), floor 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	3	148	Entrance, floor 1, Main door	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	4	149	Storage, floor 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	5	150	Restroom (Women), floor 1, Exterior to women	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	6	151	Restroom (Women), floor 1, Exterior to women	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	517	Restroom (Men), floor 1	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	8	858	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	9	952	Exterior	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	10	1264	Entrance, floor 1, Public postings board	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1265	Lobby, floor 1, Shelf over fireplace	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	12	1266	Restroom (Men), floor 1, Hand Dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	13	1267	Restroom (Women), floor 1, Archway	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
 No image available	14	1293	Restroom (Men), floor 1, Archway	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1867	Restroom (Women), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	16	1868	Restroom (Women), floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	17	1869	Restroom (Men), floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	18	1870	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1891	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment (floor mounted WC) - Depth (Parallel to side wall), less than 59 inches	1	Reconstruct toilet compartment to provide a minimum depth of 59 inches.
	20	1892	Restroom (Women), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	21	1893	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Distance from the rear wall , more than 12 inches	1	Relocate the grab bar(s) to be a maximum of 12 inches from the rear wall.
	22	1894	Restroom (Women), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	23	1895	Restroom (Women), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	24	1896	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1897	Restroom (Men), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet compartment to provide a minimum width of 60 inches.
	26	1898	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Distance from the rear wall , more than 12 inches	1	Relocate the grab bar(s) to be a maximum of 12 inches from the rear wall.
	27	1899	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	28	1900	Restroom (Men), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	29	1901	Restroom (Women), floor 1	Restroom (Multiple User); 404.2.4 Maneuvering Clearances, figure a.	Entrance Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	30	2451	Exterior, floor 1, Restroom (Women)	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	2452	Exterior, floor 1, Restroom (Men)	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	32	2492	Restroom (Women), floor 1	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	33	2493	Restroom (Women), floor 1	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	34	2494	Restroom (Men), floor 1	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	984	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	2	1045	Exterior	Exercise Machines and Equipment; 1004.1 Clear Floor Space.	Clear Floor Space - Changes in level, not permitted within the clear floor space dimension of 30 inches minimum by 48 inches minimum	4	Relocate the exercise machine to ensure a compliant clear floor space with parallel approach is provided adjacent to at least one of every type of machine.
	3	1709	Play Area, Outside, size: large	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.
	4	1710	Play Area, Outside, size: large	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	195	Exterior, Tennis court, Outside, Out	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	548	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	3	549	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	550	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	5	551	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	6	552	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	553	Exterior, Tennis Court, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	8	554	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	9	748	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	10	854	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	11	960	Exterior	Drinking Fountain; 602.7 Drinking Fountains for Standing Persons.	High Fountain, Spout Outlet - Height , not between 38 and 43 inches	2	Remove and replace with a compliant high drinking fountain.
	12	961	Exterior	Drinking Fountain; 602.4 Spout Height.	Low Fountain, Spout Outlet - Height, greater than 36 inches	2	Relocate low drinking fountain spout height to be less than 36 inches while still providing 27 inches knee clearance.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1666	Play Area, Outside, size: large	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.
	14	1667	Play Area, Outside, size: medium	Play Area; 1008.4 Play Components.	Play Component - Height (ages 3-4), not between 20 and 36 inches	3	Replace with compliant component.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	175	Play Area, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	176	Exterior, Basketball Court	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	3	177	Exterior, Basketball Court	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	4	518	Exterior, Basketball Court	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	5	519	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	6	520	Entrance, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	523	Parking Lot, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	8	524	Parking Lot, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	9	525	Parking Lot, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	10	526	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	11	527	Exterior, next to golf carts parking	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	12	1582	Exterior	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1584	Parking Lot, Outside	Parking Space (Standard Accessible Marked); 502.2 Vehicle Spaces.	Car Space - Width, less than 96 inches	1	Restripe the accessible parking space to be 96 inches wide.
	14	1653	Play Area, Outside, Animals spring riders, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	15	1654	Play Area, Outside , Swings and seesaw, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
 No image available	16	2456	Parking Lot, Outside	Sign ; 216 Signs.	Sign , missing	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	17	2457	Parking Lot, Outside	Sign ; 703.4.1 Height Above Finish Floor or Ground.	Sign - Height above finish floor, not located where the bottom of the lowest line of text is 48" minimum and/or the bottom of the highest line of text is 60" maximum above the ground.	2	Relocate sign to compliant height.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	162	Hallway, Raquetball Court, floor 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	2	163	Office, floor 1	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	3	164	Office, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	4	165	Room D, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	5	166	Room A, C, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	6	169	Kitchen, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	905	Restroom (Men), floor 1	Dressing Room; 903.3 Size.	Bench - Depth, not between 20 and 24 inches	3	Install a compliant bench with a depth between 20 to 24 inches.
	8	906	Restroom (Women), floor 1	Dressing Room; 903.3 Size.	Bench - Depth, not between 20 and 24 inches	3	Install a compliant bench with a depth between 20 to 24 inches.
	9	908	Locker Room, Both men's and women's, floor 1	Dressing Room; 803.5 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	10	1303	Office, floor 1, Time card recorder	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1304	Gym, floor 1, Keypad	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	12	1305	floor 1, Room C, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1314	Entrance, Main entrance , floor 1, AED cabinet, digital Display, Counter, Shelves	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	14	1315	Hallway, floor 1, Drinking Fountain	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1627	Orange room, floor 1-2	Platform Lift; 410.6 Doors and Gates.	Door/Gates - Opening Time, less than 20 seconds	1	Replace with compliant platform lift.
	16	1917	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	17	1918	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	18	1919	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Baby changing table - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1920	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	20	1921	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches. Also, not installed at reach range.	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches. Location of installation needs to be at compliant reach range.
	21	1922	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	22	1927	Restroom and dressing room for both men's&women's , floor 1, Men + Women	Restroom (Multiple User); 703.1 General.	Sign , not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	23	2424	floor 1, Restroom (Men)	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	24	2425	floor 1, Restroom (Women)	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2496	Kitchen, floor 1	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	26	2575	Restroom (Men), floor 1	Storage; 811.4 Operable Parts.	Operable Parts - Operation - (5% of total or one of each type), not operable with one hand and grasping, pinching, or twisting required.	3	Replace storage element with operable parts that are compliant with operation requirements and located within a compliant reach range.
	27	2576	Restroom (Women), floor 1	Storage; 811.4 Operable Parts.	Operable Parts - Operation - (5% of total or one of each type), not operable with one hand and grasping, pinching, or twisting required.	3	Replace storage element with operable parts that are compliant with operation requirements and located within a compliant reach range.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	107	Office, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	2	508	Parking Garage (with roof), floor 1, Pathway to office	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	3	509	Parking Garage (with roof), floor 1, Pathway to office	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	4	1187	Parking Lot, floor 1, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	5	1188	Restroom (Employee/Staff only), floor 1, cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	6	1189	Parking Lot, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1190	Parking Lot, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	1191	Parking Lot, floor 1, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	9	1192	Parking Lot, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	10	1193	Office, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1194	Parking Lot, floor 1, cabinet in restrooms	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	12	1195	Parking Lot, floor 2, Fire extinguisher, and Fire standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1196	Parking Lot, floor 3, Fire extinguisher, and Fire standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	14	1197	Parking Lot, floor 3, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1198	Parking Lot, floor 3, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1199	Parking Lot, floor 4, Fire extinguisher, and Fire standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1200	Parking Lot, floor 4, Fire extinguisher, and Fire standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1201	Parking Lot, floor 4, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1202	Parking Lot, floor 4, Fire extinguisher, and Fire standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1203	Parking Lot, floor 4, Fire extinguisher, and Fire standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	21	1204	Parking Lot, floor 4, Fire extinguisher, and Fire standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	22	1575	Parking Garage (with roof), Space 2/3, floor 1	Parking Space (Standard Accessible Marked); 502.3 Access Aisle.	Access Aisle, missing	1	Construct compliant access aisle with slopes not to exceed 2% in all directions, striping, identification, and connected to an accessible route.
	23	1576	Parking Garage (with roof), floor 1	Parking Space (Standard Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.
	24	1577	Parking Garage (with roof), floor 1	Parking Space (Standard Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	25	1585	Parking Garage (with roof), floor 1	Parking Space (Standard Accessible Marked); 208.2 Minimum Number.	Parking Space (Standard Accessible Marked), missing	1	Construct compliant standard accessible parking space on shortest accessible route.
	26	1601	floor 1	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	27	2226	Restroom (Unisex), floor 1, Employees/Staff only	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Length, less than 42 inches	1	Replace with compliant grab bar(s) that are a minimum of 42 inches in length.
	28	2227	Restroom (Unisex), floor 1, Employees/Staff only	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	29	2228	Restroom (Unisex), floor 1, Employees/Staff only	Restroom (Single User); 604.6 Flush Controls.	Flush Control - Location, not on the open side of water closet	1	Replace water closet and ensure that control will be on the open side of the water closet.
	30	2229	Restroom (Unisex), floor 1, Employees/Staff only	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	2230	Restroom (Unisex), floor 1, Employees/Staff only	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Length, less than 42 inches	1	Replace with compliant grab bar(s) that are a minimum of 42 inches in length.
	32	2482	Restroom (Employee/Staff only), floor 1	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	33	2483	Restroom (Employee/Staff only), floor 1	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	5	Exterior	Accessible Route; 406.2 Counter Slope.	Curb Ramp - Changes in level (adjacent surfaces), not permitted	1	Reconstruct the adjacent surface to eliminate the change in level.
	2	611	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	612	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	4	613	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	614	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	723	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	844	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	987	Exterior	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	2	Reconstruct or relocate the impediment to ensure the drinking fountain is located adjacent to a compliant clear floor space, ensuring a forward approach is provided with knee and toe clearance.
	9	883	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space - Toe Clearance (Foward Approach) - Depth, not between 17 and 25 inches	2	Reconstruct or relocate dining/work surface to provide a compliant forward approach with knee and toe clearance.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	12	Exterior, Path from bike to look out	Accessible Route; 406 Curb Ramps.	Curb Ramp - Cross Slope, steeper than 2% (1:48)	1	Reconstruct the curb ramp to have a cross slope no greater than 2%.
	2	501	Bird sanctuary, Outside, Path from bike to look out	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	502	Outside, No route to fire pit	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	503	Outside, No route to fire pit	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	507	Work out area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	1623	Parking Lot, Outside, First parking left side	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	2075	Restroom (Women), East restrooms, floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	8	2076	Restroom (Women), East restrooms, floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	9	2077	Restroom (Women), East restrooms, floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object below, less than 1 1/2 inches	1	Relocate obstruction(s) located within 1 1/2 inches below the grab bar.
	10	2078	Restroom (Men), East restrooms, floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between wall and bars, not 1 1/2 inches	1	Replace with compliant grab bars or relocate the grab bar(s) to provide the 1 1/2 inches from the wall.
	11	2079	Restroom (Men), East restrooms, floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	12	2080	Restroom (Men), East restrooms, floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	2081	Restroom (Men), East restrooms, floor 1	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	104	Office, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	105	Storage, floor 1, plumbing chase room, exterior to interior	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a casied opening with a minimum clear width of 32 inches.
	3	945	Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	4	1178	Outside, drinking fountains	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	5	1179	Outside, exterior counter	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	6	1180	Office, floor 1, shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1181	Storage, floor 1, I.T. box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	1548	Restroom (Women), east restrooms, floor 1, Hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	9	1549	Restroom (Men), east restrooms, floor 1, Hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	10	1550	Restroom (Women), East, floor 1, Stall horizontal bar over the door opening	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1551	Restroom (Men), East, floor 1, Stall horizontal bar over the door opening	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	12	1833	Restroom (Men), west restroom, floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object below, less than 1 1/2 inches	1	Relocate obstruction(s) located within 1 1/2 inches below the grab bar.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1834	Restroom (Women), west restroom, floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object below, less than 1 1/2 inches	1	Relocate obstruction(s) located within 1 1/2 inches below the grab bar.
	14	1835	Restroom (Women), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object below, less than 1 1/2 inches	1	Relocate obstruction(s) located within 1 1/2 inches below the grab bar.
	15	1836	Restroom (Men), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object below, less than 1 1/2 inches	1	Relocate obstruction(s) located within 1 1/2 inches below the grab bar.
	16	1838	Restroom (Men), west restroom, floor 1	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	17	1839	Restroom (Men), west restroom, floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	18	1840	Restroom (Men), west restroom, floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1841	Restroom (Women), west restrooms, floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	20	1842	Restroom (Women), west restroom, floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	21	2122	Restroom (Women), West, floor 1	Restroom (Multiple User); 305.2 Floor or Ground Surfaces.	Common Area - Sink - Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	1	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	22	2123	Restroom (Women), East, floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Paper Towel Dispenser - Operable Parts, not within permitted reach range	3	Relocate paper towel dispenser to be between 15 and 46 inches and ensuring that it is not a protruding object.
	23	2124	Restroom (Women), East, floor 1	Restroom (Multiple User); 306.3 Knee Clearance	Baby changing table - Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	24	2125	Restroom (Men), East, floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2126	Restroom (Men), East, floor 1	Restroom (Multiple User); 306.3 Knee Clearance	Baby changing table - Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	575	Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	819	Exterior, Pic-nic area	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	3	968	Outside	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	4	969	Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	5	1380	Outside, Picnic tables	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	6	1676	Outside, size: medium	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1677	Outside, size: large	Play Area; 1008.2.5.1 Ground Level.	Play Component - Connection (Ground) - Ramp - Running Slope - Width, steeper than 6.25% (1:16)	3	Provide compliant connection.
	8	1678	Outside, size: large	Play Area; 1008.2.5.1 Ground Level.	Play Component - Connection (Ground) - Ramp - Running Slope - Width, steeper than 6.25% (1:16)	3	Provide compliant connection.
	9	1679	Outside, size: medium	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	555	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	749	Exterior, from public sidewalk to the park pathway	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	196	Entrance, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	197	Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	3	573	Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	574	Entrance 2, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	716	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	811	Exterior, Basketball Court	Assembly Area; 802.1.2 Width.	Wheelchair Space - Clear Floor Space - Width, less than 30 inches provided	2	Reconstruct wheelchair space, remove barrier or relocate wheelchair space to a compliant location.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	812	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	1675	Play Area, Outside, size: large	Play Area; 1008.2.5.1 Ground Level.	Play Component - Connection (Ground) - Ramp - Running Slope - Width, steeper than 6.25% (1:16)	3	Provide compliant connection.
	9	1735	Play Area, Outside, size: large	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	504	Gym, Fitness area, Outside, Bike path to fitness	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	505	Lagoon, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	3	1186	Outside, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	129	Office, North office, floor 1, Office To closet	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	2	130	Office, floor 1, South office to east room	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	3	131	Exterior	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	4	155	Entrance, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	5	156	Office, floor 1, North to south office	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	6	157	Office, floor 1, North to south office	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.

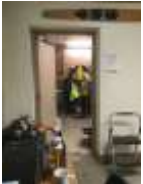
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	158	Office, floor 1, Office to lifeguard room	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	8	903	Locker Room, floor 1, Lifeguard area	Dressing Room; 903.3 Size.	Bench - Depth, not between 20 and 24 inches	3	Install a compliant bench with a depth between 20 to 24 inches.
	9	904	Locker Room, floor 1, Lifeguard area	Dressing Room; 803.5 Coat Hooks and Shelves.	Coat Hook - Location, not within permitted reach range	3	Provide coat hook within reach range of between 15 and 48 inches without reaching over an obstruction.
	10	932	Exterior, floor 1	Drinking Fountain; 602.4 Spout Height.	Low Fountain, Spout Outlet - Height, greater than 36 inches	2	Relocate low drinking fountain spout height to be less than 36 inches while still providing 27 inches knee clearance.
	11	933	Exterior, floor 1	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Floor or Ground Surfaces - Surface, not stable, firm, and slip resistant	2	Reconstruct the walking surface of the clear floor space to provide a ground surface material and condition that is stable, firm, and slip resistant.
	12	934	Exterior, floor 1	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.

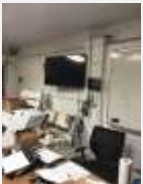
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	935	Exterior, floor 1	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	14	955	Room, floor 1, Lifeguard area	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	15	1268	Room, East storage garage, floor 1, Security alarm cabinets	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1269	East storage garage, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1270	East storage garage, floor 1, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1271	East storage garage, floor 1, Hook with floatie	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1272	East storage garage, floor 1, Time card recorder	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1295	Office, floor 1, A/V equipment	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	21	1296	floor 1, Storage garage, Paddle board storage	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	22	1297	floor 1, Storage garage, Equipment storage	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	23	1298	Lobby, Exterior lobby , Outside, Counter	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	24	1603	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1604	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.
	26	1799	Restroom (Women), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	27	1800	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	28	1801	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	29	1802	Restroom (Women), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Rear Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	30	1803	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1804	Restroom (Men), floor 1	Restroom (Multiple User); 305.2 Floor or Ground Surfaces.	Urinal - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	1	Relocate adjacent partitions/wall to provide a compliant clear floor space.
	32	1805	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	33	1806	Restroom (Men), floor 1	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	34	1807	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	35	1808	Restroom (Men), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	484	Storage, floor 1, Beach to storage area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	458	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	2	471	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	479	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	4	480	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	5	481	Exterior, Trail to Little Library	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	482	Exterior, Trail to community garden	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	715	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	8	1642	Exterior, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Overall (cracks, fading marking..), not to standards	3	Replace with compliant ground surface.
	9	1643	Exterior, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	10	1644	Exterior, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	11	1645	Play Area, Outside, size: small	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	578	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	2	579	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	3	821	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	4	822	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	5	970	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	6	971	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1681	Exterior, size: large	Play Area; 1008.4 Play Components.	Play Component - Height (ages 5-8), not between 18 and 40 inches	3	Replace with compliant component.
	8	1682	Exterior, size: large	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.
	9	1683	Exterior, size: large	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.
	10	1736	Play Area, Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	387	Exterior	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	2	576	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	577	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	4	820	Play Area	Assembly Area; 221.1 General.	Wheelchair Space - Clear Floor Space - Changes in level, not permitted within the clear floor space dimension	2	Reconstruct the walking surface of the clear floor space to ensure there is no change in level other than the allowable maximum slope of 2%. If necessary, reconstruct adjacent walking surface to compensate for the existing change in level.
	5	1680	Exterior, size: medium	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	677	Exterior, park to exercise equipment	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	678	Exterior, park to exercise equipment	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	679	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	700	Exterior, Picnic, grill, receptacles area, Pathway to grill, receptacles	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	701	Exterior, Picnic, grill, receptacles area, Pathway to grill, receptacles	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	893	Exterior, table	Dining/Work Surface; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the dining/work surface to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1023	Exterior	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	8	1024	Exterior	Drinking Fountain; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the drinking fountain to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	534	Planter space , Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	538	Play Area, Outside	Accessible Route; 403.5.1 Clear Width.	Walking Surface - Clear width, less than 36 inches	1	Reconstruct the walking surface to provide a minimum clear width of 36 inches or remove existing barriers to provide the clear width.
	3	806	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces. In this case, it could be considered to relocate the receptacle.
	4	1656	Exterior, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	5	1662	Play Area, Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	45	Office, floor 1, Office to storage	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	2	52	Restroom (Women), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure g.	Door - Maneuvering Clearance - Hinge Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 22 inches beyond hinge side. (Case G)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	3	53	Conference Room, floor 1, Conference room	Accessible Route; 404.2.5 Thresholds.	Door - New Threshold height, greater than 1/2 inch	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	4	54	Conference Room, floor 1, Conference room	Accessible Route; 404.2.5 Thresholds.	Door - New Threshold height, greater than 1/2 inch	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	5	57	Restroom (Women), floor 1, Both men's and women's bathroom	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	6	927	Exterior, floor Oit	Drinking Fountain; 206.2.2 Within a Site	Accessible Route, missing	1	Contract an accessible route that connect the drinking fountain to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1058	Office, floor 1, Microwave	Kitchen/Kitchenettes; 804.6.2 Operable Parts.	Appliance - Operable Parts, not within permitted reach range	4	Relocate appliance or provide the operable part within reach range of 15 to 46 inches.
	8	1120	Lobby, floor 1, drinking fountain	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	9	1121	Lobby, floor 1, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	10	1122	Lobby, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1123	Restroom (Men), floor 1, coat hooks	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	12	1125	Classroom, floor 1, Outlet, napkins and soap dispensers	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1126	Classroom, floor 1, Thermostat	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	14	1127	Office, floor 1, First Aid kit	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1128	Conference Room, floor 1, Thermostat	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	16	1129	Classroom, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1131	Exterior, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1599	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Changes in level, not permitted	1	Reconstruct the access aisle to be the same level as the accessible parking space it serves.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1765	Lobby, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	20	1771	Lobby, floor 1, Restroom (Men)	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	21	1777	Lobby, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Baby changing table - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	22	1778	Lobby, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	23	1784	Lobby, floor 1, Restroom (Men + Women)	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Paper Towel Dispenser - Location, not accessible from lavatory	3	Relocate paper towel dispenser to be accessible from lavatory.
	24	2379	Lobby, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2392	Lobby, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	26	2471	Office, floor 1	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	27	2472	Conference Room, floor 1	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	170	Stairwell, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	2	171	Room, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	3	172	Hallway, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	4	173	Conference Room, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	5	174	Library, floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure e.	Door - Maneuvering Clearance - Hinge Approach - Pull side, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 42 inches. (Case E)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	6	180	Office, floor 4	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	381	Exterior, side alley to side entrance ramp	Accessible Route; 405.9.1 Extended Floor or Ground Surface.	Ramp - Edge Protection - Floor or Ground Surface - Extension, less than 12 inches beyond the inside face of a handrail	1	Install compliant edge protection on both sides of the ramp.
	8	399	Stairwell, East stairwell, floor Basement	Accessible Route; 405.9.1 Extended Floor or Ground Surface.	Ramp - Edge Protection - Floor or Ground Surface - Extension, less than 12 inches beyond the inside face of a handrail	1	Install compliant edge protection on both sides of the ramp.
	9	418	Lobby, floor All, Floor to floor	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramp-end, does not return back to itself, to a wall, guard, or the landing surface	1	Replace handrails to ensure the extensions return to itself, a wall, guard, or the landing surface.
	10	419	Stairwell, floor Basement, Basement, West end emergency stairwell	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less then 12 inches beyond the bottom ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the bottom of the ramp run.
	11	420	Stairwell, floor 4, 4th floor, West end emergency stairwell	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the ramp run.
	12	421	Stairwell, floor 4, 4th floor, South side	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the ramp run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	422	Stairwell, floor 4, East side stairwell , East side	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the ramp run.
	14	521	Room, floor 1	Accessible Route; 403.5.1 Clear Width.	Walking Surface - Clear width, less than 36 inches	1	Reconstruct the walking surface to provide a minimum clear width of 36 inches or remove existing barriers to provide the clear width.
	15	522	Library, floor 2, Bio- on- ZY, mystery Ke, large type fiction C	Accessible Route; 403.5.1 Clear Width.	Walking Surface - Clear width, less than 36 inches	1	Reconstruct the walking surface to provide a minimum clear width of 36 inches or remove existing barriers to provide the clear width.
	16	868	Restroom (Men), floor 1, counter	Dining/Work Surface; 902.3 Height.	Height (top of surface), not between 28 and 34 inches	2	Reconstruct dining/work surface height to be within accessible range.
	17	869	Restroom (Men), floor 2, counter	Dining/Work Surface; 902.3 Height.	Height (top of surface), not between 28 and 34 inches	2	Reconstruct dining/work surface height to be within accessible range.
	18	870	Restroom (Women), floor 2, counter	Dining/Work Surface; 902.3 Height.	Height (top of surface), not between 28 and 34 inches	2	Reconstruct dining/work surface height to be within accessible range.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	909	Locker Room, floor 4	Dressing Room; 903.3 Size.	Bench - Depth, not between 20 and 24 inches	3	Install a compliant bench with a depth between 20 to 24 inches.
	20	957	Hallway, floor 1	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	21	1041	floor Basement through 4	Elevator; 407.2.2.3 Audible Signals.	Audible Signals - Sound (when not verbal annunciator), not once for up direction and twice for down direction	1	Replace hall signals.
	22	1042	Elevator Lobby, floor 1, Elevator 3	Elevator; 407.2.2.3 Audible Signals.	Audible Signals - Sound (when not verbal annunciator), not once for up direction and twice for down direction	1	Replace hall signals.
	23	1316	Entrance, floor 1, Lamp	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	24	1317	Stairwell, floor 1, Fire extinguisher sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1318	Elevator Lobby, floor B, Fire extinguisher sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	26	1319	Parking Garage (with roof), floor B, Utility Box, and Fire Pull	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	27	1320	Parking Garage (with roof), floor B, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	28	1321	Parking Garage (with roof), floor B, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	29	1322	Parking Garage (with roof), floor B, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	30	1323	Parking Garage (with roof), floor B, Panic Button	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1324	floor 1, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	32	1325	floor 1, Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	33	1326	All floors, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	34	1327	Parking Garage (with roof), floor 1, Archways	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	35	1328	Restroom (Family), floor 1, One paper towel dispenser, two hand dryers	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	36	1329	Family lounge, floor 1, Baby Changing Table	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	1330	Restroom (Family), floor 1, Hand Dryers	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	38	1331	Storage, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	39	1332	Storage, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	40	1333	Office, floor 1, Paper Towel Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	41	1334	Office, floor 1, First Aid kit	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	42	1335	Entrance, floor 1, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	1336	Hallway, floor 1, Telephone	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	44	1337	Restroom (Women), floor 1, One Paper Towel Dispenser, Three Hand Dryers	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	45	1338	Restroom (Men), floor B, Paper Towel Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	46	1339	floor 1, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	47	1340	Hallway, floor 2, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	48	1341	Restroom (Women), floor 2, One Paper Towel Dispenser, Two Hand Dryers	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	1342	Restroom (Men), floor 2, One Paper Towel Dispenser, Two Hand Dryers	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	50	1343	Library, floor 2, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	51	1344	Entrance, floor 2, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	52	1345	Library, floor 2, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	53	1346	Library, floor 2, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	54	1347	Classroom, floor 2, Desks	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	1348	Classroom, floor 2, Lamp	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	56	1349	Restroom (Unisex), floor 2, Baby Changing Table	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	57	1350	Restroom (Women), floor 2, Paper Towel Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	58	1356	Office, floor 3, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	59	1357	Office, floor 3, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	60	1358	floor 3, Coat hook	Miscellaneous Element; 308 Reach Ranges.	Operable Parts/Location, not within permitted reach range	3	Relocate element or provide the operable part within reach range of 15 to 46 inches.

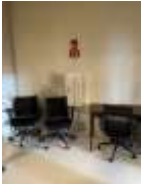
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	61	1359	floor 3, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	62	1360	Library, floor 3, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	63	1361	Library, floor 3, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	64	1362	Office, floor 4, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	65	1363	Office, floor 4, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	66	1364	Library, floor 4, Fire Extinguisher Sign	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	67	1365	Breakroom, floor 4, Vending machine	Miscellaneous Element; 308 Reach Ranges.	Operable Parts/Location, not within permitted reach range	3	Relocate element or provide the operable part within reach range of 15 to 46 inches.
	68	1366	Library, floor 4, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	69	1552	Stairwell, East and west stairwell , floor Basement, Building Structure, Staircase	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	70	1553	Maternity lounge, floor 1, Room 104, by green and red kids restrooms, Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	71	1583	floor B	Parking Space (Standard Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.
	72	1605	floor B	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	73	1606	Parking Garage (with roof), floor B	Parking Space (Van Accessible Marked); 502.2 Vehicle Spaces.	Car Space - Width (with 96 inches access aisle), less than 96 inches	1	Restripe the van accessible parking space to be 96 inches wide.
	74	1928	Restroom (Men), floor 1	Restroom (Multiple User); 605.2 Height and Depth.	Urinal - Rim Height, greater than 17 inches	1	Replace or relocate urinal to have the rim height at a maximum of 17 inches.
	75	2047	Restroom (Women), floor 2	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object below, less than 1 1/2 inches	1	Relocate obstruction(s) located within 1 1/2 inches below the grab bar.
	76	2048	Restroom (Women), floor 2	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	77	2049	Restroom (Women), floor 3	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	78	2050	Restroom (Women), floor 3	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	79	2051	Restroom (Women), floor 3	Restroom (Multiple User); 604.4 Seats.	Wheelchair Accessible Compartment - Seat - Height, greater than 19 inches	1	Replace water closet to provide a seat at a maximum height of 19 inches.
	80	2052	Restroom (Men), floor 3	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	81	2053	Restroom (Men), floor 3	Restroom (Multiple User); 604.4 Seats.	Wheelchair Accessible Compartment - Seat - Height, greater than 19 inches	1	Replace water closet to provide a seat at a maximum height of 19 inches.
	82	2054	Restroom (Men), floor 3	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	83	2055	Restroom (Women), floor 4	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Shelf - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Replace or relocate shelf to not be at a height between 27 and 80 inches.
	84	2056	Restroom (Women), floor 4	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	85	2057	Restroom (Women), floor 4	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	86	2058	Restroom (Women), floor 4	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	87	2059	Restroom (Women), floor 4	Restroom (Multiple User); 604.4 Seats.	Wheelchair Accessible Compartment - Seat - Height, greater than 19 inches	1	Replace water closet to provide a seat at a maximum height of 19 inches.
	88	2060	Restroom (Men), floor 4	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	89	2061	Restroom (Men), floor 4	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	90	2062	Restroom (Men), floor 4	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	91	2090	Restroom (Men), Across 107, floor 1, Across 107	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	92	2091	Restroom (Men), Across 107, floor 1, Across 107, Men	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	93	2092	Restroom (Women), Across 107, floor 1, Across 107	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	94	2093	Restroom (Women), Across 107, floor 1, Across 107	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	95	2094	Restroom (Women), Across 107, floor 1, Across 107	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	96	2095	Restroom (Women), Across 107, floor 1, Across 107	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	97	2096	Restroom (Women), Across 107, floor 1, Across 107	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Distance from the rear wall , more than 12 inches	1	Relocate the grab bar(s) to be a maximum of 12 inches from the rear wall.
	98	2097	Restroom (Women), Across 107, floor 1, Across 107	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	99	2098	Restroom (Family), Green restroom by 101, floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	100	2099	Restroom (Family), Green restroom by 101, floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Rear Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	101	2100	Restroom (Family), Green restroom by 101, floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	102	2101	Restroom (Family), Green restroom by 101, floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	103	2102	Restroom (Family), Red restroom by 104, floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	104	2103	Restroom (Family), Red restroom by 104, floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	105	2104	Restroom (Men), second floor, floor 2	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	106	2105	Restroom (Men), second floor, floor 2	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	107	2137	Restroom (Men), floor 1, Across 107	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	108	2138	Restroom (Men), floor 1, Across 107	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	109	2139	Restroom (Women), floor 1, Across 107	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	110	2140	Restroom (Women), floor 1, Across 107	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	111	2141	Restroom (Family), Green restroom across from 101, floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	112	2142	Restroom (Family), Green restroom across from 101, floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	113	2143	Restroom (Family), Red restroom across from 104, floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	114	2144	Restroom (Family), Red restroom across from 104, floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	115	2145	Restroom (Men), floor 2	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	116	2146	Restroom (Men), floor 2	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	117	2147	Restroom (Men), floor 2	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	118	2148	Restroom (Women), floor 2	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	119	2149	Restroom (Women), floor 2	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	120	2150	Restroom (Men), floor 2	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	121	2151	Restroom (Women), floor 2	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	122	2152	Restroom (Unisex), floor 3	Restroom (Multiple User); 307 Protruding Objects.	Baby changing table - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	123	2153	Restroom (Unisex), floor 3	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height, greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	124	2154	Restroom (Unisex), floor 3	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Paper Towel Dispenser - Operable Parts, not within permitted reach range	3	Relocate paper towel dispenser to be between 15 and 46 inches and ensuring that it is not a protruding object.
	125	2155	Restroom (Women), floor 3	Restroom (Multiple User); 902.3 Height.	Baby changing table - Height (top of surface), not between 28 and 34 inches for a work surface	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	126	2156	Restroom (Women), floor 3	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Length, less than 36 inches	1	Replace with compliant grab bar(s) that are a minimum of 36 inches in length.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	127	2157	Restroom (Women), floor 3	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	128	2158	Restroom (Men), floor 3	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	129	2159	Restroom (Men), floor 3	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	130	2160	Restroom (Women), floor 3	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	131	2161	Restroom (Women), floor 4	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	132	2162	Restroom (Women), floor 4	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	133	2163	Restroom (Women), floor 4	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	134	2164	Restroom (Men), floor 4	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	135	2165	Restroom (Men), floor 4	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	136	2166	Restroom (Men), floor 4	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	137	2271	Office, floor 1, Employees/Staff only	Restroom (Single User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	138	2381	Entrance, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	139	2394	Entrance, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	140	2497	Classroom, floor 1	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	141	2498	Classroom, floor 1	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	142	2499	Breakroom, floor 1	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	143	2501	Office, floor 3	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	144	2502	Office, floor 4	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	145	2503	Restroom (Men), floor 4	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	146	2504	Breakroom, floor 4	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	147	2505	Breakroom, floor 4	Sink; 306.3.1 General.	Sink - Clear Floor Space - Knee Clearance (Forward Approach) - Height, less than 27 inches	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	148	2577	Locker Room, floor 4	Storage; 811.4 Operable Parts.	Operable Parts - Operation - (5% of total or one of each type), not operable with one hand and grasping, pinching, or twisting required.	3	Replace storage element with operable parts that are compliant with operation requirements and located within a compliant reach range.
	149	2582	Hallway, By book return, floor 1	Telephone; 217 Telephones	TTY, missing (when at least one public phone is provided)	3	Remove public telephone/s, or add TTY/'s.
	150	2583	Hallway, floor 1, Back exit to parking lot	Telephone; 217 Telephones	TTY, missing (when at least one public phone is provided)	3	Remove public telephone/s, or add TTY/'s.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	271	Tunnel from pump station to boiler room, floor Basement	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	2	272	Office, floor 1, office on east side between two machine rooms	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	3	273	Office, Service building , floor 2	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	4	274	Office, Service building , floor 2	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	5	275	Restroom (Men), floor 2, men's by S-6, hallway to restroom	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	6	276	Breakroom, Service building , floor 2, S-21	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	277	Office, Service building , floor 2, S-4	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	8	278	Lobby, floor 2, Foyer in service building, main entrance to water filtration	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	9	279	Office, Service building , floor 2, Foyer	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	10	280	Breakroom, Filtration bilding, floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	11	281	Breakroom, Filtration bilding, floor 2	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	12	282	Laboratory. Filtration building, floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	283	Office, Door into west parking, floor 2	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	14	284	Bay, Garage 7, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	15	307	Machinery Space, floor 1, Garage n 2, Outside to garage n 2 + workshop	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	16	308	Machinery Space, floor 1, Garage n 2, Outside to garage	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	17	392	Parking Lot, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	18	413	Machinery Space, floor Basement, Tunnel, From pump station to boiler room	Accessible Route; 405.8 Handrails.	Handrails, missing on ramp run with rise greater than 6 inches	1	Install compliant handrail that meets all size, mounting, and extension requirements. Ensure the ramp has compliant handrails on both sides of the ramp.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	646	Machinery Space, Pump station, floor 1	Accessible Route; 402.2 Components.	Walking Surface - Steps, not permitted	1	Determine the best location to install an elevator in order to provide an accessible route.
	20	647	Machinery Space, Boiler room, floor 1	Accessible Route; 402.2 Components.	Walking Surface - Steps, not permitted	1	Provide a wheelchair lift.
	21	648	Foyer. Door into filtration building, floor 2	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	22	649	Filtration building, floor 2	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	23	650	Filtration building, floor 2	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	24	687	Parking Lot, floor Pit, West parking location, From parking lot to west entrance	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	910	Locker Room, Pump station 1st floor, floor 1, men's	Dressing Room; 903.3 Size.	Bench - Depth, not between 20 and 24 inches	3	Install a compliant bench with a depth between 20 to 24 inches.
	26	911	Locker Room, Pump station 1st floor, floor 1, men's	Dressing Room; 803.5 Coat Hooks and Shelves.	Shelf - Location, not within permitted reach range	3	Relocate shelf to be within reach range of between 15 and 48 inches without reaching over an obstruction.
	27	912	Office, Service building, floor 2	Dressing Room; 803.4 Benches.	Dressing Room - Bench, missing	3	Provide a compliant bench.
	28	1006	Machinery Space, Pump station 1st floor, floor 1, lobby	Drinking Fountain; 602.7 Drinking Fountains for Standing Persons.	High Fountain, Spout Outlet - Height , not between 38 and 43 inches	2	Remove and replace with a compliant high drinking fountain.
	29	1007	Garage, floor 1, Garage #3	Drinking Fountain; 211.2 Minimum Number.	Low fountain, missing	2	Install a compliant low drinking fountain.
	30	1008	Office, Service building, floor 2	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1009	Office, Service building, floor 2	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	32	1010	Office, Service building, floor 2	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	2	Reconstruct or relocate the impediment to ensure the drinking fountain is located adjacent to a compliant clear floor space, ensuring a forward approach is provided with knee and toe clearance.
	33	1011	Lobby, floor 2, filtration control room foyer	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	34	1025	Machinery Space, floor 1, Pump station	Drinking Fountain; 211.2 Minimum Number.	Low fountain, missing	2	Install a compliant low drinking fountain.
	35	1026	Lobby, floor 2, Lincoln Building Lobby	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	36	1027	Lobby, floor 2, Lincoln Building Lobby	Drinking Fountain; 211.2 Minimum Number.	Low fountain, missing	2	Install a compliant low drinking fountain.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	1073	Breakroom, Filtration building, floor 2	Kitchen/Kitchenettes; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	4	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	38	1074	Breakroom, Filtration building, floor 2, Microwave	Kitchen/Kitchenettes; 804.6.2 Operable Parts.	Appliance - Operable Parts, not within permitted reach range	4	Relocate appliance or provide the operable part within reach range of 15 to 46 inches.
	39	1075	Breakroom, Filtration building, floor 2	Kitchen/Kitchenettes; Advisory 606.1 General.	Soap Dispenser - Operable Parts, not within permitted reach range	4	Relocate soap dispenser to be no higher than 46 inches.
	40	1076	Breakroom, Filtration building, floor 2	Kitchen/Kitchenettes; Advisory 606.1 General.	Paper Towel Dispenser - Operable Parts, not within permitted reach range	4	Relocate paper towel dispenser to be between 15 and 46 inches and ensuring that it is not a protruding object.
	41	1471	Lobby, floor 2, filtration building lobby at Lincoln entrance, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	42	1472	floor 4, filtration control 4th floor stair lobby, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	1505	Storage, floor 1, Garage n 3, garage opener	Miscellaneous Element; 308 Reach Ranges.	Operable Parts/Location, not within permitted reach range	3	Relocate element or provide the operable part within reach range of 15 to 46 inches.
	44	1506	Breakroom, floor 2, Service building, employee time card reader	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	45	1507	Office, floor 2, Lavatory	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	46	1508	Water filtration building, floor 3, Control room, AED cabinet, Fire Sign, Fire Extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	47	1509	Water filtration building, floor 3, Control room, Machine controls	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	48	1615	Parking Lot, West parking lot, Outside	Parking Space (Van Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	1629	Office, floor 2	Platform Lift; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Provide compliant surface or replace with compliant platform lift.
	50	1999	Machinery Space, Pump station, floor 1, Men	Restroom (Multiple User); 604.8.1.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	51	2000	Dressing, floor 2, Service building locker room, Men	Restroom (Multiple User); 604.8.1.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	52	2001	Restroom (Men), floor 2	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Shelf - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Replace or relocate shelf to not be at a height between 27 and 80 inches.
	53	2002	Restroom (Men), floor 2, men's by S-6	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment (wall hung WC) - Depth (Parallel to side wall), less than 56 inches	1	Reconstruct toilet compartment to provide a minimum depth of 56 inches.
	54	2003	Restroom (Men), floor 2, men's by S-6	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	2004	Restroom (Men), floor 2, men's by S-6	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	56	2005	Restroom (Men), floor 2, men's by S-6	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	57	2018	Office, floor 2, Office, Restroom (Men)	Restroom (Multiple User); 703.1 General.	Sign , not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	58	2297	Office, Service building, floor 2, Restroom (Women)	Restroom (Single User); 609.4 Position of Grab Bars.	Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	59	2298	Office, Service building, floor 2, Restroom (Women)	Restroom (Single User); 609.4 Position of Grab Bars.	Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	60	2299	Office, Service building, floor 2, Restroom (Women)	Restroom (Single User); 603.4 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	61	2300	Office, Service building, floor 2, Restroom (Women)	Restroom (Single User); 604.8.1.2 Doors.	Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	62	2301	Office, Service building, floor 2, Restroom (Women)	Restroom (Single User); 306.3.1 General.	Sink - Clear Floor Space - Knee Clearance (Forward Approach) - Height, less than 27 inches	1	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	63	2302	Lobby, floor 3, restroom in filtration control room foyer, Restroom (Unisex)	Restroom (Single User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	64	2303	Lobby, floor 3, restroom in filtration control room foyer, Restroom (Unisex)	Restroom (Single User); 604.7 Dispensers.	Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	65	2304	Lobby, floor 3, restroom in filtration control room foyer, Restroom (Unisex)	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height, greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	66	2305	Lobby, floor 3, restroom in filtration control room foyer, Restroom (Unisex)	Restroom (Single User); Advisory 606.1 General.	Paper Towel Dispenser - Operable Parts, not within permitted reach range	3	Relocate paper towel dispenser to be between 15 and 46 inches and ensuring that it is not a protruding object.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	67	2306	Lobby, floor 3, restroom in filtration control room foyer, Restroom (Unisex)	Restroom (Single User); 306.3 Knee Clearance	Baby changing table - Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	68	2319	Office, floor 2, Service Building, Restroom (Women)	Restroom (Single User); 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	69	2320	Office, Water filtration building, floor 3, Restroom (Unknown)	Restroom (Single User); 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	70	2426	Restroom (Women), Service building, floor 2	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	71	2429	Machinery Space, floor 1, Pump station, Restroom (Men)	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	72	2430	Dressing, Service building, floor 2, Restroom (Unknown)	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	73	2516	Breakroom, floor 2, Break room between s-13 and s-21 service building	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	74	2517	Restroom (Men), floor 2, men's by S-6	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	75	2554	Machinery Space, Pump station, floor All	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	76	2555	Machinery Space, Garage 3, floor 1	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	77	2556	Garage, floor 1, Garage #3	Stairways; 504.3 Open Risers.	Riser - Open Risers, not permitted	5	Reconstruct stairs.
	78	2557	Machinery Space, Garage 3, floor 1	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	79	2558	Lobby, Lincoln Street Lobby, floor 2	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	80	2559	Lobby, North side filtration building foyer Lincoln entr, floor 2	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	81	2560	Filtration building, floor 2	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	82	2561	Parking Lot, west parking lot, Outside	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	83	2562	Filter control room, floor 3	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	84	2564	Storage, floor 1, Garage n 3	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	85	2579	Locker Room, Service building, floor 2	Storage; 811.4 Operable Parts.	Operable Parts - Operation - (5% of total or one of each type), not operable with one hand and grasping, pinching, or twisting required.	3	Replace storage element with operable parts that are compliant with operation requirements and located within a compliant reach range.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	9	Exterior, accessible parking to main entrance	Accessible Route; 406.4 Landings.	Curb Ramp - Landing, missing	1	Construct a curb ramp landing.
	2	297	Locker Room, floor 1, men's locker room, men's locker to conference Room	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	3	298	Bay, floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	4	299	Bay, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	5	311	Entrance, floor 1, Entrance, Public sidewalk to lobby	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	6	668	Exterior, accessible route to entrance, public sidewalk to entrance through driveway	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	669	Exterior, accessible route to entrance, public sidewalk to entrance through driveway	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.
	8	670	Dining Area, floor 1, dining room, dining to exterior door	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	9	695	Bay, floor 1, From bay to other rooms	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	10	696	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	11	916	Locker Room, floor 1, men's locker room	Dressing Room; 903.3 Size.	Bench - Depth, not between 20 and 24 inches	3	Install a compliant bench with a depth between 20 to 24 inches.
	12	1020	Hallway, floor 1, hallway	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1078	Kitchen, floor 1, kitchen	Kitchen/Kitchenettes; 804.3.2 Height.	Work Surface - Height, more than 34 inches	4	Reconstruct work surface height to be 34 inches maximum. Ensure a compliant forward approach with knee and toe clearance is maintained.
	14	1079	Kitchen, floor 1, kitchen	Kitchen/Kitchenettes; 606.3 Height.	Sink - Rim Height, greater than 34 inches	4	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	15	1485	Exterior, Doorbell	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	16	1486	Breakroom, floor 1, lounge, Digital Display and stuffed animals	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1487	Kitchen, floor 1, phone	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1488	Breakroom, floor 1, study room, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1489	Gym, floor basement, workout room, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1490	Gym, floor basement, workout room, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	21	1491	Gym, floor basement, workout room, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	22	1492	Bay, floor 1, Hose	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	23	1493	Bay, floor 1, Cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	24	1494	Bay, floor 1, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1495	Bay, floor 1, house reel	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	26	1511	Bay, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	27	1618	Exterior	Parking Space (Van Accessible Marked); 502.2 Vehicle Spaces.	Marking, missing	1	Provide marking.
	28	1619	Exterior	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	29	2017	Restroom (Men), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	30	2312	Lobby, floor 1, Restroom (Unisex)	Restroom (Single User); 604.3.1 Size.	Room - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet room to provide a minimum width of 60 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	2313	Lobby, floor 1, Restroom (Unisex)	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar - Length, less than 36 inches	1	Replace with compliant grab bar(s) that are a minimum of 36 inches in length.
	32	2314	Lobby, floor 1, Restroom (Unisex)	Restroom (Single User); 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	33	2315	Lobby, floor 1, Restroom (Unisex)	Restroom (Single User); 603.4 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	34	2316	Hallway, floor 1, Restroom (Women)	Restroom (Single User); 604.3.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	35	2324	Lobby, floor 1	Restroom (Single User); 703.4.2 Location.	Sign - Clear Floor Space in front of the sign (Pull side), less than 18 by 18 inches clear floor space centered on the sign is provided	2	Relocate sign to compliant location.
	36	2325	floor 1, Hallway , Restroom (Women)	Restroom (Single User); 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	2431	Restroom (Women), floor 1, Restroom (Women)	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	38	2563	Exterior, floor basement, exterior stair to basement	Stairways; 505.2 Where Required.	Handrails - Extension on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	20	Entrance, Outside	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	2	21	floor 1, Office to stairs	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	3	22	floor 1, Office to storage	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	4	23	floor 1, Office to bay	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, force greater than 5 pounds required	1	Remove or adjust closer on the door to reduce the opening force to less than 5 pounds.
	5	24	floor 1, Office to bay	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	6	25	Machinery Space, floor 1, Bay to electrical room	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, force greater than 5 pounds required	1	Remove or adjust closer on the door to reduce the opening force to less than 5 pounds.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	26	Kitchen, floor 1, Bay to kitchen	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	8	27	Kitchen, floor 1, Kitchen to stairs	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	9	28	Kitchen, floor 1, Kitchen to stairs	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	10	29	Machinery Space, floor 1, Mechanical room , Kitchen to mechanical room	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	11	30	Kitchen, floor 1, Kitchen to back exit	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	12	31	Kitchen, floor 1, Kitchen to bay	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	32	Stairwell, floor 1, Stairwell to bay	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	14	33	Bay, floor 1, Mens Room, Bay to mens restroom	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	15	34	Room, floor 2, Stair to vestibule	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	16	35	Stairwell, floor 2, West stairwell to second floor corridor	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	17	36	Room, floor 2, Bunk room 1, Hallway to bunk room 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	18	37	Gym, floor 2, Breakroom to gym	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	38	Recreation Center, floor 2, Rec area to hallway	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a casied opening with a minimum clear width of 32 inches.
	20	39	Machinery Space, floor Basement , Mechanical room , Stairwell to mechanical room	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	21	40	Machinery Space, floor Basement , Mechanical room , Stairwell to mechanical room	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a casied opening, or relocate the door.
	22	41	Machinery Space, floor Basement	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, force greater than 5 pounds required	1	Remove or adjust closer on the door to reduce the opening force to less than 5 pounds.
	23	1043	Gym, floor 2	Exercise Machines and Equipment; 1004.1 Clear Floor Space.	Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	4	Relocate the exercise machine to ensure a compliant clear floor space with parallel approach is provided adjacent to at least one of every type of machine.
	24	1057	Kitchen, floor 1	Kitchen/Kitchenettes; 606.3 Height.	Sink - Rim Height, greater than 34 inches	4	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1110	Entrance, floor 1, Call button	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	26	1111	Kitchen, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	27	1112	Bay, floor 1, Multiple points at single location	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	28	1113	Hallway, floor 2, Telephone	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	29	1114	Gym, floor 2, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	30	1115	Gym, floor 2, panic button	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1116	Gym, floor 2, Hand sanitizer	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	32	1117	Gym, floor 2, Drinking fountain	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	33	1118	Restroom (Women), floor 2, Soap dispenser and hand sanitizer	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	34	1119	Restroom (Women), floor 2, hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	35	1594	Parking Lot, Outside	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.
	36	1595	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.2 Vehicle Spaces.	Marking, missing	1	Provide marking.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	37	1596	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	38	1758	Restroom (Men), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	39	1759	Restroom (Men), floor 2	Restroom (Multiple User); 703.1 General.	Sign , not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	40	1760	Restroom (Men), floor 2	Restroom (Multiple User); 605.2 Height and Depth.	Urinal - Rim Height, greater than 17 inches	1	Replace or relocate urinal to have the rim height at a maximum of 17 inches.
	41	1761	Restroom (Men), floor 2	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	42	1762	Restroom (Women), floor 2	Restroom (Multiple User); 404.2.4 Maneuvering Clearances, figure a.	Entrance Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	43	1763	Restroom (Women), floor 2,	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
 No image available	44	1764	Restroom (Women), floor 2,	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	45	2169	Restroom (Women), floor 1	Restroom (Single User); 604.3.1 Size.	Room - Depth (Parallel to side wall) - Depth (Parallel to side wall), less than 56 inches	1	Reconstruct toilet room to provide a minimum depth of 56 inches.
	46	2170	Restroom (Men), floor 2	Restroom (Single User); 603.4 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	47	2419	Restroom (Men), floor 2	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
 No image available	48	2420	Restroom (Women), floor 2	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	2439	Sleeping, floor 2, Bunk room 3	Sign ; 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	50	2440	Sleeping, floor 2, Bunk room 1	Sign ; 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	51	2521	Stairwell, floor 1	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	286	Lobby, floor 1, Apparatus Bay 135, lobby to apparatus Bay	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	2	287	Office, floor 1, Watch office 102, watch office to hallway	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	3	288	Hallway, floor 1, hallway, hallway to apparatus Bay	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	4	289	Hallway, floor 1, hallway, hallway by lounge to apparatus Bay	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	5	290	Breakroom, floor 1, lounge, lounge to back patio	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace glass door to ensure the bottom 10 inches is smooth.
	6	291	Storage, floor 1, Pantry 122, lounge to pantry	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	292	Room, floor 1, day room 121, bay lobby to day room 121	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	8	293	Room, floor 1, bay lobby to exercise room, bay lobby to back exit	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	9	294	Lobby, Bay lobby to the dayroom, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cascd opening, or relocate the door.
	10	309	Throughout the facility, floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, force greater than 5 pounds required	1	Remove or adjust closer on the door to reduce the opening force to less than 5 pounds.
	11	310	Bay, floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	12	658	Breakroom, floor 1, lounge, lounge to back patio	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	659	Parking Lot, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	14	660	Gym, floor 1, exercise room 124, bay lobby to exercise room	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	15	661	Bay, floor 1, Bay, inside bay area	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	16	690	Outside, Entrance	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	17	691	Bay, floor 1	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	18	913	Restroom (Women), floor 1	Dressing Room; 803.4 Benches.	Dressing Room - Bench, missing	3	Provide a compliant bench.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	914	Restroom (Women), floor 1	Dressing Room; 803.5 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	20	915	Locker Room, floor 1, men's shower	Dressing Room; 903.3 Size.	Bench - Depth, not between 20 and 24 inches	3	Install a compliant bench with a depth between 20 to 24 inches.
	21	1016	Hallway, floor 1, hallway	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	22	1017	Hallway, floor 1, hallway	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	23	1077	Kitchen, floor 1, Vent hood	Kitchen/Kitchenettes; 307 Protruding Objects.	Appliance - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, or provide cane detection or relocate to an alcove.
	24	1082	Kitchen, floor 1	Kitchen/Kitchenettes; 606.3 Height.	Sink - Rim Height, greater than 34 inches	4	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1083	Kitchen, floor 1	Kitchen/Kitchenettes; 804.3.2 Height.	Work Surface - Height, more than 34 inches	4	Reconstruct work surface height to be 34 inches maximum. Ensure a compliant forward approach with knee and toe clearance is maintained.
	26	1475	Hallway, floor 1, Carbon monoxide detector	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	27	1476	Day room, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	28	1477	Bay, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	29	1478	Bay, floor 1, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	30	1479	Bay, floor 1, Phone	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1480	Bay, floor 1, Gauge	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	32	1481	Gym, floor 1, exercise room 124, shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	33	1482	Gym, floor 1, exercise room 124, shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	34	1510	Gym, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	35	1617	Parking Lot, Outside	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.
	36	2006	Laundry, floor 1, Restroom (Women)	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	2007	Laundry, floor 1, Restroom (Women)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	38	2008	Laundry, floor 1, Restroom (Women)	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	39	2009	Laundry, floor 1, Restroom (Women)	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	40	2010	Laundry, floor 1, Restroom (Women)	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	41	2011	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	42	2012	Restroom (Men), floor 1	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	2013	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	44	2014	Restroom (Men), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	45	2015	Restroom (Men), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	46	2016	Restroom (Men), floor 1	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	47	2307	Restroom (Unisex), floor 1, Public Restroom	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	48	2308	Restroom (Unisex), floor 1, Public Restroom	Restroom (Single User); 307 Protruding Objects.	Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	2309	Hallway, Officers shower, floor 1, Men	Restroom (Single User); 604.3.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	50	2310	Restroom (Unisex), floor 1, Public Restroom	Restroom (Single User); 604.7 Dispensers.	Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	51	2311	Restroom (Unisex), floor 1, Public Restroom	Restroom (Single User); 609.3 Spacing.	Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	52	2321	Lobby, floor 1, Restroom (Unisex)	Restroom (Single User); 604.4 Seats.	Seat - Height, not between 17 and 19 inches	1	Replace water closet or provide seat height between 17 and 19 inches.
	53	2322	floor 1, Public restroom, Unisex	Restroom (Single User); 609.4 Position of Grab Bars.	Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	54	2323	Lobby, floor 1, Public restroom, Unisex	Restroom (Single User); 609.4 Position of Grab Bars.	Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	2408	Restroom (Women), floor 1	Shower Compartment; 608.2.3 Alternate Roll-In Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	56	2409	Dressing, floor 1	Shower Compartment; 608.2.3 Alternate Roll-In Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	57	2427	Officers shower, floor 1	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	58	2463	floor 1, Throughout the facility	Sign ; 703.4.1 Height Above Finish Floor or Ground.	Sign - Height above finish floor, not located where the bottom of the lowest line of text is 48" minimum and/or the bottom of the highest line of text is 60" maximum above the ground.	2	Relocate sign to compliant height.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	300	Dining Area, floor 1, dining room, dining to back patio	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	2	301	Dining Area, floor 1, dining room, dining to back patio	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	3	302	Dining Area, floor 1, dining room, dining to back patio	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	4	303	Bay, floor 1	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	5	304	Dining Area, floor 1, bay, bay to side exit	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	6	305	Exterior, floor 1, lobby	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	671	Dining Area, floor 1, dining to back patio	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	8	672	Bay, floor 1, bay to side exit	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	9	673	Exterior, sidewalk to doorbells	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	10	674	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	11	697	Bay, floor 1, Room next to bay, Within the little room	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	12	1080	Kitchen, floor 1, kitchen	Kitchen/Kitchenettes; 606.3 Height.	Sink - Rim Height, greater than 34 inches	4	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1081	Kitchen, floor 1, kitchen	Kitchen/Kitchenettes; 804.3.2 Height.	Work Surface - Height, more than 34 inches	4	Reconstruct work surface height to be 34 inches maximum. Ensure a compliant forward approach with knee and toe clearance is maintained.
	14	1496	Bay, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1497	Bay, floor 1, shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1498	Bay, floor 1, Hose	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1499	Bay, floor 1, tank holders	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1500	Bay, floor 1, Cabinets	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1501	Bay, floor 1, control box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1502	Bay, floor 1, Hook	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	21	1503	Exterior, doorbells, call box, mail box	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	22	2317	Restroom (Women), floor 1	Restroom (Single User); 604.3.1 Size.	Room - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet room to provide a minimum width of 60 inches.
	23	2318	Restroom (Women), floor 1	Restroom (Single User); 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	24	2326	Bay, floor 1, Bay, Restroom (Men + Women)	Restroom (Single User); 606.2 Clear Floor Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2428	Restroom (Women), floor 1	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	26	2432	Restroom (Unisex), floor 1, Shower in the restroom	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	353	Stairwell, floor 1, Door into bay	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	2	354	Stairwell, floor 1, First floor	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	3	355	Stairwell, floor 2, Doors into stairwell	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	4	356	Stairwell, floor 2, Second floor	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	5	365	Gym, floor B, 008 Stair - 01	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	6	366	Bay, floor 1, 115 Clean Room	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	367	Bay, floor 1, 117 Workshop	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	8	368	Entrance, Outside, Entrance	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	9	397	Entrance, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	10	709	Bay, floor 1	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	11	1033	Entrance, floor 1, Entrance lobby	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	12	1044	Gym, floor B	Exercise Machines and Equipment; 1004.1 Clear Floor Space.	Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	4	Relocate the exercise machine to ensure a compliant clear floor space with parallel approach is provided adjacent to at least one of every type of machine.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1086	Kitchen, floor 1	Kitchen/Kitchenettes; 606.3 Height.	Sink - Rim Height, greater than 34 inches	4	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	14	1087	Kitchen, floor 1	Kitchen/Kitchenettes; 804.3.2 Height.	Work Surface - Height, more than 34 inches	4	Reconstruct work surface height to be 34 inches maximum. Ensure a compliant forward approach with knee and toe clearance is maintained.
	15	1088	Kitchen, floor 1	Kitchen/Kitchenettes; 804.2.1 Pass Through Kitchen.	Pass Through Kitchen - Work area - Width, less than 40 inches	1	Reconstruct or remove cabinetry to provide 40 inches clear between elements.
	16	1531	Breakroom, floor 1, Day Room, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1532	Breakroom, floor 1, Work room 106, shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1533	Office, floor 1, watch office 104, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1534	Locker Room, floor 2, accessible washroom 208, Shower Rod	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1535	Gym, floor B, Workout room 006, fan	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	21	1536	Gym, floor B, Workout room 006, stair exit signs	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	22	1537	Bay, floor 1, Bay area, hose pipes	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	23	1538	Bay, floor 1, Bay area, hose pipes	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	24	1542	Bay, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1543	Bay, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	26	1621	Parking Lot, Outside	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.
	27	2352	Restroom (Unisex), floor 1, nearby the entrance, lobby	Restroom (Single User); 609.4 Position of Grab Bars.	Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	28	2353	Restroom (Unisex), floor 1, nearby the entrance, lobby	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	29	2354	Restroom (Unisex), floor 1, nearby the entrance, lobby	Restroom (Single User); 902.3 Height.	Baby changing table - Height (top of surface), not between 28 and 34 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	30	2355	Restroom (Unisex), floor 1, nearby the entrance, lobby	Restroom (Single User); 404.2.3 Clear Width.	Door - Opening Clear Width, less than 32 inches	1	Reconstruct door opening to have opening clear width of 32 in or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cascd opening with a minimum clear width of 32".

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	2356	Locker Room, floor 2, 208, Restroom (Unisex)	Restroom (Single User); 609.4 Position of Grab Bars.	Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	32	2357	Locker Room, floor 2, 208, Restroom (Unisex)	Restroom (Single User); 609.4 Position of Grab Bars.	Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	33	2358	Locker Room, floor 2, 208, Restroom (Unisex)	Restroom (Single User); 604.3.1 Size.	Room - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet room to provide a minimum width of 60 inches.
	34	2359	Locker Room, floor 2, 208, Restroom (Unisex)	Restroom (Single User); 606.3 Height.	Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	35	2360	Restroom (Unisex), floor 1, Restroom 102	Restroom (Single User); 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	36	2361	Locker Room, floor 2, Restroom 208, Unisex	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	2362	Locker Room, floor 2, Restroom 208, Unisex	Restroom (Single User); 307 Protruding Objects.	Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	38	2363	Locker Room, floor 2, Restroom 208, Unisex	Restroom (Single User); 603.4 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	39	2364	Locker Room, floor 2, Restroom 208, Unisex	Restroom (Single User); Advisory 606.1 General.	Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	40	2375	Restroom (Unisex), 207 Restroom 02, floor 2	Restroom (Single User); 604.3.1 Size.	Room - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet room to provide a minimum width of 60 inches.
	41	2436	Locker Room, floor 2, Accessible washroom 208, Unisex	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	42	2437	Locker Room, floor 2, 207, Unisex	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	2580	Dressing, floor 2, 209 dressing room	Storage; 811.4 Operable Parts.	Operable Parts - Operation - (5% of total or one of each type), not operable with one hand and grasping, pinching, or twisting required.	3	Replace storage element with operable parts that are compliant with operation requirements and located within a compliant reach range.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	490	Play Area, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	2	941	Outside	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	3	1646	Play Area, Outside, size: medium	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	198	Exterior, Tennis Court, Outside, Tennis court	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	580	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	3	581	Exterior	Accessible Route; 403.5.1 Clear Width.	Walking Surface - Clear width, less than 36 inches	1	Reconstruct the walking surface to provide a minimum clear width of 36 inches or remove existing barriers to provide the clear width.
	4	582	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.
	5	583	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	717	Dining Area, Outside, Picnic area, From path to picnic table	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	726	Exterior, Soccer Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	8	727	Exterior, Volleyball Court, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	9	787	Exterior, Volleyball Court, Outside, to assembly area of Volleyball Court	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.
	10	823	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	11	824	Exterior, Tennis Court, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	12	825	Exterior, Bench at East Side Entrance	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	972	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	14	973	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	15	874	Exterior, booth	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	16	875	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space-Knee Clearance (Forward Approach)-Depth (27 inches height), not between 8 and 25 inches	2	Reconstruct or relocate dining/work surface to provide a compliant forward approach with knee and toe clearance.
	17	1684	Exterior, size: medium	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.
	18	1685	Exterior, size: medium	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	19	1737	Play Area, Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Type of surface, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	159	Hallway, floor 1, Hallway to stage	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	2	160	Pantry , floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	3	161	Gym, floor 1	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	4	167	Restroom (Men), floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	5	168	Throughout the building , floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	6	188	Kitchen, floor 1	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	189	Kitchen, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	8	190	Reception/Info Desk, floor 1, Reception, office space	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	9	191	Reception/Info Desk, floor 1, Reception, office space	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	10	192	Recreation Center, Dance studio door, floor 1, Dance Studio, Hallway to Dance Studio	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	11	193	Hallway, floor 1, Computer lab	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	12	194	Exterior, Tennis court	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	404	Lobby, Stairs, floor 1	Accessible Route; 505.8 Surfaces.	Handrails - Surface, no rounded edges	1	Remove existing handrails and replace with new handrails meeting all requirements, including rounded edges on the surface of the handrails.
	14	405	Lobby, Stairs in the lobby, floor 1	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less than 12 inches beyond the bottom ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the bottom of the ramp run.
	15	528	Exterior, Baseball Field	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	16	533	Parking Lot, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	17	537	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	18	780	Exterior, Soccer Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	781	Exterior, Soccer Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	20	782	Exterior, Baseball Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.
	21	783	Recreation Center, Basketball Court, floor 1	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	22	784	Exterior, Baseball Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility. In this case, it could be considered to open a gate into dogout.
	23	785	Exterior, Baseball Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.
	24	786	Exterior, Baseball Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility. In this case, it could be considered to open a gate into dogout.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	804	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	26	805	Exterior, Basketball Court	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces. In this case, it could be considered to relocate the receptacle.
	27	865	Parking Lot, Outside	Accessible Route; 406 Curb Ramps.	Curb Ramp - Running Slope, steeper than 8.33% (1:12)	1	Reconstruct the curb ramp to have a running slope no greater than 8.33%.
	28	907	Locker Room, Both men's and women's locker room , floor 1	Dressing Room; 803.4 Benches.	Dressing Room - Bench, missing	3	Provide a compliant bench.
	29	956	Gym, floor 1	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	30	958	Exterior	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1066	Lobby, floor 1	Kitchen/Kitchenettes; 306.3.1 General.	Sink - Clear Floor Space - Knee Clearance (Forward Approach) - Height, less than 27 inches	4	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	32	1067	Lobby, floor 1, Vent hood	Kitchen/Kitchenettes; 804.6.2 Operable Parts.	Appliance - Operable Parts, not within permitted reach range	4	Relocate appliance or provide the operable part within reach range of 15 to 46 inches.
	33	1299	Computer Room, floor 2, Fire Pull	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	34	1300	Computer Room, floor 2, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	35	1301	Gym, floor 1, Paper Towel Dispenser is also protruding	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	36	1302	Gym, floor 1, Coat hook	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	1306	Lobby, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	38	1307	Hallway, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	39	1308	Backstage , floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	40	1309	Reception/Info Desk, floor 1, Time card recorder	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	41	1310	Pantry , floor 1, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	42	1311	Hallway, floor 1, Fire Pull	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	1312	Arts and crafts room, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	44	1313	Arts and crafts room , floor 1, Paper Towel Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	45	1351	Exterior, Gas meter	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	46	1352	Exterior, Behind the baseball field , Outside, T mobile power pipe and box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	47	1371	Hallway, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	48	1372	Hallway, floor 1, Fire Pull	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	1373	Recreation Center, Basketball Court, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	50	1374	Recreation Center, Basketball Court, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	51	1375	Stage, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	52	1376	Kitchen, floor 1, Soap Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	53	1377	Recreation Center, Dance Studio , floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	54	1609	Parking Lot, Outside	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	1624	Lobby, floor 1	Platform Lift; 410.3 Clear Floor Space.	Platform - Clear Floor Space - Width , less than 30 inches	1	Replace with compliant platform lift.
	56	1625	Hallway	Platform Lift; 410.6 Doors and Gates.	Door/Gates - Opening Time, less than 20 seconds	1	Replace with compliant platform lift.
	57	1626	Hallway, floor 2	Platform Lift; 410.6 Doors and Gates.	Door/Gates - Opening Time, less than 20 seconds	1	Replace with compliant platform lift.
	58	1655	Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	59	1660	Play Area, Swings, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	60	1661	Play Area, Outside, size: large	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	61	1909	Locker Room, floor 1, Restroom (Women)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	62	1910	Locker Room, floor 1, Restroom (Women)	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	63	1911	Locker Room, floor 1, Restroom (Women)	Restroom (Multiple User); 404.2.8.1 Door Closers and Gate Closer.	Wheelchair Accessible Compartment - Door does not self-close.	1	Replace door with self-closing type, or adjust the hardware.
	64	1912	Locker Room, floor 1, Restroom (Women)	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	65	1913	Locker Room, floor 1, Restroom (Men)	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	66	1914	Locker Room, floor 1, Restroom (Men)	Restroom (Multiple User); 404.2.8.1 Door Closers and Gate Closer.	Wheelchair Accessible Compartment - Door does not self-close.	1	Replace door with self-closing type, or adjust the hardware.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	67	1915	Locker Room, floor 1, Restroom (Men)	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	68	1916	Locker Room, floor 1, Restroom (Men)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	69	1923	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	70	1924	Hallway, floor 1, Restroom (Men)	Restroom (Multiple User); 605.2 Height and Depth.	Urinal - Rim Height, greater than 17 inches	1	Replace or relocate urinal to have the rim height at a maximum of 17 inches.
	71	1925	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Rear Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	72	1926	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 404.2.8.1 Door Closers and Gate Closer.	Wheelchair Accessible Compartment - Door does not self-close.	1	Replace door with self-closing type, or adjust the hardware.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	73	1929	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror Countertops - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	74	1930	Hallway, floor 1, Restroom (Men)	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	75	1931	Hallway, floor 1, Restroom (Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	76	1932	Hallway, floor 1, Restroom (Women)	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	77	1933	Locker Room, floor 1, Restroom (Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	78	1934	Locker Room, floor 1, Restroom (Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	79	1935	Locker Room, floor 1, Restroom (Men)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	80	1936	Locker Room, floor 1, Restroom (Men)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.
	81	2380	Lobby, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	82	2393	Lobby, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	83	2413	Locker Room, floor 1, Restroom (Men + Women)	Shower Compartment; 608.2.2 Standard Roll-In Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	84	2495	Classroom, Art and craft, floor 1	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	85	2537	Gym, floor 1	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	86	2538	Gym, floor 1	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	87	2539	Auditorium, floor 1	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	88	2540	Hallway, floor 1-2	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	988	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	2	884	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space-Knee Clearance (Forward Approach)-Depth (9 inches height), not between 11 and 25 inches	2	Reconstruct or relocate dining/work surface to provide a compliant forward approach with knee and toe clearance.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	199	Entrance, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	371	Exterior	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	3	725	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	813	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	5	826	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	6	974	Entrance, Outside	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	876	Exterior , table	Dining/Work Surface; 307 Protruding Objects.	Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection or relocate to an alcove.
	8	877	Exterior , table	Dining/Work Surface; 307 Protruding Objects.	Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection or relocate to an alcove.
	9	878	Exterior , other	Dining/Work Surface; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the dining/work surface to the rest of the facility.
	10	1686	floor Put, size: small	Play Area; 1008.2.5.1 Ground Level.	Play Component - Connection (Ground) - Ramp - Running Slope - Width, steeper than 6.25% (1:16)	3	Provide compliant connection.
	11	1687	Play Area, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	12	1688	Play Area, Going to the slide , Outside, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	357	Entrance, floor 1, Entrance, exterior to interior	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	2	358	Recording studio, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	3	359	Recording studio, floor 1	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	4	360	Recording studio, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	5	361	Hallway, Rear egress door, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	6	362	Hallway, Egress from stage, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	363	Hallway, Egress from stage, floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	8	364	Lobby, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	9	369	Conference Room, floor 1, Restroom	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	10	370	Recording studio, floor 1, Recording Studio	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	11	710	Dining Area, floor 1, Storage room, dining area to storage room	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	12	711	Conference Room, floor 1, Mechanical room, conference room to mechanical room	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	712	Conference Room, floor 1, Multi-purpose room, conference room to stage	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	14	1034	Restroom (Unisex), floor 1, Restroom lobby	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	15	1035	Restroom (Unisex), floor 1, Restroom lobby	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	16	1539	Concessions, floor 1, bar counter area, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1540	Auditorium, floor 1, Auditorium , 3 coat hooks, not reach range and protruding object	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1541	Storage, floor 1, Storage room, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1544	Dining Area, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1545	Dining Area, floor 1, Thermostat	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	21	1546	Dining Area, floor 1, Thermostat	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	22	1547	Conference Room, floor 1, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	23	2365	Conference Room, floor 1, Restroom (Unisex)	Restroom (Single User); 609.4 Position of Grab Bars.	Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	24	2366	Conference Room, floor 1, Restroom (Unisex)	Restroom (Single User); 609.4 Position of Grab Bars.	Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2367	Conference Room, floor 1, Restroom (Unisex)	Restroom (Single User); 603.4 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	26	2368	Conference Room, floor 1, Restroom (Unisex)	Restroom (Single User); 902.3 Height.	Baby changing table - Height (top of surface), not between 28 and 34 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	27	2369	Restroom (Unisex), floor 1, Unisex restroom by office	Restroom (Single User); 603.2.1 Turning Space.	Clearance - Turning Space , missing	1	Reconfigure the restroom to provide compliant turning space.
	28	2376	Conference Room, floor 1, Restroom (Unisex)	Restroom (Single User); 307 Protruding Objects.	Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	29	2377	Conference Room, floor 1, Restroom (Unisex)	Restroom (Single User); 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	30	2378	Conference Room, floor 1, Restroom (Unisex)	Restroom (Single User); 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	2391	Concessions, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Length, less than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches long.
	32	2404	Concessions, floor 1	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Length, less than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches long.
	33	2466	Restroom (Unisex), floor 1, Restroom lobby	Sign ; 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	34	2572	Auditorium, Stage, floor 1, Multi-purpose room	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	535	Entrance, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	2	536	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	3	1370	Exterior, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	4	1657	Play Area, Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	5	1658	Play Area, Outside, size: large	Play Area; 1008.3.2.3 Transfer Supports.	Transfer Steps - Mean of Support, missing	3	Replace with compliant transfer steps.
	6	1659	Pool, Outside, size: medium	Play Area; 1008.4 Play Components.	Play Table - Knee Clearance - Depth, less than 17 inches	3	Replace with compliant play table.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	202	Entrance, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	203	Back entrance, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	3	721	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	745	Play Area, Outside, Sidewalk to benches	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	817	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	6	860	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1383	Play Area, Outside, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	1695	Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	9	1696	Outside, size: small	Play Area; 1008.2.5.1 Ground Level.	Play Component - Connection (Ground) - Ramp - Running Slope - Width, steeper than 6.25% (1:16)	3	Provide compliant connection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	372	Restroom (Women), floor 1, Women, exterior to interior	Accessible Route; 404.2.4 Maneuvering Clearances, figure h.	Door - Maneuvering Clearance - Latch Approach - Pull side, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 24 inches. (Case H)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	2	373	Restroom (Men), floor 1, Men, exterior to interior	Accessible Route; 404.2.4 Maneuvering Clearances, figure h.	Door - Maneuvering Clearance - Latch Approach - Pull side, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 24 inches. (Case H)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	3	946	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	4	1182	Exterior, drinking fountain	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	5	1183	Restroom (Men), floor 1, hand dryer, Fan and window	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	6	1184	Storage, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1185	Restroom (Women), floor 1, Hand dryer, fan and window	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	2065	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	9	2106	Restroom (Women), floor 1	Restroom (Multiple User); 305.2 Floor or Ground Surfaces.	Common Area - Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	1	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	10	2107	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment (floor mounted WC) - Depth (Parallel to side wall), less than 59 inches	1	Reconstruct toilet compartment to provide a minimum depth of 59 inches.
	11	2108	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	12	2109	Restroom (Men), floor 1,	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	499	Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	2	1177	Outside, picnic tables	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	741	Exterior, floor 1, Sidewalk to flagpole	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	6	Exterior	Accessible Route; 406 Curb Ramps.	Curb Ramp - Running Slope, steeper than 8.33% (1:12)	1	Reconstruct the curb ramp to have a running slope no greater than 8.33%.
	2	7	Exterior	Accessible Route; 406.4 Landings.	Curb Ramp - Landing, missing	1	Construct a curb ramp landing.
	3	615	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	4	616	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	5	617	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	618	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	619	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	8	620	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	9	621	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	10	622	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	11	623	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	12	624	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	729	Exterior, Fishing Dock	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	14	845	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	15	846	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	16	989	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	17	1048	Exterior	Fishing Pier and Platform; 206.2.14 Fishing Piers and Platforms.	Accessible Route, missing	1	Construct an accessible route that connect the fishing pier or platform to the rest of the facility.
	18	1714	Play Area, Outside, size: large	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1715	Play Area, Outside	Play Area; 1008.4 Play Components.	Play Component - Height (ages 5-8), not between 18 and 40 inches	3	Replace with compliant component.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	750	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	855	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	827	Entrance, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	2	828	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	3	1689	Play Area, Outside , size: small	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	492	Outside	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	2	1648	Play Area, Outside, size: small	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.
	3	1649	Play Area, Outside, size: small	Play Area; 1008.4.2 Clear Floor or Ground Space.	Play Component - Floor or Ground Surfaces - Surface, not stable, firm or slip resistant	3	Provide compliant walking surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	539	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	2	540	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	3	541	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	4	542	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	5	543	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	6	544	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	545	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	8	546	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	9	547	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	10	747	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	11	853	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	654	Central Street Entrance, Outside, SE corner sidewalk to play area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	655	Steward Avenue Entrance, Outside, NW corner sidewalk to play area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	656	Central street and Steward Ave corner Entrance, Outside, SW corner sidewalk to play area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	737	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	738	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	740	Exterior, floor 1, Sidewalk to flagpole	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	852	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	861	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	9	886	Exterior , table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	10	1014	Exterior	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space - Slope, steeper than the maximum allowed of 2% (1:48) in any direction	2	Reconstruct the walking surface of the clear floor space to ensure no slope exceeds the maximum allowable of 2% for a minimum of 30 inches by 48 inches. Ensure the clear floor space is connected to a compliant accessible route.
	11	1015	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	12	1720	Play Area, Outside, size: medium	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	18	Exterior, Tennis Court, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gates. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	51	Community garden, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	3	374	Play Area, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	4	424	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	5	425	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	6	426	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	427	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	8	428	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	9	429	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	10	430	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	11	431	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	12	432	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	433	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	14	434	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	15	435	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	16	436	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	17	437	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	18	438	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	439	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	20	440	Exterior, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	21	441	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	22	442	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	23	443	Walkway, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	24	444	Walkway, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	445	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	26	446	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	27	447	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	28	448	Play Area, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	29	453	Exterior, Baseball Field, To dugout	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	30	454	Exterior, Baseball Field, To dugout	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	455	Exterior, Baseball Field, Cricket field, To the bleachers	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	32	456	Exterior, Sidewalk to community garden	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	33	752	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	34	753	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	35	754	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	36	755	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	756	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	38	757	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	39	758	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	40	759	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	41	760	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	42	761	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	762	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	44	763	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	45	764	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	46	765	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	47	766	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	48	767	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	768	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	50	769	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	51	770	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	52	771	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	53	772	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	54	773	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	774	Exterior, Bleacher, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	56	925	Play Area, Outside	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	57	1554	Outside	Parking Space (Standard Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.
	58	1593	Exterior Patio, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	59	1632	Play Area, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	60	1633	Play Area, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	61	1634	Play Area, Outside, Animals Spring riders, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	62	1635	Play Area, Outside, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Type of surface, not to standards	3	Replace with compliant ground surface.
	63	1636	Play Area, Outside, size: small	Play Area; 1008.3.1 Transfer Platforms.	Transfer Platform, missing	3	Provide a compliant transfer platform.
	64	1751	Gym, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	65	1755	loor 1, Restroom (Men + Women)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	66	1756	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	67	1757	Restroom (Men), floor 1	Restroom (Multiple User); 305.7 Maneuvering Clearance.	Urinal - Clear Floor Space - Width - Within an Alcove, less than 36 inches width provided within an alcove	1	Relocate adjacent partitions/wall to provide a compliant clear floor space.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	19	Bay, Outside, Bathroom , Park to bathroom	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	2	736	Exterior, Baseball Field, Sidewalk to bleachers	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	739	Exterior, floor 1, Sidewalk to dugout	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	1096	Exterior, Drinking Fountain	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	5	1109	Kitchen, floor 1, Dispenser, Paper towels and soap	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	6	1746	Restroom (Men), floor 1	Restroom (Multiple User); 305.7 Maneuvering Clearance.	Urinal - Clear Floor Space - Width - Within an Alcove, less than 36 inches width provided within an alcove	1	Relocate adjacent partitions/wall to provide a compliant clear floor space.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1747	Restroom (Men), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	8	1748	Restroom (Men), floor 1	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	9	2063	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	10	2064	Restroom (Women), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	11	2470	Kitchen, floor 1	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	718	Exterior, from path to benches	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	814	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	3	879	Entrance, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	4	1690	Outside , size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	459	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	460	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	461	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	4	462	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	5	463	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	6	464	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	465	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	8	473	Exterior, Parking to entrance.	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	9	1046	Exterior	Fishing Pier and Platform; 206.2.14 Fishing Piers and Platforms.	Accessible Route, missing	1	Construct an accessible route that connect the fishing pier or platform to the rest of the facility.
	10	1130	Exterior, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	11	1555	Parking Lot, Outside	Parking Space (Standard Accessible Marked); 208.2 Minimum Number.	Parking Space (Standard Accessible Marked), missing	1	Construct compliant standard accessible parking space on shortest accessible route.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	106	Office, floor 1, Rental Concession	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a casied opening with a minimum clear width of 32 inches.
	2	506	Exterior Patio, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	947	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	4	948	Exterior	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	5	949	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	6	1843	Restroom (Men), floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1844	Restroom (Women), floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	8	1845	Restroom (Women), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	9	1846	Restroom (Women), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	10	2066	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	11	2067	Restroom (Women), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	12	2068	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	2069	Restroom (Men), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear and side grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	14	2070	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	15	2071	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	16	2072	Restroom (Men), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	17	2073	Restroom (Men), floor 1	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	18	2074	Restroom (Men), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	2110	Restroom (Women), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	20	2111	Restroom (Women), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	21	2112	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Baby changing table - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	22	2113	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	23	2114	Restroom (Men), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	24	2115	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2116	Restroom (Men), floor 1,	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	26	2117	Restroom (Women), floor 1	Restroom (Multiple User); 604.4 Seats.	Wheelchair Accessible Compartment - Seat - Height, greater than 19 inches	1	Replace water closet to provide a seat at a maximum height of 19 inches.
	27	2118	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet compartment to provide a minimum width of 60 inches.
	28	2119	Restroom (Women), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	29	2120	Restroom (Men), floor 1	Restroom (Multiple User); 703.1 General.	Sign , not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	30	2121	Restroom (Women), floor 1	Restroom (Multiple User); 703.1 General.	Sign , not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	585	Entrance, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	586	Play Area, Outside, from pathway to play area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	587	Shelter, Basketball Court, Outside, from pathway to basketball court	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	830	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	5	975	Back entrance , Outside	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	6	1693	Play Area, Outside , size: medium	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	2	Exterior, By the parking lot, Outside	Accessible Route; 406 Curb Ramps.	Curb Ramp - Running Slope, steeper than 8.33% (1:12)	1	Reconstruct the curb ramp to have a running slope no greater than 8.33%.
	2	3	Exterior, By the parking lot, Outside	Accessible Route; 405.4 Floor or Ground Surfaces.	Curb Ramp - Changes in level (other than running, cross slopes), are not permitted	1	Reconstruct the curb ramp to have no change in level.
	3	382	Exterior, By the parking lot, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope - existing sites/building/facilities, steeper than 12.5% (1:8) (with 3 in maximum rise)	1	Reconstruct ramp to a maximum slope of 12.5% for a 3 inch maximum rise.
	4	563	Parking Lot, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	5	564	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	965	Play Area, Outside	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1378	Exterior, Picnic Tables	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	1379	Exterior, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	9	1611	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	10	1670	Play Area, Outside , size: large	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	11	1671	Play Area, Outside , size: large	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.
	12	2272	Exterior, By the parking lot, Outside, Restroom (Unisex)	Restroom (Single User); 604.3.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	592	Outside	Accessible Route; 403.5.1 Clear Width.	Walking Surface - Clear width, less than 36 inches	1	Reconstruct the walking surface to provide a minimum clear width of 36 inches or remove existing barriers to provide the clear width.
	2	593	Entrance, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	3	594	Entrance, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	4	595	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	5	596	Entrance, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	6	597	Entrance, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	722	Entrance, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	8	818	Entrance, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	9	835	Exterior, Wesley Ave and Mulford Streets Corner	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	10	978	Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Floor or Ground Surfaces - Surface, not stable, firm, and slip resistant	2	Reconstruct the walking surface of the clear floor space to provide a ground surface material and condition that is stable, firm, and slip resistant.
	11	979	Play Area	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	12	882	Play Area, Outside, table	Dining/Work Surface; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the dining/work surface to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1382	Outside , Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	14	1697	Outside , size: medium	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	15	1698	Play Area, Outside, size: small	Play Area; 1008.4.2 Clear Floor or Ground Space.	Play Component - Floor or Ground Surfaces - Surface, not stable, firm or slip resistant	3	Provide compliant walking surface.
	16	1702	Play Area, Outside, size: large	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	103	Tennis Court, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	493	Play Area, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	494	Play Area, Baseball Field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	495	Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	5	496	Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	6	731	Soccer Field, Outside, Sidewalk to soccer field	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	742	Play Area, Baseball Field, Outside, Bleachers to dugout	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	8	1738	Exterior, size: medium	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.
	9	2045	Restroom (Men), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	10	2082	Restroom (Women), floor 1	Restroom (Multiple User); 604.6 Flush Controls.	Wheelchair Accessible Compartment - Flush Control - Location, not on the open side of water closet	1	Replace water closet and ensure that control will be on the open side of the water closet.
	11	2083	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extention from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	12	2084	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment (wall hung WC) - Depth (Parallel to side wall), less than 56 inches	1	Reconstruct toilet compartment to provide a minimum depth of 56 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	2085	Restroom (Men), floor 1	Restroom (Multiple User); 604.6 Flush Controls.	Wheelchair Accessible Compartment - Flush Control - Location, not on the open side of water closet	1	Replace water closet and ensure that control will be on the open side of the water closet.
	14	2086	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	15	2087	Restroom (Men), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	16	2088	Restroom (Men), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object below, less than 1 1/2 inches	1	Relocate obstruction(s) located within 1 1/2 inches below the grab bar.
	17	2089	Restroom (Men), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	18	2127	Restroom (Women), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	2128	Restroom (Women), floor 1	Restroom (Multiple User); 305.2 Floor or Ground Surfaces.	Common Area - Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	1	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	20	2129	Restroom (Women), floor 1	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.
	21	2130	Restroom (Women), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	22	2131	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	23	2132	Restroom (Women), floor 1	Restroom (Multiple User); 703.4.1 Height Above Finish Floor or Ground.	Sign - Height above finish floor, not located where the bottom of the lowest line of text is 48" minimum and/or the bottom of the highest line of text is 60" maximum above the ground.	2	Relocate sign to compliant height.
	24	2133	Restroom (Men), floor 1	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2134	Restroom (Men), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	26	2135	Restroom (Men), floor 1	Restroom (Multiple User); 703.4.1 Height Above Finish Floor or Ground.	Sign - Height above finish floor, not located where the bottom of the lowest line of text is 48" minimum and/or the bottom of the highest line of text is 60" maximum above the ground.	2	Relocate sign to compliant height.
	27	2136	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	2046	Restroom (Women), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	2	2467	Restroom (Men), floor 1	Sign ; 703.4.1 Height Above Finish Floor or Ground.	Sign - Height above finish floor, not located where the bottom of the lowest line of text is 48" minimum and/or the bottom of the highest line of text is 60" maximum above the ground.	2	Relocate sign to compliant height.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	227	Restroom (Men), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	2	228	Restroom (Women), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	3	635	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	636	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	5	637	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	6	638	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	639	Exterior, floor 1	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.
	8	640	Exterior, floor 1	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.
	9	993	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	10	994	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	11	1397	Room, floor 1, Cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	12	1398	Room, floor 1, Plumbing	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1399	Restroom (Men), floor 1, Windows	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	14	1400	Restroom (Men), floor 1, Hand Dryer and Fan	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1401	Exterior, floor 1, Public postings board	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1402	Restroom (Women), floor 1, Windows	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1403	Restroom (Women), floor 1, Fan	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1964	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Distance from the rear wall , more than 12 inches	1	Relocate the grab bar(s) to be a maximum of 12 inches from the rear wall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1965	Restroom (Men), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	20	1966	Restroom (Men), floor 1	Restroom (Multiple User); 305.2 Floor or Ground Surfaces.	Common Area - Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	1	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	21	1967	Restroom (Men), floor 1	Restroom (Multiple User); 403.3 Slope.	Common Area - Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	22	1968	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment (floor mounted WC) - Depth (Parallel to side wall), less than 59 inches	1	Reconstruct toilet compartment to provide a minimum depth of 59 inches.
	23	1969	Restroom (Women), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	24	1970	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1971	Restroom (Women), floor 1	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.
	26	1972	Restroom (Women), floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	27	1973	Restroom (Women), floor 1	Restroom (Multiple User); 403.3 Slope.	Common Area - Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	28	2416	Exterior, Restroom (Unknown)	Shower Compartment; 608.6 Shower Unit and Water.	Shower Spray - Hose Length, less than 59 inches	3	Install a hand held shower sprayer with hose 59 inches minimum long.
	29	2460	Restroom (Women), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	591	Outside	Accessible Route; 403.5.1 Clear Width.	Walking Surface - Clear width, less than 36 inches	1	Reconstruct the walking surface to provide a minimum clear width of 36 inches or remove existing barriers to provide the clear width.
	2	834	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	3	881	Outside , table	Dining/Work Surface; 902.3 Height.	Height (top of surface), not between 28 and 34 inches	2	Reconstruct dining/work surface height to be within accessible range.
	4	1700	Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	5	1701	Play Area, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	6	1741	Play Area, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	14	Storage, floor 1, Storage to exit.	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	15	Lobby, floor 1, kitchen	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	3	16	Locker Room, floor 1, Locker room both men's and women's	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	4	17	Gym, floor 1, Gym and both of bathroom doors 10"	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	5	401	Gym	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less than 12 inches beyond the bottom ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the bottom of the ramp run.
	6	449	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.

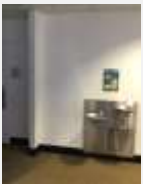
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	450	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	8	451	Exterior, From ROW to entrance.	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	9	452	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	10	862	Exterior, Parking to entrance.	Accessible Route; 406.4 Landings.	Curb Ramp - Landing - Slope, steeper than 2% (1:48)	1	Reconstruct curb ramp landing.
	11	894	Locker Room, floor 1	Dressing Room; 903.3 Size.	Bench - Length, less than 42 inches	3	Install a compliant bench with a minimum length of 42 inches.
	12	926	Hallway, floor 1	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1055	Kitchen, floor 1	Kitchen/Kitchenettes; 804.3.1 Clear Floor or Ground Space.	Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	4	Reconstruct the work surface to provide a compliant forward approach including knee and toe clearance.
	14	1056	Kitchen, floor 1	Kitchen/Kitchenettes; 804.6.2 Operable Parts.	Appliance - Operable Parts, not within permitted reach range	4	Relocate appliance or provide the operable part within reach range of 15 to 46 inches.
	15	1089	Kitchen, floor 1, Ice maker switch	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	16	1090	Kitchen, floor 1, Baby Changing station	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1091	Lobby, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1092	Lobby, floor 1, Building Structure, Bracing in misc rooms	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1093	Restroom (Men), floor 1, Hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1094	Restroom (Men), floor 1, Baby Changing station	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	21	1095	Restroom (Women), floor 1, Hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	22	1097	Hallway, floor 1, Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	23	1098	Locker Room, Men + Women, floor 1, Coat hook	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	24	1099	Kitchen, floor 1	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1100	Kitchen, floor 1, Light switch	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	26	1101	Kitchen, floor 1, Light switch	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	27	1102	Storage, floor 1, shelf and utility cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	28	1103	Lobby, floor 1, counter	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	29	1104	Lobby, floor 1, Vending machine	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	30	1105	Lobby, floor 1, Vending machine	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1106	Office, floor 1, counter	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	32	1107	CraftRoom B, floor 1, 119, paper towel dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	33	1108	Hallway, floor 1, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	34	1592	Exterior Patio, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	35	1744	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Rear Grab Bar - Space between wall and bar, not 1 1/2 inches	1	Replace with compliant grab bars or relocate the grab bar(s) to provide the 1 1/2 inches from the wall.
	36	1745	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Replace or relocate toilet paper dispenser to not be a protruding object and be within reach range.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	1749	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	38	1750	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.
	39	1752	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 404.2.10 Door and Gate Surfaces.	Entrance Door - Smooth Surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	40	1753	Gym, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.
	41	1754	floor 1, Restroom (Men + Women)	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	42	2167	Restroom (Women)	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	2168	Restroom (Men + Women), floor 1	Restroom (Single User); 604.3.1 Size.	Room - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet room to provide a minimum width of 60 inches.
	44	2418	Locker Room, floor 1, Restroom (Men + Women)	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Multiple Elements in the shower are not to accessibility standards.	3	Reconstruct the shower, or build a new one compliant with the accessibility standards.
	45	2438	Hallway, floor 1	Sign ; 703.4.1 Height Above Finish Floor or Ground.	Sign - Height above finish floor, not located where the bottom of the lowest line of text is 48" minimum and/or the bottom of the highest line of text is 60" maximum above the ground.	2	Relocate sign to compliant height.
	46	2468	Craft Room A, floor 1, 118	Sink; 306.3.1 General.	Sink - Clear Floor Space - Knee Clearance (Forward Approach) - Height, less than 27 inches	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	47	2469	Craft Room B, floor 1, 119	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	205	Entrance, floor 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	2	206	Room, floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on both sides	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on both the pull and push side.
	3	207	Room, floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	4	208	Entrance, floor 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	5	209	Entrance, floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on both sides	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on both the pull and push side.
	6	210	Kitchen, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	211	Room, floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	8	212	Restroom (Unisex), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	9	625	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	10	626	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	11	627	Room, floor 1	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	12	628	Room, floor 1	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	730	Entrance, floor 1	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	14	1387	floor 1, AV equipment	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	2273	Restroom (Unisex), floor 1	Restroom (Single User); 604.2 Location.	Seat - Centerline Location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	16	2274	Restroom (Unisex), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Length, less than 42 inches	1	Replace with compliant grab bar(s) that are a minimum of 42 inches in length.
	17	2275	Restroom (Unisex), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar - Length, less than 36 inches	1	Replace with compliant grab bar(s) that are a minimum of 36 inches in length.
	18	2276	Restroom (Unisex), floor 1	Restroom (Single User); 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	2277	Restroom (Unisex), floor 1	Restroom (Single User); 307 Protruding Objects.	Miscellaneous Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate dispenser to a location that provides cane detection or to be at a maximum height of 27 inches.
	20	2278	Restroom (Unisex), floor 1	Restroom (Single User); 604.7 Dispensers.	Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	21	2506	Kitchen, floor 1	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	22	2507	Kitchen, floor 1	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	213	Entrance, floor 1	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	2	214	Entrance, floor 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a casied opening with a minimum clear width of 32 inches.
	3	215	Entrance, floor 1	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a casied opening with a minimum clear width of 32 inches.
	4	216	Entrance, floor 1	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	5	217	Entrance, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a casied opening, or relocate the door.
	6	218	Room, floor 1	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.

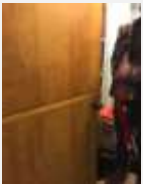
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	219	Room, floor 1	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	8	220	Room, floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	9	221	Entrance, floor 1	Accessible Route; 404.2.5 Thresholds.	Door - New Threshold height, greater than 1/2 inch	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	10	222	Entrance, floor 1	Accessible Route; 404.2.5 Thresholds.	Door - New Threshold height, greater than 1/2 inch	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	11	629	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	12	630	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	631	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	14	1388	floor 1, Door shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1389	Storage, floor 1, Av equipment	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1390	Room, floor 1, Cased opening (too low)	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	13	Exterior, floor 1, Parking to shelter	Accessible Route; 406 Curb Ramps.	Curb Ramp - Running Slope, steeper than 8.33% (1:12)	1	Reconstruct the curb ramp to have a running slope no greater than 8.33%.
	2	398	Exterior, Parking to restrooms	Accessible Route; 405.7.1 Slope.	Ramp - Intermediate Landing - Slope, steeper than 2% (1:48)	1	Reconstruct ramp and landing to have a maximum of 2% cross-slope.
	3	657	Exterior, From path to pier	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	724	Exterior, From path to picnic table	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	887	Exterior, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	6	1049	Exterior	Grill; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connects the grill to the rest of the facility or relocate the grill.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	8	Parking Lot, Outside	Accessible Route; 406.2 Counter Slope.	Curb Ramp - Counter Slope of adjoining gutters and road surfaces , steeper than 5% (1:20)	1	Repave the counter slope at the base of the curb ramp to be a maximum of 5%.
	2	223	Restroom (Men), floor 1	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, force greater than 5 pounds required	1	Remove or adjust closer on the door to reduce the opening force to less than 5 pounds.
 No image available	3	224	Restroom (Women), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	4	389	Exterior	Accessible Route; 405.9.2 Curb or Barrier.	Ramp - Edge Protection - Curb or Barrier - Opening, greater than 4 inches	1	Install compliant edge protection on both sides of the ramp.
	5	406	Exterior	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the ramp run.
	6	407	Exterior	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less then 12 inches beyond the bottom ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the bottom of the ramp run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	408	Exterior	Accessible Route; 505.3 Continuity.	Handrails - Continuity (switchback or dogleg) , not continuous between runs	1	Replace with compliant handrail that is continuous between ramp runs.
	8	409	Exterior	Accessible Route; 505.4 Height.	Handrails - Height , not between 34 and 38 inches above walking surface	1	Install compliant handrails on both sides of the ramp at a height between 34 and 38 inches above the walking surface.
	9	410	Exterior	Accessible Route; 505.10.1 Top and Bottom Extension at Ramps.	Handrails - Extension on ramps -Length, required extension is less then 12 inches beyond the bottom ramp run where the ramp run slope becomes a landing	1	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the bottom of the ramp run.
	10	411	Exterior	Accessible Route; 505.4 Height.	Handrails - Height , not between 34 and 38 inches above walking surface	1	Install compliant handrails on both sides of the ramp at a height between 34 and 38 inches above the walking surface.
	11	632	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	12	633	Exterior, floor 1	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	13	990	Exterior, floor 1	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	14	964	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	15	1391	floor 1, Plumbing	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1392	floor 1, Oxygen Storage Cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	17	1393	floor 1, Heater	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	18	1394	Exterior, floor 1, Lamp	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1588	Parking Lot, Outside	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	20	1937	Outside, Restroom (Men + Women)	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	21	1938	Outside, Restroom (Men + Women)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	22	1939	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	23	1940	Restroom (Men), floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	24	1941	Restroom (Men), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1942	Restroom (Men), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	26	1943	Restroom (Men), floor 1	Restroom (Multiple User); 403.3 Slope.	Common Area - Walking Surface - Running slope, steeper than 5% (1:20), between the urinal-sink area and the drainage.	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	27	1944	Restroom (Men), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	28	1945	Restroom (Women), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	29	1946	Restroom (Women), floor 1	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	30	1947	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Trash bin - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate the trash bin to a location that provides cane detection or to be at a maximum height of 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1948	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	32	1949	Restroom (Women), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	33	1950	Restroom (Women), floor 1	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	34	1951	Restroom (Women), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	35	2414	Exterior	Shower Compartment; 608.6 Shower Unit and Water.	Shower Spray - Hose Length, less than 59 inches	3	Install a hand held shower sprayer with hose 59 inches minimum long.
	36	2544	Exterior	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	231	Storage, Attic, floor 5	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	2	232	Hallway, floor 5, Stair into attic	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	3	233	Conference Room, floor 5, 4900	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Door does not have hardware. Provide one with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	4	234	Kitchen, floor 5, 4807	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	5	235	Hallway, floor 5, Several rooms	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	6	236	Hallway, floor 5, 4600 and 4500	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	237	Breakroom, floor 5, City Manager Office	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	8	238	Breakroom, floor 5, City Manager Office	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	9	239	Office, floor 5, City Manager Office	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	10	240	Breakroom, floor 5, Law Enforcement office	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	11	241	Hallway, floor 5, 4450, 4400, 4200, 4100 and 4000	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	12	242	Conference Room, floor 5, 4101	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	243	Office, floor 5, Within 4000	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	14	244	Storage, floor 3, 3003	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	15	245	Office, floor 4, 4000 former AP office, from open office to private office	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	16	246	Office, floor 3, 3106, corridor to office	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	17	247	Hallway, floor 3, 3510, 3600	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	18	248	Office, 3510 permitting, floor 3, 3510, public area to work area	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	249	Office, floor 2, 2750 and Council Chamber	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	20	250	Office, floor 2, 2200	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	21	251	Office, floor 2, 2103	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	22	252	Hallway, floor 1, corridor to single door emergency exit on west side by elevators	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	23	253	Hallway, floor 1, corridor to single door emergency exit on west side by elevators	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	24	254	Office, floor 1, City Clerk	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	255	Office, floor 1, 1300, public area to work area	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, force greater than 5 pounds required	1	Remove or adjust closer on the door to reduce the opening force to less than 5 pounds.
	26	256	Office, floor 1, 1100, lobby area to office area	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	27	257	Mail room, floor 1, 1000	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	28	258	Office, Parks and recreation, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cascd opening, or relocate the door.
	29	259	Office, Parks and recreation, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	30	260	Machinery Space, floor G, G401, Accessible entrance lobby to mechanical room	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cascd opening with a minimum clear width of 32 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	261	Storage, Attic, floor 5, North Stairs to storage-office	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	32	262	Storage, Attic, floor 5, North Stairs to storage-office	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	33	263	Storage, Attic, floor 5, South Stairs to lift-storage	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	34	264	Storage, Attic, floor 5, South Stairs to lift-storage	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	35	265	Office, floor 4, Paul Zalmezak office	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	36	266	Storage, Utility room, floor 2	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	267	Office, floor 1, Human resources, Human Resources to 1702	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	38	268	Office, floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	39	269	Hallway, floor G, Next to G320	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	40	270	Hallway, floor G, Elevator lobby, Lobby to mechanical room	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	41	390	Storage, Attic, floor 5	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	42	391	Hallway, Near G800, floor G	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	412	Council chamber, floor 1, Ramp to committee seating	Accessible Route; 405.8 Handrails.	Handrails, missing on ramp run with rise greater than 6 inches	1	Install compliant handrail that meets all size, mounting, and extension requirements. Ensure the ramp has compliant handrails on both sides of the ramp.
	44	641	Council Chambers, floor 2, mechanical 2801, council Chambers to mechanical room	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	45	642	Restroom (Men), floor 1, men 1520, corridor to men's restroom	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	46	643	Hallway, floor 1	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	47	644	Elevator Lobby, floor G	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	48	645	Storage, floor 3, Storage 3805, Hallway to storage	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	885	Breakroom, floor G, G850, counter	Dining/Work Surface; 902.3 Height.	Height (top of surface), not between 28 and 34 inches	2	Reconstruct dining/work surface height to be within accessible range.
	50	924	Restroom (Unisex), floor 3, Unisex Shower, Locker Room	Dressing Room; 903.2 Clear Floor or Ground Space.	Bench - Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	3	Relocate the bench to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant bench and clear floor space.
	51	998	Hallway, floor 5	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	52	999	Hallway, floor 3	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	53	1000	Hallway, Near Chamber, floor 2	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	54	1001	Hallway, Near Chamber, floor 2	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	1002	Hallway, floor 2	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	56	1003	Hallway, Near City Clerk office, floor 1	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	57	1004	Hallway, floor G	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	58	1005	Hallway, floor 3, Next to 3801	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	59	1037	Hallway, floor 4	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	60	1409	Storage, Attic, floor 5, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	61	1410	Kitchen, 4807, Soap and paper towels	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	62	1411	Kitchen, 4807, Phone	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	63	1412	Breakroom, floor 4, Paper Towel Dispenser	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	64	1413	Office, floor 4, 4200, counter	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	65	1414	Hallway, floor 5, 4250, Phone	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	66	1415	Nursing/Mother's Room, floor 3, 3461, Paper Towel Dispenser	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	67	1416	Nursing/Mother's Room, floor 3, 3461, Coat Hook	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	68	1417	Office, floor 3, 3301, Shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	69	1418	Conference Room, floor 2, Aldermanic Library 2750, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	70	1419	Conference Room, floor 2, 2403, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	71	1420	Hallway, floor 2, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	72	1421	Hallway, in front of room 2250, floor 2, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	73	1422	Office, floor 2, 2000 IT, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	74	1423	Stairwell, floor 2, Vending machine	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	75	1424	Office, floor 1, 1700 HR, shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	76	1425	Office, floor 1, 1600 General and Emergency Assistance, wall mounted cabinets	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	77	1426	Hallway, Near room 1700, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	78	1427	Computer Room, floor 1, 1611, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	79	1428	Hallway, floor 1, corridor left of 1501, safety suggestion box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	80	1429	Office, floor 1, 1000 Mail Room, shelf	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	81	1430	Hallway, floor 1, hallway in front of 1105, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	82	1431	Lobby, floor 1, Art	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	83	1432	Hallway, Parks and recreation, floor 1, employee time card reader	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	84	1433	Stairwell, floor G, stairwell North side, fire hose cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	85	1434	Hallway, floor G, G312, Sink and Paper Towel Dispenser	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	86	1435	Hallway, floor G, Flyer holder	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	87	1436	Conference Room, floor G, G300, Speakers	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	88	1437	Breakroom, floor G, Fire hose cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	89	1438	Breakroom, floor G, Vending machine	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	90	1439	Breakroom, floor G, fire control cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	91	1440	Hallway, floor G, left of G600, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	92	1441	Lobby, Elevator lobby, floor G, Elevator Lobby, fire hose cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	93	1442	Restroom (Unisex), floor G703, hand drier	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	94	1443	Restroom (Unisex), floor G703, baby changing table	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	95	1444	Breakroom, floor G, G850, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	96	1445	Gym, floor G, G802, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	97	1446	Workshop, floor G, G900, exhaust Hood	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	98	1447	floor G, G900, fire control cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	99	1448	Hallway, floor 4, Next to Law Office 4400, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	100	1449	Hallway, floor 4, Next to Law Office 4400, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	101	1450	Stairwell, floor 4, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	102	1451	Office, 4000 former AP office, floor 4, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	103	1452	Office, floor 3, 3000, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	104	1453	Office, floor 3, 3000, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	105	1454	Office, floor 3, 3000, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	106	1455	Hallway, floor 3, Next to 3201, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	107	1456	Council chamber, floor 2, Door over ramp to mechanical, Wall. Door is too low	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	108	1457	Hallway, floor 2, Administrative adjudication assistant, Counter	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	109	1458	Hallway, floor 2, Next to room 2651, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	110	1459	floor 2, Next to 2401, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	111	1460	Stairwell, floor 2, Building Structure, Stairs are too low	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	112	1461	Office, floor 2, Coat hooks	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	113	1462	Stairwell, floor 2, fire hose cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	114	1463	Hallway, floor 1, Nearby stairwell, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	115	1464	Office, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	116	1465	Hallway, floor G, Next to G204, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	117	1466	Office, floor G, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	118	1467	Hallway, floor G, Hallway next to accessible entrance, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	119	1468	Office, floor G, G900, First Aid kit	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	120	1469	Entrance, floor G, G906, fire hose cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	121	1470	Entrance, floor G, G906, Fire Pull	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	122	1589	Exterior	Parking Space (Standard Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.
	123	1614	Exterior, Accessible Van Parking spaces	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	124	1628	Storage, Attic, floor 5	Platform Lift; 410.6 Doors and Gates.	Door/Gates - Opening Time, less than 20 seconds	1	Replace with compliant platform lift.
	125	1974	Restroom (Men), floor 5	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.
	126	1975	Restroom (Men), floor 4, 4801	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Rear Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	127	1976	Restroom (Women), floor 4	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	128	1977	Restroom (Women), floor 4	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	129	1978	Restroom (Women), floor 4	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	130	1979	Restroom (Women), floor 4	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	131	1980	Hallway, floor 3, Restroom (Women)	Restroom (Multiple User); 404.2.8.1 Door Closers and Gate Closer.	Wheelchair Accessible Compartment - Door does not self-close.	1	Remove or adjust closer on the door to reduce the closing speed to be within allowable range. The range varies depending if the door has a spring hinge.
	132	1981	Hallway, floor 3, Restroom (Women)	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	133	1982	Hallway, floor 3, Restroom (Women)	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	134	1983	Restroom (Men), floor 3	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.
	135	1984	Restroom (Men), floor 3	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	136	1985	Restroom (Men), floor 3	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	137	1986	Council chamber, floor 2, 2712 and 2711, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	138	1987	Council chamber, floor 2, 2712 and 2711, Restroom (Men + Women)	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	139	1988	Council chamber, floor 2, 2712 and 2711, Restroom (Men + Women)	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	140	1989	Council chamber, floor 2, 2712	Restroom (Multiple User); 604.8.1.1 Size.	Wheelchair Accessible Compartment - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet compartment to provide a minimum width of 60 inches.
	141	1990	Council chamber, floor 2, 2712	Restroom (Multiple User); 404.2.4 Maneuvering Clearances, figure i.	Entrance Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	142	1991	Hallway, floor 1, 1520, Men	Restroom (Multiple User); 604.8.1.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	143	1992	Restroom (Women), floor 1, women 1119	Restroom (Multiple User); 604.8.1.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	144	1993	Restroom (Women), floor G, women G104	Restroom (Multiple User); 604.8.1.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	145	1994	floor 4, Women	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Sink - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate sink bottom edge to be at exactly 27 inches high or add cane detection to sink.
	146	1995	Restroom (Women), floor 4	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	147	1996	Restroom (Women), floor 3	Restroom (Multiple User); 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	148	1997	Restroom (Women), floor 3	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Miscellaneous Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate dispenser to a location that provides cane detection or to be at a maximum height of 27 inches.
	149	1998	Restroom (Women), floor 3	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	150	2044	Restroom (Women), floor 3	Restroom (Multiple User); 606.3 Height.	Common Area - Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink and install no higher than 34 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	151	2290	Hallway, floor G, Employees/Staff only	Restroom (Single User); 604.3.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	152	2291	Restroom (Unisex), floor G, G703	Restroom (Single User); 604.2 Location.	Seat - Centerline Location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	153	2292	Restroom (Unisex), floor G, G703	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar - Length, less than 36 inches	1	Replace with compliant grab bar(s) that are a minimum of 36 inches in length.
	154	2293	Restroom (Unisex), floor G, G703	Restroom (Single User); 4.16.2 Clear Floor Space.(TAS,1994)	Seat (old building)-Clear Floor Space, less than 36 inches (Width) and/or 66 inches (Depth)	1	Replace water closet or relocate to a compliant location.
	155	2294	Office, floor G, G311 G318, Restroom (Unknown)	Restroom (Single User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	156	2295	Lobby, floor G, G783, Gender Neutral	Restroom (Single User); 604.7 Dispensers.	Toilet Paper Dispenser - Location, behind grab bars	3	Replace toilet paper dispenser or relocate to a compliant location not behind grab bars.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	157	2296	Lobby, floor G, Gender Neutral	Restroom (Single User); 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	158	2382	Office, Permitting room, floor 3, 3510	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	159	2383	Office, floor 2, 2700 Administrative Adjudication	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	160	2384	Office, floor 2, 2000	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	161	2385	Office, floor 4, Purchasing 4200	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	162	2386	Office, floor 1, 1600	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	163	2387	Office, floor 1, 1200 city clerk	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	164	2388	Office, floor 1, Mail room	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	165	2395	Office, Permitting room, floor 3, 3510	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	166	2396	Office, floor 2, 2700 Administrative Adjudication	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	167	2397	Office, floor 2, 2000	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	168	2398	Office, floor 4, Purchasing 4200	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	169	2399	Office, floor 1, 1600	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	170	2400	Office, floor 1, 1200 city clerk	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	171	2401	Office, floor 1, Mail room	Sales,Service Counters; 904.4.1 Parallel Approach.	Counter - Parallel Approach - Height, greater than 36 inches	2	Reconstruct a portion of the counter top that is 36 inches tall.
	172	2417	Shower Room, floor 3, Unisex Shower	Shower Compartment; 608.7 Thresholds.	Threshold - Height, greater than 1/2 inch	3	Reconstruct threshold to be less than 1/2 inch.
	173	2508	Breakroom, floor 4, break room inside City Manager's office	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	174	2509	Nursing/Mother's Room, floor 3, 3461	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	175	2510	Nursing/Mother's Room, floor 3, 3461	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	176	2511	Restroom (Unisex), floor G, G312, outside of restroom	Sink; 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	177	2512	Restroom (Unisex), floor G, G703	Sink; 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	1	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	178	2513	Breakroom, floor G, G850	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	179	2514	Breakroom, floor G, G900	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	180	2515	Breakroom, floor 4, Kitchen 4807	Sink; 306.3.1 General.	Sink - Clear Floor Space - Knee Clearance (Forward Approach) - Height, less than 27 inches	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	181	2545	Storage, Attic, floor 5, stairway on south side	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	182	2546	Storage, Attic, floor 5, stairway on south side	Stairways; 504.2 Treads and Risers.	Risers - Height, not uniform and/or not between 4 and 7 inches	5	Reconstruct stairs.
	183	2547	Stairwell, floor 4, stairs next to elevators	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	184	2548	Stairwell, floor 4	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	185	2549	Stairwell, floor 4, stairwell by office 4000	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	186	2550	Stairwell, floor 4, stairwell Southwest corner of building	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	187	2551	Lobby, floor 2, in front of elevators	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	188	2552	Lobby, floor 2, stair lobby on second floor	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	189	2553	Exterior	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	190	2578	Shower room, floor 3, Rod	Storage; 811.4 Operable Parts.	Operable Parts - Operation - (5% of total or one of each type), not operable with one hand and grasping, pinching, or twisting required.	3	Replace storage element with operable parts that are compliant with operation requirements and located within a compliant reach range.
	191	2581	Breakroom, floor 4, Kitchen 4807, Phone next to the window	Telephone; 217 Telephones	TTY, missing (when at least one public phone is provided)	3	Remove public telephone/s, or add TTY/'s.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	714	Entrance, floor 1, Entrance at the lot, From public right of way to the parking lot	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	2	1591	Parking Garage (with roof), floor 1	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	3	1622	Parking Garage (with roof), floor 1	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	42	Restroom (Women), Outside	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	2	43	Restroom (Men), Outside	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	3	44	Restroom (Women), Outside	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	4	46	Office, floor 1, Office	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	5	47	Restroom (Men), Outside	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	6	55	Entrance, floor 1, Lobby	Accessible Route; 404.2.4 Maneuvering Clearances, figure f.	Door - Maneuvering clearance - Hinge Approach - Push side, perpendicular to doorway, less than 42 inches and/or parallel to doorway, less than 22 inches beyond hinge side. (Case F)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	56	Entrance, floor 1, Lobby	Accessible Route; 404.2.6 Doors in Series and Gates in Series.	Door - Distance between two hinged/pivoted doors/gates in series, less than 48 inches is provided	1	If possible, adjust the swing on at least one door or remove one door to make a cased opening. If not possible, relocate one or both doors to ensure at least 48 inches is provided between door swings when both are in the open position.
	8	928	Classroom, floor 1	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	9	1766	Exterior, floor 1, Restroom (Women)	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	10	1767	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	11	1768	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	12	1769	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1770	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 307 Protruding Objects.	Baby changing table - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	14	1772	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door - Distance between door opening and adjoining wall, less than 4 inches	1	Relocate the door to be a minimum of 4 inches from the adjacent wall or reconstruct the toilet compartment.
	15	1779	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	16	1780	Restroom (Women), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	17	1781	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	18	1782	Exterior, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Common Area - Coat Hook - Height, greater than 48 inches	2	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	11	Exterior	Accessible Route; 406.2 Counter Slope.	Curb Ramp - Adjacent Surfaces at transitions at curb ramps, not at the same level	1	Provide a flush transition at the curb ramp.
	2	376	Play Area, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	3	377	Exterior	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	4	378	Exterior	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	5	457	Exterior, Tennis Court, Outside, To the bleachers	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	466	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	467	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	8	468	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	9	469	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	10	470	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	11	474	Exterior, Soccer Field, Sidewalk to bleacher.	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	12	475	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	476	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.
	14	477	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	15	478	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	16	775	Exterior, Bleacher, Tennis Court	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	17	776	Exterior	Assembly Area; 802.1.1 Floor or Ground Surface.	Wheelchair Space - Clear Floor Space - Changes in level, not permitted within the clear floor space dimension	2	Reconstruct the walking surface of the clear floor space to ensure there is no change in level other than the allowable maximum slope of 2%. If necessary, reconstruct adjacent walking surface to compensate for the existing change in level.
	18	866	Outside, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches	2	Reconstruct or relocate dining/work surface to provide a compliant forward approach with knee and toe clearance.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1124	Exterior Patio, Outside, Picnic tables	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	20	1597	Parking Lot, Outside	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.
	21	1630	Play Area, Outside, size: medium	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.
	22	1631	Play Area, Outside, size: medium	Play Area; 1008.2.5.1 Ground Level.	Play Component - Connection (Ground) - Ramp - Running Slope - Width, steeper than 6.25% (1:16)	3	Provide compliant connection.
	23	1637	Play Area, Outside, size: small	Play Area; 1008.3.1.3 Transfer Space.	Transfer Platform - Transfer space - Width (centered and parallel to the 24 inches side), less than 48 inches	3	Replace with compliant transfer platform.
	24	1638	Play Area, Outside, size: small	Play Area; 1008.4.5 Transfer Support.	Entry Point/Seat - Means of support, missing	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1639	Play Area, Outside, size: small	Play Area; 1008.4.5 Transfer Support.	Entry Point/Seat - Means of support, missing	3	Replace with a compliant entry point/seat.
	26	1640	Play Area, Outside, size: small	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Type of surface, not to standards	3	Replace with compliant ground surface.
	27	1641	Play Area, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	608	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	609	Exterior	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	3	610	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	75	Parking Garage (with roof), floor 5	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	2	76	Parking Garage (with roof), floor 4	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	3	93	Office, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	4	94	Office, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	5	95	Parking Garage (with roof), floor 6th tier	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	6	96	Parking Garage (with roof), floor 6th tier to ground floor all floors all corners, Stairs entrance door	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	97	floor 5th tier, SE corner 5th tier to stairs	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	8	98	Parking Garage (with roof), floor 4th tier	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	9	99	Parking Garage (with roof), floor 3rd to 1st floor (all the doors on this corner) , Garage to stairs and elevators, Garage to stairs and elevators	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	10	863	Parking Garage (with roof), floor 1	Accessible Route; 406 Curb Ramps.	Curb Ramp - Running Slope, steeper than 8.33% (1:12)	1	Reconstruct the curb ramp to have a running slope no greater than 8.33%.
	11	864	Parking Garage (with roof), floor 1	Accessible Route; 406 Curb Ramps.	Curb Ramp - Running Slope, steeper than 8.33% (1:12)	1	Reconstruct the curb ramp to have a running slope no greater than 8.33%.
	12	1166	Parking Garage (with roof), floor 6th tier, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1167	Parking Garage (with roof), floor 6th tier , Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	14	1168	Parking Garage (with roof), floor 5th tier to ground , Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1169	Parking Garage (with roof), Staircase , floor All floors , Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	1556	Parking Garage (with roof), floor 6	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	17	1557	Parking Garage (with roof), floor 6	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	18	1558	Parking Garage (with roof), floor 6	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1559	Parking Garage (with roof), floor 6	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	20	1560	Parking Garage (with roof), floor 5	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	21	1561	Parking Garage (with roof), floor 5	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	22	1562	Parking Garage (with roof), floor 5	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	23	1563	Parking Garage (with roof), floor 4	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	24	1564	Parking Garage (with roof), floor 4	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1565	Parking Garage (with roof), floor 4	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	26	1566	Parking Garage (with roof), floor 4	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	27	1567	Parking Garage (with roof), floor 3	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	28	1568	Parking Garage (with roof), floor 3	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	29	1569	Parking Garage (with roof), floor 3	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	30	1570	Parking Garage (with roof), floor 2	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1571	Parking Garage (with roof), floor 2	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	32	1572	Parking Garage (with roof), floor 2	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	33	1573	Parking Garage (with roof), floor 1	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	34	1574	Parking Garage (with roof), floor 1	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	35	2191	Office, floor 1, Restroom (Unisex)	Restroom (Single User); 604.3.1 Size.	Room - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet room to provide a minimum width of 60 inches.
	36	2192	Office, floor 1, Restroom (Unisex)	Restroom (Single User); 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	2193	Office, floor 1, Restroom (Unisex)	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	38	2529	Parking Garage (with roof), floor 6	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	285	Tennis Court, Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	791	Exterior, Baseball Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility. In this case, it could be considered to open a gate into dogout.
	3	792	Exterior, Baseball Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility. In this case, it could be considered to open a gate into dogout..
	4	847	Exterior, Tennis Court, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces. In this case, it could be considered to relocate the receptacle.
	5	848	Exterior, Baseball Field	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	6	1473	Church St and Florence Ave Corner , Outside, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1474	Church St and Florence Ave Corner , Outside, Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	1717	Play Area, Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.
	9	1718	Play Area, Outside , size: medium	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	10	1719	Play Area, Outside , size: medium	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	1	229	Restroom (Women), floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	2	230	Restroom (Men), floor 1	Accessible Route; 404.2.5 Thresholds.	Door - New Threshold height, greater than 1/2 inch	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.
	3	995	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	4	996	Exterior	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	5	997	Room, floor 1	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	6	1068	Kitchen, floor 1	Kitchen/Kitchenettes; 804.3.2 Height.	Work Surface - Height, more than 34 inches	4	Reconstruct work surface height to be 34 inches maximum. Ensure a compliant forward approach with knee and toe clearance is maintained.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1069	Kitchen, floor 1	Kitchen/Kitchenettes; 306.3.1 General.	Sink - Clear Floor Space - Knee Clearance (Forward Approach) - Height, less than 27 inches	4	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	8	1070	Kitchen, floor 1	Kitchen/Kitchenettes; 606.3 Height.	Sink - Rim Height, greater than 34 inches	4	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	9	1071	Kitchen, floor 1	Kitchen/Kitchenettes; 811.3 Height.	Storage - Operable Parts, not within permitted reach range	4	Relocate operable parts to be within compliant range between 15 to 46 inches.
	10	1072	Kitchen, floor 1	Kitchen/Kitchenettes; 804.6.1 Clear Floor or Ground Space.	Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	4	Reconstruct the clear floor space to ensure a compliant forward approach is provided, meeting all dimensional requirements for knee clearance and toe clearance. If necessary, relocate appliance within the kitchen.
	11	1404	Exterior, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	12	1405	Room, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1406	Room, floor 1, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	14	1407	Room, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	15	1408	Room, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	16	2279	Restroom (Women), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	17	2280	Restroom (Women), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Distance from the rear wall , less than 12 inches	1	Relocate the grab bar(s) to be a maximum of 12 inches from the rear wall.
	18	2281	Restroom (Women), floor 1	Restroom (Single User); 307 Protruding Objects.	Miscellaneous Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate dispenser to a location that provides cane detection or to be at a maximum height of 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	2282	Restroom (Women), floor 1	Restroom (Single User); 307 Protruding Objects.	Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	20	2283	Restroom (Women), floor 1	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	21	2284	Restroom (Women), floor 1	Restroom (Single User); 306.3 Knee Clearance	Baby changing table - Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	22	2285	Restroom (Men), floor 1	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	23	2286	Restroom (Men), floor 1	Restroom (Single User); 307 Protruding Objects.	Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	24	2287	Restroom (Men), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar - Distance from the rear wall , less than 12 inches	1	Relocate the grab bar(s) to be a maximum of 12 inches from the rear wall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	2288	Restroom (Men), floor 1	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	26	2289	Restroom (Men), floor 1	Restroom (Single User); 306.3 Knee Clearance	Baby changing table - Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	27	2461	Restroom (Women), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	28	2462	Restroom (Men), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	472	Exterior, floor Oit, ROW to community garden	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	1030	Exterior	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	2	1734	Play Area, Outside , size: large	Play Area; 1008.4.5 Tranfer Support.	Entry Point/Seat - Means of support, missing	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	204	Play Area, floor 1	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	599	Play Area, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	3	1705	Play Area, Outside , size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	605	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	606	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	842	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	4	843	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	5	986	Exterior	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	6	2541	Exterior	Stairways; 206.2.2 Within a Site	Accessible Route, missing	5	Construct an accessible route that connect the stairways to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	2542	Exterior	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	8	2543	Exterior	Stairways; 504.4 .Tread Surface.	Tread Surface - Overall condition, not stable, firm, and slip resistant	5	Reconstruct stairs.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	584	Entrance, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	2	829	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	3	1381	Entrance, Outside , Vegetation	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	4	1691	Play Area, Outside, size: small	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.
	5	1692	Play Area, Outside , size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	744	Exterior, Public sidewalk to brick sidewalk	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	2	837	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	59	B Building, floor 1, Warehouse	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	2	60	B building near freight elevator, floor 1	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	3	61	B building near freight elevator, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.
	4	62	Employee back entrance, B building, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	5	66	Conference Room, floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	6	67	Office, B Building, floor 2, Greenways supervisor	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	68	Office, C building, parking enforcement, floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	8	72	Office, C building, parking manager, floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	9	73	Machinery Space, A building, floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	10	78	All through the Building , floor 1, Restroom Men+Women	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	11	79	Hallway, floor 2, C building to parking	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	12	80	Hallway, floor 2, C building to parking	Accessible Route; 404.2.4 Maneuvering Clearances, figure c.	Door - Maneuvering Clearance - Front Approach - Push side - if closer and latch are provided, perpendicular to doorway, less than 48 inches and/or parallel to doorway, less than 12 inches. (Case C)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the closer, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	81	floor 1, Main Entrance	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on door. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	14	82	floor 1, Main Entrance	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	15	83	Entrance, B building double doors by Main entrance , floor 1, Main Entrance	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	16	84	Entrance, B building double doors by Main entrance , floor 1, Main Entrance	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	17	85	Entrance, B building double doors by Main entrance , floor 1, Main Entrance	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	18	86	Classroom, B building , floor 2	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	87	Conference Room, floor 2, Conference room	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	20	88	Area of refuge , floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	21	89	Building C , floor 2	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	22	90	Office, Building C , floor 2	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	23	91	Building A main entrance door , floor 1, Main entrance	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	24	92	Building A , floor 1, Car service garage	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	379	Entrance, Main entrance , floor 1	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	26	402	Exterior	Accessible Route; 405.8 Handrails.	Handrails, missing on ramp run with rise greater than 6 inches	1	Install compliant handrail that meets all size, mounting, and extension requirements. Ensure the ramp has compliant handrails on both sides of the ramp.
	27	483	Entrance, Outside	Accessible Route; 402.2 Components.	Walking Surface - Steps, not permitted	1	Remove the step and construct one ramp run with level landings at the top and bottom of the ramp. No handrails required if the vertical change is 6 inches or less.
	28	485	Lobby, floor 1, Fire exit	Accessible Route; 402.2 Components.	Walking Surface - Steps, not permitted	1	Remove the step and construct one ramp run with level landings at the top and bottom of the ramp. No handrails required if the vertical change is 6 inches or less.
	29	486	Entrance, floor 1, B building back entrance	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, greater than 6 inches	1	Add a ramp with handrails on both sides and landings at the top and bottom of the ramp.
	30	487	Entrance, floor 1, B building back entrance	Accessible Route; 402.2 Components.	Walking Surface - Steps, not permitted	1	Determine the best location to install an elevator in order to provide an accessible route.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	488	Exterior, To the bike racks	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	32	895	Locker Room, B building men's, floor 2	Dressing Room; 803.4 Benches.	Dressing Room - Bench, missing	3	Provide a compliant bench.
	33	896	Locker Room, B building women's, floor 2	Dressing Room; 803.4 Benches.	Dressing Room - Bench, missing	3	Provide a compliant bench.
	34	937	Hallway, Building A, floor 1	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	35	938	B building hallway by the entrance, floor 1	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits, greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	36	939	B building after the double doors, floor 1	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits, greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	940	Hallway, B building , floor 2	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	38	1036	Hallway, by the restrooms	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	39	1059	Office, C building, parking manager, floor 2	Kitchen/Kitchenettes; 804.2.1 Pass Through Kitchen.	Pass Through Kitchen - Work area - Width, less than 40 inches	1	Reconstruct or remove cabinetry to provide 40 inches clear between elements.
	40	1132	Lobby, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	41	1135	Breakroom, B building , floor 2, Ice machine	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	42	1137	Breakroom, B building, floor 2, Ice machine	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	1139	Classroom, B building, floor 2, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	44	1140	Classroom, B building, floor 2, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	45	1141	Classroom, B building, floor 2, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	46	1142	Hallway, B building, floor 2, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	47	1149	Conference Room, floor 2, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	48	1150	Breakroom, floor 2, Telephone	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	1151	Conference Room, floor 2, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	50	1152	Office, Parking enforcement , floor 2, Thermostat	Miscellaneous Element; 308 Reach Ranges.	Operable Parts/Location, not within permitted reach range	3	Relocate element or provide the operable part within reach range of 15 to 46 inches.
	51	1153	Main entrance , Outside, Entry system keypad	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	52	1154	Hallway, B building 2nd floor , floor 2, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	53	1155	Breakroom, Cafeteria , floor 2, Vending machine	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.
	54	1156	Breakroom, Kitchen - B building second floor , floor 2, Dispenser	Miscellaneous Element; 308 Reach Ranges.	Operable Parts , not operable with one hand and grasping, pinching, or twisting required.	3	Replace with compliant operable part that does not require grasping, pinching, or twisting and operable with a closed fist.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	1157	Conference Room, floor 2, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	56	1158	Parking Lot, Building D , floor 2, Building Structure	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	57	1159	Hallway, Building A Main entrance , floor 1, Cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	58	1160	Hallway, Building A main entrance hallway , floor 1, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	59	1161	Office, Building A Supervisor office , floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	60	1162	Hallway, Building A, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	61	1163	Hallway, Building A, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	62	1164	Hallway, Building A, floor 1, Pull-out desk	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	63	1165	Office, floor 1, Utility Box	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	64	1590	Parking Lot, floor 2	Parking Space (Standard Accessible Marked); 502.6 Identification.	Identification Sign - Height, less than 60 inches	1	Relocate sign to compliant height of 60 inches to the bottom of the sign.
	65	1600	Parking Lot, Building D, floor 2	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	66	1787	B building, floor 1, Restroom (Men)	Restroom (Multiple User); 404.2.4 Maneuvering Clearances	Wheelchair Accessible Compartment - Door - Maneuvering Clearance, not provided	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	67	1788	B building, floor 1, Restroom (Men)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	68	1789	B building, floor 1, Restroom (Men)	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	69	1790	B building, floor 1, Restroom (Men)	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Paper Towel Dispenser - Operable Parts, not within permitted reach range	3	Relocate paper towel dispenser to be between 15 and 46 inches and ensuring that it is not a protruding object.
	70	1791	Locker Room, B building, floor 2, Restroom (Women)	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	71	1792	Locker Room, B building, floor 2, Restroom (Women)	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	72	1794	Locker Room, B building, floor 2, Restroom (Men)	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	73	1795	Locker Room, B building, floor 2, Restroom (Men)	Restroom (Multiple User); Advisory 606.1 General.	Common Area - Soap Dispenser - Operable Parts, not within permitted reach range	3	Relocate soap dispenser to be no higher than 46 inches.
	74	1797	B building, floor 2	Restroom (Multiple User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	75	1826	Restroom (Women), floor 2	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height, greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	76	1827	Restroom (Men), floor 2	Restroom (Multiple User); 604.5.1 Side Wall.	Ambulatory Accessible Compartment - Side Grab Bar, missing	1	Install missing side grab bar(s).
	77	1828	Restroom (Men), floor 2	Restroom (Multiple User); 404.2.4 Maneuvering Clearances	Ambulatory Accessible Compartment - Door - Maneuvering Clearance, not provided	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	78	1829	Restroom (Men), floor 2	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	79	1830	Restroom (Women), B Building , floor 2	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	80	1831	Restroom (Women), B Building , floor 2	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	81	1832	Restroom (Women), B Building , floor 2	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Miscellaneous Dispenser - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate dispenser to a location that provides cane detection or to be at a maximum height of 27 inches.
	82	2043	Restroom (Women), floor 2	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Sink - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate sink bottom edge to be at exactly 27 inches high or add cane detection to sink.
	83	2171	B building, floor 1, Restroom (Women)	Restroom (Single User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	84	2172	B building, floor 2, Restroom (Women)	Restroom (Single User); 604.2 Location.	Seat - Centerline Location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	85	2173	B building, floor 2, Restroom (Women)	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar, missing	1	Install missing rear grab bar.
	86	2174	B building, floor 2, Restroom (Women)	Restroom (Single User); 609.3 Spacing.	Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	87	2175	B building, floor 2, Restroom (Women)	Restroom (Single User); 603.4 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	88	2176	Hallway, B building near offices, floor 2, Restroom (Men + Women)	Restroom (Single User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	89	2178	Hallway, A building, floor 1, Restroom (Men)	Restroom (Single User); 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches.	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a cased opening, or relocate the door.
	90	2179	Hallway, A building, floor 1, Restroom (Men)	Restroom (Single User); 604.3.1 Size.	Room - Width (Perpendicular to side wall), less than 60 inches	1	Reconstruct toilet room to provide a minimum width of 60 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	91	2180	Hallway, A building, floor 1, Restroom (Men)	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar, missing	1	Install missing side grab bar(s).
	92	2181	Hallway, A building, floor 1, Restroom (Men)	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar, missing	1	Install missing rear grab bar.
	93	2182	Hallway, A building, floor 1, Restroom (Men)	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	94	2183	Hallway, A building, floor 1, Restroom (Men)	Restroom (Single User); 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	95	2184	Hallway, A building, floor 1, Restroom (Men)	Restroom (Single User); 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	96	2185	Hallway, A building, floor 1, Restroom (Unisex)	Restroom (Single User); 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	97	2186	Hallway, A building, floor 1, Restroom (Unisex)	Restroom (Single User); 603.2.1 Turning Space.	Clearance - Turning Space , missing	1	Reconfigure the restroom to provide compliant turning space.
	98	2187	Hallway, A building, floor 1, Restroom (Unisex)	Restroom (Single User); 604.5.1 Side Wall.	Rear Grab Bar, missing	1	Install missing rear grab bar.
	99	2188	Hallway, A building, floor 1, Restroom (Unisex)	Restroom (Single User); 604.5.1 Side Wall.	Side Grab Bar, missing	1	Install missing side grab bar(s).
	100	2189	Hallway, A building, floor 1, Restroom (Unisex)	Restroom (Single User); 603.3 Mirrors.	Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	101	2190	Hallway, A building, floor 1, Restroom (Unisex)	Restroom (Single User); 606.5 Exposed Pipes and Surfaces.	Sink - Water Supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	102	2195	Office, C building parking enforcement , floor 2, Restroom (Unisex)	Restroom (Single User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	103	2196	Office, C building parking enforcement, floor 2, Restroom (Unisex)	Restroom (Single User); 603.2.1 Turning Space.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.
	104	2421	Locker Room, B building, floor 2	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Entry - Clear Size, less than 36 by 48 inches (12 inches beyond the seat wall not provided)	3	Remove impediments or reconstruct shower to accommodate adjacent clear floor space.
	105	2422	Locker Room, B building, floor 2	Shower Compartment; 608.2.1 Transfer Type Shower Compartments.	Entry - Clear Size, less than 36 by 48 inches (12 inches beyond the seat wall not provided)	3	Remove impediments or reconstruct shower to accommodate adjacent clear floor space.
	106	2441	Exterior	Sign ; 216.6 Entrances.	Directional Sign to nearest accessible entrance, missing	2	Install compliant directional sign to identify location of nearest accessible entrance.
	107	2442	Restroom (Men + Women), Entrance, B building bathrooms by the main entrance, floor 1	Sign ; 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	108	2443	B building, throughout the facility, floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.

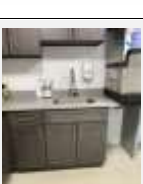
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	109	2444	Conference Room, B building, throughout the facility , floor 2	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	110	2445	Restroom (Men + Women), floor 2	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	111	2446	Conference Room, floor 2	Sign ; 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	112	2447	Restroom (Men + Women), floor 2	Sign ; 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	113	2448	Warehouse , floor 2	Sign ; 703.4.2 Location.	Sign (Single leaf door)-Location, not located at the latch side wall or adjacent wall if latch wall is not possible.	2	Relocate sign to compliant location.
	114	2476	Breakroom, floor 2	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	115	2477	Office, Building A office breakroom, floor 1	Sink; 606.3 Height.	Sink - Rim Height, greater than 34 inches	3	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	116	2478	Locker Room, floor 2	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	117	2523	B building, floor 1	Stairways; 505.2 Where Required.	Handrails - Extension on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	118	2524	B building, floor 1	Stairways; 505.2 Where Required.	Handrails - Extension on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	119	2525	Entrance, B building, floor 1	Stairways; 505.2 Where Required.	Handrails - Extension on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	120	2526	Entrance, B building, floor 1	Stairways; 505.2 Where Required.	Handrails - Extension on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	121	2527	B building, floor 1	Stairways; 505.2 Where Required.	Handrails - Extension on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	122	2528	D building, floor 1	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	123	2573	Entrance, floor 1	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	74	Stage, floor 1, from green room to stage	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	2	77	Lobby, floor 1, lobby to storage	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	3	113	Room, floor 1, 103, Hallway to 103	Accessible Route; 404.2.4 Maneuvering Clearances, figure b.	Door - Maneuvering Clearance - Front Approach - Push side, perpendicular to doorway, less than 48 inches. (Case B)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	4	114	Hallway, floor 1, Janitor Closet	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	5	115	Classroom, 106, floor 1, 106, Classroom to closet	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	6	116	Hallway, floor 1, 109, Hallway to 109	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	117	Classroom, floor 1, 107, Hallway to 107	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	8	118	Hallway, All 2nd floor doors in hallways and rooms, floor 2, All doors	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	9	119	Restroom (Women), W 2nd, floor 2, Women's room 2nd	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	10	132	Theater, floor 1, 102, Hall to 102	Accessible Route; 404.2.4 Maneuvering Clearances, figure j.	Door - Maneuvering Clearance - Latch Approach - Push side, perpendicular to doorway, less than 42 inches and/or parallel to doorway, less than 24 inches. (Case J)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	11	133	Classroom, floor 1, 103, 103 to exit	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	12	134	Classroom, floor 1, 105	Accessible Route; 404.2.5 Thresholds.	Door - Old Threshold height, greater than 3/4 inch or no beveled edge on each side with slope steeper than 50% (1:2)	1	Reconstruct the approach to the door to ensure there is no change in level greater than 1/2 inch including the threshold.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	135	Storage, floor 1, Inside 105	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	14	136	Classroom, floor 1, 106	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a casied opening with a minimum clear width of 32 inches.
	15	137	Storage, floor 1, In 108	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	16	138	Classroom, floor 1, 108	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the push side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the push side.
	17	139	Classroom, floor 1, 215	Accessible Route; 404.2.4 Maneuvering Clearances, figure a.	Door - Maneuvering Clearance - Front Approach - Pull side, perpendicular to doorway, less than 60 inches and/or parallel to doorway, less than 18 inches. (Case A)	1	Provide a compliant maneuvering clearance. If possible, adjust the door swing, remove the door to make a casied opening, or relocate the door.
	18	140	Hallway, floor 2, 2nd Floor Typ	Accessible Route; 404.2.11 Vision Lights.	Door -Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	141	Storage, floor 2	Accessible Route; 404.2.3 Clear Width.	Door - Opening clear width, less than 32 inches	1	Reconstruct door opening to have clear width of 32 inches or more when the door is open 90 degrees. Replace door with a compliant size door. If possible, remove door to make a cased opening with a minimum clear width of 32 inches.
	20	515	Exterior, PROW to Main Entrance	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	21	516	Exterior, Walkway to accessible entry on the back	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	22	936	Lobby, floor 1	Drinking Fountain; 307 Protruding Objects.	Low Fountain, Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Install an apron on drinking fountain to serve as cane detection.
	23	1060	Kitchen, floor 1, kitchen next to stage	Kitchen/Kitchenettes; 606.3 Height.	Sink - Rim Height, greater than 34 inches	4	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	24	1145	Gym, floor 1, Fire Pull	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	25	1146	Lobby, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	26	1147	Theater, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	27	1148	Restroom (Men), floor 1, Dispenser, paper towel dispenser and hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	28	1250	Hallway, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	29	1251	Classroom, floor 1, 103, Tend rods	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	30	1252	floor 1, Art, Paintings	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	31	1253	Hallway, 2nd Fl Corridor, floor 2, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	32	1254	Hallway, Near rm 221, floor 2, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	33	1255	Restroom (Women), floor 2, Baby changing table, paper towel dispenser, hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	34	1256	Restroom (Men), 2nd Floor, floor 2, Baby changing table, paper towel dispenser, hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	35	1257	Restroom (Women), floor 1, Women room 1st fl, Baby changing table, paper towel dispenser, hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	36	1258	Restroom (Men), floor 1, Baby changing table, paper towel dispenser, hand dryer	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	37	1273	Hallway, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	38	1274	Hallway, floor 1, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	39	1275	Stairwell, floor 1, Digital display	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	40	1276	Hallway, floor 1, Drinking fountain	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	41	1277	Hallway, floor 1, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	42	1278	Hallway, floor 2, Drinking fountain	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	43	1581	Parking Lot, Outside	Parking Space (Standard Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.
	44	1616	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.
	45	1809	Restroom (Men), floor 1	Restroom (Multiple User); 703.1 General.	Sign , not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	46	1810	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	47	1811	Restroom (Men), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Baby changing table - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	48	1812	Restroom (Men), floor 1	Restroom (Multiple User); 902.3 Height.	Baby changing table - Height (top of surface), not between 28 and 34 inches for a work surface	2	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	49	1813	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	50	1814	Restroom (Men), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	51	1815	Restroom (Men), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	52	1816	Restroom (Men), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	53	1817	Restroom (Women), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	54	1818	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Paper Towel Dispenser - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the paper towel dispenser or replace with dispenser that does not protrude more than 4 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	55	1819	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	56	1820	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Baby changing table - Protrusion Limits, greater than 4 inches, at a height between 27 and 80 inches	1	Relocate baby changing table to a location that provides a compliant forward approach clear floor space. Additionally, ensure the fixture meets all work surface and protruding object requirements.
	57	1821	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	58	1822	Restroom (Women), floor 1	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Side Grab Bar - Extension from the rear wall, less than 54 inches	1	Relocate the existing grab bar to compliant location or install new grab bar.
	59	1823	Restroom (Women), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	60	1824	Restroom (Women), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	61	1825	Restroom (Women), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	62	1857	Restroom (Women), floor 2	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	63	1858	Restroom (Women), floor 2	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	64	1859	Restroom (Men), 2nd floor men's room, floor 2	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	65	1860	Restroom (Men), floor 2, Men	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	66	1861	Restroom (Women), floor 1	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	67	1862	Restroom (Women), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	68	1863	Restroom (Men), floor 1	Restroom (Multiple User); 609.3 Spacing.	Wheelchair Accessible Compartment - Side Grab Bar - Space between grab bar and projecting object above, less than 12 inches	1	Relocate obstruction(s) located within 12 inches above the grab bar.
	69	1864	Restroom (Men), floor 1,	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	70	1871	Restroom (Women), floor 2	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	71	1872	Restroom (Women), floor 2	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	72	1873	Restroom (Women), floor 2	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door , swing into minimum required compartment area	1	Reconstruct the toilet compartment to have the door on the opposite side of the compartment.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	73	1874	Restroom (Women), floor 2	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	74	1875	Restroom (Women), floor 2	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	75	1876	Restroom (Men), floor 2	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	76	1877	Restroom (Men), floor 2	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height, greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	77	1878	Restroom (Men), floor 2	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	78	1879	Restroom (Men), floor 2	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	79	1880	Restroom (Women), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	80	1881	Restroom (Women), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height, greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	81	1882	Restroom (Women), floor 1	Restroom (Multiple User); 604.8.1.2 Doors.	Wheelchair Accessible Compartment - Door, swing into minimum required compartment area	1	Reconstruct the toilet compartment to have the door on the opposite side of the compartment.
	82	1883	Restroom (Women), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	83	1884	Restroom (Women), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	84	1885	Restroom (Men), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	85	1886	Restroom (Men), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	86	1887	Restroom (Men), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Rear Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	87	1888	Restroom (Men), floor 1	Restroom (Multiple User); 609.4 Position of Grab Bars.	Wheelchair Accessible Compartment - Side Grab Bar - Height, not between 33 and 36 inches	1	Relocate grab bar(s) to a compliant height between 33 and 36 inches.
	88	2194	Restroom (Unisex), floor 1, Restroom (Unisex)	Restroom (Single User); 603.2.1 Turning Space.	Clearance - Turning Space , missing	1	Reconfigure the restroom to provide compliant turning space.
	89	2450	Hallway, Restroom (Men + Women), floor 2	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	90	2491	Room, floor 1, Room 101	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	91	2530	Stairwell, SE Stair, floor 1	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	92	2531	Stairwell, W Stair, floor 1	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	93	2532	Exterior	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	94	2533	Stairwell, 1st to 2nd floor, floor 1	Stairways; 505.2 Where Required.	Handrails , missing on one or both sides	5	Install compliant handrails, ensuring they are provided on both sides.
	95	2534	Stairwell, floor 2	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.
	96	2535	Emergency Exit, floor 1, Theater 102	Stairways; 505.2 Where Required.	Handrails - Extention on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	97	2536	Stairwell, floor 1, East stair to exit and basement	Stairways; 505.2 Where Required.	Handrails - Extension on stairs -Length - required extension is less then 12 inches beyond the top ramp run where the ramp run slope becomes a landing	5	Replace handrails to provide compliant extensions that extend a minimum of 12" beyond the top of the stair run.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	838	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	2	980	Clark street side, Outside	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	3	981	Clark street side, Outside	Drinking Fountain; 211.2 Minimum Number.	Low fountain, missing	2	Install a compliant low drinking fountain.
	4	1384	Outside	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	607	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	1587	Parking Lot, Outside	Parking Space (Standard Accessible Marked); 208.2 Minimum Number.	Parking Space (Standard Accessible Marked), missing	1	Construct compliant standard accessible parking space on shortest accessible route.
	3	1612	Parking Lot, Outside	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.
	4	1613	Parking Lot, Outside	Parking Space (Van Accessible Marked); 502.6 Identification.	Identification Sign, missing	1	Provide an accessible parking sign mounted at 60 inches to the bottom of the sign.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	400	Play Area, Outside, Sidewalk to low play components	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	2	423	Play Area, Outside, Sidewalk to play area	Accessible Route; 405.8 Handrails.	Handrails, missing on ramp run with rise greater than 6 inches	1	Install compliant handrail that meets all size, mounting, and extension requirements. Ensure the ramp has compliant handrails on both sides of the ramp.
	3	743	Play Area, Outside, Sidewalk to play area	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	4	1039	Exterior	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	732	Exterior, floor 1, Sidewalk to planter	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	733	Exterior, Public sidewalk to park entrance	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	3	1038	Exterior, floor 1	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	491	Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	2	942	Outside	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	3	943	Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	4	1647	Play Area, Outside, size: medium	Play Area; 1008.4.2 Clear Floor or Ground Space.	Play Component - Clear Floor Space - Changes in level, not permitted	3	Bevel walking surface.
	5	1742	Play Area, Outside, size: medium	Play Area; 1008.3.1 Transfer Platforms.	Transfer Platform - Surface - Depth, less than 14 inches	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	383	Play Area, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	2	559	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	3	560	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	4	561	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	565	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	6	807	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	966	Play Area, Medium size play area, Outside	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	8	963	Exterior	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Foward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	9	1668	Play Area	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.
	10	1672	Play Area, L, Outside, size: medium	Play Area; 1008.3.1.2 Height.	Transfer Platform - Height (Top Surface), not between 11 and 18 inches	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	1	Exterior	Accessible Route; 406.4 Landings.	Curb Ramp - Landing, missing	1	Construct a curb ramp landing.
	2	558	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	803	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	4	1743	Exterior	Receptacle; 305.2 Floor or Ground Surfaces.	Clear Floor Space - Surface - Overall condition, not stable, firm, and slip resistant	3	Reconstruct the walking surface of the clear floor space to provide a ground surface material and condition that is stable, firm, and slip resistant.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	600	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	2	839	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	3	840	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	4	841	Exterior, Chicago Ave. and Lake Street	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	5	982	Chicago Ave and lake street , Outside	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	6	983	Chicago Ave and lake street , Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1706	Play Area, Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Type of surface, not to standards	3	Replace with compliant ground surface.
	8	1707	Play Area, Outside, size: medium	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.
	9	1708	Play Area, Outside, size: medium	Play Area; 1008.4.2 Clear Floor or Ground Space.	Play Component - Floor or Ground Surfaces - Surface, not stable, firm or slip resistant	3	Provide compliant walking surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	48	Machinery Space, floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	2	49	Machinery Space, floor 1	Accessible Route; 404.2.11 Vision Lights.	Door - Vision Lights-glazed panel bottom - Height, greater than 43 inches	1	Replace door.
	3	50	Office, floor 1	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	4	375	Exterior, Parking to offices	Accessible Route; 405.4 Floor or Ground Surfaces.	Ramp - Changes in level , not permitted	1	Reconstruct the ramp.
	5	929	Hallway, floor 1	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	6	1598	Parking Lot, Outside	Parking Space (Van Accessible Marked); 208.2 Minimum Number.	Parking Space (Van Accessible Marked), missing	1	Construct compliant van accessible parking space on shortest accessible route.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1773	Hallway, floor 1, Restroom (Men)	Restroom (Multiple User); 305.2 Floor or Ground Surfaces.	Common Area - Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	1	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.
	8	1774	Hallway, floor 1, Restroom (Men)	Restroom (Multiple User); 604.6 Flush Controls.	Wheelchair Accessible Compartment - Flush Control - Location, not on the open side of water closet	1	Replace water closet and ensure that control will be on the open side of the water closet.
	9	1775	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	10	1776	Hallway, floor 1, Restroom (Men)	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	11	1783	Hallway, floor 1, Restroom (Men + Women)	Restroom (Multiple User); 703.4.1 Height Above Finish Floor or Ground.	Sign - Height above finish floor, not located where the bottom of the lowest line of text is 48" minimum and/or the bottom of the highest line of text is 60" maximum above the ground.	2	Relocate sign to compliant height.
	12	2473	Breakroom, floor 1	Sink; 305.2 Floor or Ground Surfaces.	Sink - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	3	Reconstruct the millwork below the sink to provide a compliant clear floor space, ensuring forward approach requirements are met. If necessary, replace the sink with a compliant fixture.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	1650	Play Area, Outside, size: small	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

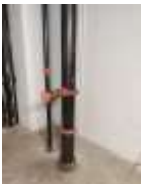
PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	102	Office, floor 3, parking level 3 to office entrance	Accessible Route; 404.2.4.4 Floor or Ground Surface.	Door - Slope - Maneuvering Clearance, greater than 2% (1:48) - on the pull side	1	Reconstruct the ground surface to provide a slope not greater than 2% in any direction for the full size of the required maneuvering clearance on the pull side.
	2	1175	Office, floor 3, Shelf and digital displays	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	3	1176	Office, floor 3, AED cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	4	1205	Stairwell, floor every floors, southeast stairwell, one per level, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	5	1206	Stairwell, floor every floors, northeast stairwell, one per level, Fire Standpipe	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	6	1207	Parking Garage (with roof), floor every floors, Between 5 and 8 per level, Fire extinguisher	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1208	Parking Garage (with roof), floor 2, charging station	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	1578	Parking Garage (with roof), floor 10	Parking Space (Standard Accessible Marked); 502.4 Floor or Ground Surfaces.	Floor or Ground Surfaces - Slope, steeper than 2% (1:48)	1	Reconstruct the ground surface to have slope less than 2% (1:48) in all directions.
 No image available	9	1586	Parking Garage (with roof), floor 1	Parking Space (Standard Accessible Marked); 208.2 Minimum Number.	Parking Space (Standard Accessible Marked), missing	1	Construct compliant standard accessible parking space on shortest accessible route.
	10	2221	Restroom (Unisex), floor 3, Toilet, Restroom (Unisex)	Restroom (Single User); 603.4 Coat Hooks and Shelves.	Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	11	2222	Restroom (Unisex), floor 3, Toilet, Restroom (Unisex)	Restroom (Single User); 604.6 Flush Controls.	Flush Control - Location, not on the open side of water closet	1	Replace water closet and ensure that control will be on the open side of the water closet.
	12	2223	Restroom (Unisex), floor 3, Toilet, Restroom (Unisex)	Restroom (Single User); 604.2 Location.	Seat - Centerline Location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	2224	Restroom (Unisex), floor 3, Toilet, Restroom (Unisex)	Restroom (Single User); 606.3 Height.	Sink - Rim Height, greater than 34 inches	1	Relocate sink to be no higher than 34 inches. If necessary, replace the sink, ensuring it meets all requirements including forward approach, height, faucets, and is provided with insulated pipes.
	14	2225	Restroom (Unisex), floor 3, Toilet, Restroom (Unisex)	Restroom (Single User); 307 Protruding Objects.	Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	15	2231	Restroom (Unisex), floor 1	Restroom (Single User); 606.2 Clear Floor Space.	Seat - Clear Floor Space , not provided	1	Provide a compliant clear floor space.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	568	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	569	Play Area, Outside	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.
	3	570	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	571	Ashland avenue entrance , Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	572	Play Area, Outside, From path to Play Area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	809	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces. In this case, it could be considered to relocate the receptacle.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	810	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	967	Play Area, Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	9	871	Play Area, Outside, table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	10	872	Exterior, Far back corner , table	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.
	11	873	Exterior, Far back corner with tables, table	Dining/Work Surface; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the dining/work surface to the rest of the facility.
	12	1674	Play Area, Swings , Outside, size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	200	Side entrance , Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	2	201	Side entrance , Outside	Accessible Route; 404.2.10 Door and Gate Surfaces.	Door - Smooth surface, missing on the push side within 10 inches of finish floor	1	Remove current obstruction on gate. If necessary, replace door stop to ensure the bottom 10 inches is smooth.
	3	588	Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	4	719	Exterior, From path to bench nearby the fence	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	5	720	Play Area, Outside	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	815	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	816	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	831	Entrance, Outside, West Entrance	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	9	832	Play Area, Outside, North East Entrance	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	10	976	By the side entrance door , Outside	Drinking Fountain; 211.2 Minimum Number.	Low fountain, missing	2	Install a compliant low drinking fountain.
	11	977	By the side entrance door , Outside	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	12	880	Play Area, Outside , desk	Dining/Work Surface; 902.2 Clear Floor or Ground Space.	Clear Floor Space, not provided as several dimensional requirements for size, slope, or approach are not provided	2	Relocate the dining/work surface to ensure a compliant clear floor space is located on the short side. If necessary, reconfigure the room to have enough space to provide a compliant dining/work surface and clear floor space.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1694	Play Area, Outside , size: medium	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	225	Restroom (Women), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	2	226	Restroom (Men), floor 1	Accessible Route; 404.2.4 Maneuvering Clearances, figure i.	Door - Maneuvering Clearance - Latch Approach - Pull side - if closer is provided, perpendicular to doorway, less than 54 inches and/or parallel to doorway, less than 24 inches. (Case I)	1	Provide a compliant maneuvering clearance. If possible, remove the door to make a cased opening, relocate the door, or reconstruct the impediment to provide a compliant clearance.
	3	634	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	4	991	Exterior, floor 1	Drinking Fountain; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches and between 27 and 80 inches above finish floor	1	Install a drinking fountain apron to serve as cane detection.
	5	992	Exterior, floor 1	Drinking Fountain; 211.2 Minimum Number.	Low fountain, missing	2	Install a compliant low drinking fountain.
	6	1395	Room, floor 1, Cabinet	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	1396	Room, floor 1, Plumbing	Miscellaneous Element; 307 Protruding Objects.	Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Lower element, provide cane detection, or relocate to an alcove.
	8	1952	Restroom (Women), floor 1	Restroom (Multiple User); 604.7 Dispensers.	Wheelchair Accessible Compartment - Toilet Paper Dispenser - Distance from the WC (front) to the Dispenser Centerline, not between 7 and 9 inches	3	Replace toilet paper dispenser or relocate to a compliant location between 7 and 9 inches from the front of the water closet.
	9	1953	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Trash bin - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Relocate the trash bin to a location that provides cane detection or to be at a maximum height of 27 inches.
	10	1954	Restroom (Women), floor 1	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	11	1955	Restroom (Women), floor 1	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.
	12	1956	Restroom (Women), floor 1	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
 No image available	13	1957	floor 1, Men	Restroom (Multiple User); 604.2 Location.	Wheelchair Accessible Compartment - Seat - Centerline location, not between 16 and 18 inches from wall	1	Move the water closet seat to have the centerline between 16 and 18 inches from the adjacent wall.
	14	1958	floor 1, Men	Restroom (Multiple User); 603.4 Coat Hooks and Shelves.	Wheelchair Accessible Compartment - Coat Hook - Height, greater than 48 inches	3	Relocate coat hook to be no higher than 48 inches without reaching over an obstruction.
	15	1959	floor 1, Men	Restroom (Multiple User); 604.5.1 Side Wall.	Wheelchair Accessible Compartment - Rear Grab Bar - Distance from the centerline of the closet, less than 12 inches (one side), less than 24 inches (opposite side)	1	Relocate existing grab bar to compliant location at least 12 inches (one side), at least 24 inches (opposite side).
	16	1960	floor 1, Men	Restroom (Multiple User); 307 Protruding Objects.	Common Area - Hand Dryer - Protrusion Limits , greater than 4 inches, at a height between 27 and 80 inches	1	Provide cane detection for the hand dryer or relocate to a height lower than 27 inches.
	17	1961	floor 1, Men	Restroom (Multiple User); 305.2 Floor or Ground Surfaces.	Urinal - Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	1	Relocate adjacent partitions/wall to provide a compliant clear floor space.
	18	1962	floor 1, Men	Restroom (Multiple User); 603.3 Mirrors.	Common Area - Mirror above lavatories - Height , greater than 40 inches (bottom edge)	4	Relocate mirror to have the bottom of the reflective edge to be no more than 40 inches high.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	19	1963	floor 1, Men	Restroom (Multiple User); 606.5 Exposed Pipes and Surfaces.	Common Area - Sink - Water supply and drain pipes under lavatory, not configured to protect against contact	1	Install cover at exposed pipes.
	20	2415	Exterior, Restroom (Unknown)	Shower Compartment; 608.5.2 Standard Roll-In Type Shower Compartments.	Controls/Faucets/Shower Spray - Height, greater than 48 inches	3	Relocate controls to be no higher than 48".
	21	2458	Restroom (Women), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.
	22	2459	Restroom (Men), floor 1	Sign ; 703.1 General.	Sign, not to standards due to one or more reasons such as non compliant visual characters, proportions, contrast, pictograms, braille, size, and/or mounting location	2	Install compliant signage to identify the permanent room or space. Ensure the sign meets all requirements including visual characters, braille, and mounting height requirements.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	352	Entrance, floor 1, Entrance, exterior to interior	Accessible Route; 404.2.7 Door and Gate Hardware.	Door - Hardware - Operation, not operable with one hand and grasping, pinching, or twisting required.	1	Remove hardware and replace with lever type hardware that is operable with a closed fist and does not require tight grasping, pinching, or twisting.
	2	708	Entrance, floor 1	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.
	3	2351	Machinery Space, floor 1, Restroom (Unisex)	Restroom (Single User); 604.3.1 Size.	Multiple Elements in the restroom are not to accessibility standards.	1	Reconstruct the whole restroom, or build a new one compliant with the accessibility standards.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	598	Play Area, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	2	746	Dining Area, Outside, Sidewalk to dining area	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	836	Play Area, Outside, along the pathway nearby picnic area	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	4	1699	Outside , size: medium	Play Area; 1008.3.1 Transfer Platforms.	Transfer Platform, missing	3	Provide a compliant transfer platform.
	5	1703	Outside, size: small	Play Area; 1008.4.2 Clear Floor or Ground Space.	Play Component - Floor or Ground Surfaces - Surface, not stable, firm or slip resistant	3	Provide compliant walking surface.
	6	1704	Play Area, Outside, size: medium	Play Area; 1008.4.2 Clear Floor or Ground Space.	Play Component - Clear Floor Space - Changes in level, not permitted	3	Bevel walking surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	388	East entrance , Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	2	589	Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	3	833	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	590	Entrance, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	651	Play Area, Outside, Southwest corner of playground equipment	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	2	652	soccer/baseball field, Outside, sidewalk to field and bleachers	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	3	653	Exterior	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/4 and 1/2 inch	1	Bevel the change in level on the walking surface.
	4	688	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	5	689	Outside	Accessible Route; 403.3 Slope.	Walking Surface - Running slope, steeper than 5% (1:20)	1	Reconstruct the walking surface to have running slope less than 5% (1:20).
	6	789	Exterior	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	790	Exterior, soccer/baseball field, Baseball Field, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	793	Exterior, Baseball Field	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.
	9	801	Exterior	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	10	849	Exterior, near the entrance	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	11	850	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	12	851	Play Area, Outside	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1012	Play Area, Outside	Drinking Fountain; 602.2 Clear Floor Space.	Low Fountain, Clear Floor Space-Knee Clearance (Forward Approach)-Height, less than 27 inches as required	2	Relocate drinking fountain to provide compliant knee and toe clearance. If the existing fixture is unable to meet all requirements, replace the drinking fountain with a compliant fixture.
	14	1013	Play Area, Outside	Drinking Fountain; 211.2 Minimum Number.	High Fountain, missing	2	Install a compliant high drinking fountain.
	15	1716	Play Area, Outside, size: large	Play Area; 1008.2.6 Ground Surfaces.	Ground Surface - Maintenance - Use Levels, not to standards	3	Replace with compliant ground surface.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	384	Play Area, Outside	Accessible Route; 405.7.1 Slope.	Ramp - Top Landing - Slope, exceeds 2% (1:48) in all directions	1	Reconstruct top landing to not exceed 2% slope in any direction.
	2	385	Play Area, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	3	386	Play Area, Outside	Accessible Route; 405.2 Slope.	Ramp - Running slope, steeper than 8.33% (1:12)	1	Reconstruct ramp to have a maximum slope of 8.33%. Ramp to include compliant handrails on both sides with level landings.
	4	562	Play Area, Outside	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 1/2 and 3 inches	1	Reconstruct the walking surface to eliminate the vertical deflection.
	5	566	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).
	6	567	Play Area, Outside	Accessible Route; 403.3 Slope.	Walking Surface - Cross slope, steeper than 2% (1:48)	1	Reconstruct the walking surface to have cross slope less than 2% (1:48).

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	808	Play Area, Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.
	8	1669	Exterior, size: medium	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.
	9	1673	Play Area, Outside, size: small	Play Area; 240.2.2 Elevated Play Components	Elevated Play Component (50%), not connected by ramp or transfer system	3	Provide accessible route to the play component.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	751	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	2	778	Outside	Assembly Area; 221.1 General.	Wheelchair Space, missing	2	Provide compliant number of integrated wheelchair spaces.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	1	4	Exterior	Accessible Route; 406.2 Counter Slope.	Curb Ramp - Adjacent Surfaces at transitions at curb ramps, not at the same level	1	Provide a flush transition at the curb ramp.
	2	601	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings, greater than 1/2 inch	1	Reconstruct the ground surface to have less than a 1/2 inch opening.
	3	602	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	4	603	Exterior	Accessible Route; 302.3 Floor or Ground Surface.	Walking Surface - Openings (Maintenance), greater than 1/2 inch	1	Fill the openings to provide a level surface with less than a 1/2 inch opening.
	5	604	Exterior	Accessible Route; 403.2 Floor or Ground Surface.	Walking Surface - Surface - Overall condition, not stable, firm, and slip resistant	1	Provide compliant walking surface that is stable, firm, and slip resistant.
	6	728	Exterior, Fishing Dock	Accessible Route; 403.4 Changes in Level.	Walking Surface - Changes in level, between 3 and 6 inches	1	Add ramp. No handrails required if the vertical change is 6 inches or less.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	7	788	Exterior, Basketball Court, From path to basket court	Assembly Area; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the wheelchair space to the rest of the facility.
	8	985	Exterior	Drinking Fountain; 211.2 Minimum Number.	Low fountain, missing	2	Install a compliant low drinking fountain.
	9	1047	Exterior	Fishing Pier and Platform; 1005.3.2 Extended Ground or Deck Surface.	Toe Clearance (Forward Approach) - Height, less than 9 inches	4	Provide compliant Toe Clearance (Forward Approach).
	10	1385	Exterior, Little Free Library	Miscellaneous Element; 305.2 Floor or Ground Surfaces.	Clear Floor Space , not provided as several dimensional requirements for size, slope, or approach are not provided	1	Reconstruct or relocate the element to provide a compliant clear floor space.
	11	1386	Exterior, picnic table and grill	Miscellaneous Element; 206.2.2 Within a Site	Accessible Route, missing	1	Construct an accessible route that connect the element to the rest of the facility.
	12	1711	Play Area, Outside, size: large	Play Area; 1008.3.1.4 Transfer Supports.	Transfer Platform - Mean of Support, missing	3	Replace with compliant transfer platform.

PHOTO	REPORT ID	GIS ID	LOCATIONS	ELEMENTS; CODES	BARRIERS	PRIORITY	RECOMMENDED ACTION
	13	1712	Play Area, Outside, size: large	Play Area; 206.2.17 Paly Areas	Accessible Route, missing	1	Contract an accessible route that connect the receptacle to the rest of the facility.
	14	1713	Play Area, Outside, size: medium	Play Area; 1008.4.4 Entry Points and Seats.	Entry Point/Seat - Height, not between 11 and 24 inches	3	Replace with a compliant entry point/seat.

Appendix 5 - PSA Checklist

Programs, Services, and Activities Checklist

Requirement	Yes	No	Comments
1) Ensure that the program is provided at an accessible location. At a minimum, this includes: • Accessible route from the parking lot or bus stop location all the way to the program meeting space. • Accessible parking spaces per standards. • At least one accessible restroom available for program meeting space, if also available to general public. • Accessible amenities such as drinking fountains, flashing fire alarms, as available to general public.			
2) Ensure the website and content, along with all electronic and digital communications, meet WCAG2.1, at a minimum. This includes all forms and other supporting documents. In the Department of Justice's technical information publication, <i>Accessibility of Web Information and Services of State and Local Government Entities and Public Accommodations</i>, resources are listed to provide guidance for web developers designing accessible web pages. https://www.ada.gov/websites2.htm			
3) Ensure that the application process is accessible to persons with disabilities either in person or via the website. For program access, any application for participation to a program should include the Notice of Compliance with contact information to obtain accommodations. Examples of accommodations include: • Assistance in filling out an application form for an individual who is blind or someone who has an intellectual disability. • Sign Language Interpreters . • Accessible website if applications are online.			

Programs, Services, and Activities Checklist

4) Ensure that the process, brochure, or other City document has the Equal Employment Statement to provide reasonable accommodations. Example Statement from the City of Austin: The City of Austin does not discriminate on the basis of disability in the admission or access to, treatment or employment in, its programs or activities. Reasonable accommodations will be provided upon request in the employment process. Contact information: names, phone numbers and email addresses Examples of accommodations include: • Assistance with filling out an employment application form for an individual who is blind or someone who has an intellectual disability. • Sign Language Interpreters for the interview process. • Ensure an accessible website if applications are available online. • Accessible location for the interview process.			
5) Ensure that all contractors abide by their ADA responsibilities. The general nondiscrimination requirement and all of Title II apply whether a public entity provides the program, service, or activity itself or is contracting with another entity to do so. Public entities must make sure the private business or organization they are contracting with uphold the same level of obligation as the public entity itself. Example: If the City contracts with an organization to provide a bicycle safety class for residents and a resident requests a Sign Language Interpreter, the contracting organization is responsible for providing it, at no additional cost to the resident.			

6) Ensure effective communication with people with disabilities during emergency situations.

Issues that have the greatest impact on people with disabilities include:

- Notification - Many traditional emergency notification methods are not accessible to or usable by people with disabilities. People who are deaf or hard of hearing cannot hear radio, television, sirens, or other audible alerts. Those who are blind or who have low vision may not be aware of visual cues, such as flashing lights. Warning methods should be developed to ensure that all residents will have the information necessary to make sound decisions and take appropriate, responsible action.
- Evacuation – People with a mobility disability may need assistance leaving a building without a working elevator. People who are blind may not be able to use traditional orientation and navigation methods. A person who is deaf may be trapped and unable to communicate because the only communication device relies on voice. Procedures should be in place to ensure that people with disabilities can evacuate the physical area under different conditions.
- Emergency transportation - Accessible transportation may be needed to evacuate people with disabilities. Some communities have used lift-equipped school to evacuate people who use wheelchairs during floods.
- Medication, refrigeration, and back-up power - A reasonable number of shelters should have back-up generators and a way to keep medications in a refrigerator or a cooler with ice. These shelters should be made available on a priority basis to people who require access to electricity and refrigeration, for example, for using life-sustaining medical devices, providing power to motorized wheelchairs, and preserving medications.

Programs, Services, and Activities Checklist

• Locations of accessible emergency shelters and other shelters with specific feature - The public should be notified about the location of these shelters. Emergency personnel need lists of where they are and information should be easily found on websites. • Service animals - People with disabilities who use service animals should not be separated from their service animals, even if pets are not permitted. Service animals are the responsibility of their handlers who must keep them under control at all times. • Access to information - Communication must be accessible for people who are deaf or hard of hearing. Staff and volunteers should be trained on basic ways to provide accessible communication, including exchanging notes or posting written announcements to go with spoken announcements. Staff and volunteers should read printed information, upon request, to people who are blind or who have low vision.			
7) Include policy guidelines and training for assisting persons using service animals. Ensure staff is aware of service animal policies When it is not obvious what service a dog provides, a public entity may ask two questions: 1. Is the dog a service animal required because of a disability? 2. What work or task has the dog been trained to perform? Examples of tasks service animals (dogs) can be trained to perform include: • Guiding a person who is blind. • Providing stability for a person who has difficulty walking. • Alerting a person who has hearing loss when someone is approaching from behind.			

Programs, Services, and Activities Checklist

• Picking up items for a person who uses a wheelchair. • Preventing a child with autism from wandering away. • Alerting and protecting a person who is having a seizure. • Reminding a person with mental illness to take prescribed medications. • Calming a person with Post Traumatic Stress Disorder (PTSD) during an anxiety attack. Title II makes a distinction between psychiatric service animals and emotional support animals. Example: If a dog has been trained to sense an oncoming anxiety attack and acts to help avoid the attack or lessen its impact, the dog would qualify as a service animal. However, if the dog's mere presence provides comfort, that would not be considered a service animal. People with disabilities are not required to use a professional training program; they have the right to train the dogs themselves. A public entity cannot require medical documentation of disability, a service animal identification card, a special vest or training documentation.			
8) Ensure Notice of Compliance to program information on web pages, brochures, reports, or any City communications. Title II entities must provide information to the public, program participants, program beneficiaries, applicants, and employees about the ADA and how it applies to the public entity. Example of Notice of Compliance: <i>Americans with Disabilities Act</i>			



Programs, Services, and Activities Checklist



The [Name of public entity] does not discriminate because of disability in its programs, services, activities, and employment practices. If you need auxiliary aids and services for effective communication (such as a sign language interpreter, an assistive listening device or print material in digital format) or a reasonable modification in programs, services or activities contact the ADA Coordinator as soon as possible, preferably XX days before the activity or event. A grievance procedure is available to resolve complaints. Upon request, this notice is available in alternative formats such as large print or Braille. [ADA Coordinator name and contact information] Examples of Alternative Formats and Auxiliary Aids and Services For people who are deaf or have hearing loss: • qualified interpreters on-site or through video remote interpreting (VRI) services • real-time computer-aided transcription services (CART) • written materials • exchange of written notes • typing on a tablet or computer • assistive listening devices • open and closed captioning, including real-time captioning • videophones • videotext displays For people who are blind or have vision loss: • large print materials • audio recordings • Braille materials • screen reader software • magnification software			

Programs, Services, and Activities Checklist

• notetakers • qualified readers • optical readers • secondary auditory programs (SAP) For people who have speech disabilities: • exchange of written notes or typed communication • qualified speech-to-speech transliterators (a person trained to recognize unclear speech and repeat it clearly) Public entities are required to ensure that interested people, including people with vision or hearing impairments, can obtain information as to the “existence and location of accessible services, activities, and facilities.” Entities must have a process in place in order to provide these accommodations. Example: A City Managers’ office receives a call from a new resident who uses a wheelchair. The resident would like to know which City facilities are accessible (and which are not) and where the accessible entrances are. The City Manager's administrative assistant can provide that information because the ADA Coordinator created a list of the accessibility features in all facilities. The list is on the City’s website and the ADA Coordinator sent an email to all staff with the link.			
9) Ensure effective communication with related processes for provision of alternative formats. The Notice of Compliance, addressed above, provides information to residents regarding the provision of alternative formats and auxiliary aids and services. As a result, the City must have a process in place to ensure residents are provided information in a timely manner. The process can stipulate the time frame for provision of alternative formats and justification if a different format will be provided or if requested alternative format is deemed undue hardship.			



Programs, Services, and Activities Checklist



Public entities are required to give primary consideration to the type of auxiliary aid or service requested by the person with the disability unless they can demonstrate that another equally effective means of communication is available or that the aid or service requested would fundamentally alter the nature of the program, service, or activity or would result in undue financial and administrative burdens. The type of auxiliary aid or service will vary in accordance with the method of communication used by the person; the nature, length, and complexity of the communication and the context in which the communication occurs. Example: What is required to communicate effectively when a person is registering for a composting class is very different from what is required to communicate effectively in a court proceeding. The auxiliary aid or service must be effective. If a public entity chooses Video Remote Interpreting (VRI – where the interpreter is off-site and communication occurs with computer equipment) rather than face-to-face, the public entity must make sure the quality is comparable. The regulations include specific performance standards for VRI.			
10) Ensure Notice of Compliance is provided for all public meetings, boards & commissions, and City sponsored event notifications. The Notice of Compliance, addressed above, must also be included in all public meetings, boards & commissions, and City sponsored events. Meetings should be conducted in accessible locations. See information on accessible locations above.			



Programs, Services, and Activities Checklist



11) Ensure that the process for participating in the program including training, classes, camps, etc., and related activities is accessible to persons with disabilities through reasonable modifications and communications. The Notice of Compliance, addressed above, provides information to residents regarding the provision of reasonable modifications for participation in programs. As a result, the City must have a process in place to ensure residents are provided reasonable modifications, in a timely manner. The process can stipulate the time frame for provision of modifications and justification if alternate modification will be provided or if requested modification is deemed undue hardship.			

Appendix 6 - PSA Reviews

City Manager's Office	Ensure accessible location	Ensure website and content i.e. all electronic and digital communications, meets WCAG2.1, at a minimum. This includes all forms and other supporting documents.	Ensure that the application process is accessible to persons with disabilities.	Ensure Equal Employment Statement to provide reasonable accommodations	Ensure that all contractors abide by their ADA responsibilities	Ensure effective communication during emergency situations.	Include service animal guidelines;ensure staff aware.	Provide Notice of Compliance on all City communications i.e.web pages, brochures, reports.	Ensure effective communication for provision of alternative formats.	Ensure Notice of Compliance is provided for all public meetings, boards & commissions, and City sponsored event notifications.	Ensure that process for participating in the program including training, classes, camps, and related activities is accessible to persons with disabilities through reasonable modifications and communications.
Diversity and Inclusion (D&I) Staff Committee	X	X	X						X	X	
Administrative Hearings	X	X	X					X	X	X	
Small Business Mentoring Program	X	X	X	X				X	X	X	X
Racial Equity Diversity Inclusion (REDI) Committee	X	X	X						X	X	
Budget Conversations Seminars	X	X	X						X	X	X
Climate Action and Resilience Plan (CARP)		X						X	X		
COVID-19 Small Business Program	X	X	X	X				X	X	X	X

Community Development	Ensure accessible location	Ensure website and content i.e. all electronic and digital communications, meets WCAG2.1, at a minimum. This includes all forms and other supporting documents.	Ensure that the application process is accessible to persons with disabilities.	Ensure Equal Employment Statement to provide reasonable accommodations	Ensure that all contractors abide by their ADA responsibilities	Ensure effective communication during emergency situations.	Include service animal guidelines;ensure staff aware.	Provide Notice of Compliance on all City communications i.e.web pages, brochures, reports.	Ensure effective communication for provision of alternative formats.	Ensure Notice of Compliance is provided for all public meetings, boards & commissions, and City sponsored event notifications.	Ensure that process for participating in the program including training, classes, camps, and related activities is accessible to persons with disabilities through reasonable modifications and communications.
Property Maintenance		X			X			X			
Building and Inspection Services		X			X			X			
Transportation and Mobility	X	X	X			X		X	X		X
Plan Commission	X	X	X			X		X			
Historic Preservation	X	X	X					X	X		X
Zoning Service Application and Review	X	X	X								X
Design and Project Review Committee	X	X	X					X	X		
Housing and Community Development Committee	X	X	X			X		X	X		
Social Services Committee	X	X	X		X	X		X	X		
Plan Commission	X	X	X					X	X		
Planning and Development Committee	X	X	X					X	X		
Preservation Commission	X	X	X					X	X		
Zoning Board of Appeals	X	X	X					X	X		
Zoning Committee to the Plan Commission	X	X	X					X	X		
Housing Rehab Loans		X	X		X			X	X		X
Landlord and Tenant Resources		X						X	X		
Homeowner Resources		X	X					X	X		
Community Development Block Grant		X	X		X						X
HUD Consolidated Action Plan		X						X	X		
Affordable Housing	X	X	X					X	X		X
Vacant Building		X	X					X			
Rental Registration		X	X					X			
Comprehensive Plan		X						X	X		
Area Planning		X						X	X		

Fire Department	Ensure accessible location	Ensure website and content i.e. all electronic and digital communications, meets WCAG2.1, at a minimum. This includes all forms and other supporting documents.	Ensure that the application process is accessible to persons with disabilities.	Ensure Equal Employment Statement to provide reasonable accommodations	Ensure that all contractors abide by their ADA responsibilities	Ensure effective communication during emergency situations.	Include service animal guidelines; ensure staff aware.	Provide Notice of Compliance on all City communications i.e. web pages, brochures, reports.	Ensure effective communication for provision of alternative formats.	Ensure Notice of Compliance is provided for all public meetings, boards & commissions, and City sponsored event notifications.	Ensure that process for participating in the program including training, classes, camps, and related activities is accessible to persons with disabilities through reasonable modifications and communications.
Evanston Fire Department Firefighter Training	X	X			X				X		X
Evanston Fire Department Special Operations Training	X	X			X				X		X
Evanston Fire Department Paramedic Training	X	X			X				X		X
Plan Review	X	X	X		X			X	X	X	X
Fire Investigation		X						X	X		X
Life & Safety Education		X							X		X
Fire Compliance, Business, and Occupancy Inspections		X						X	X		X
Fire Suppression		X						X	X		X
Emergency Medical Services		X						X	X		X
Special Rescue Operations		X						X	X		X
Community Service (block parties, File of Life, etc.)	X	X	X		X			X	X		X
Premise Alert Program		X	X					X	X		X
File of Life		X	X					X	X		X
Fire Explorer Training	X	X	X		X			X	X		X
Citizen's Fire Academy	X	X	X		X			X	X		X
CPR Training	X	X	X		X			X	X		X
Emergency Preparedness Series (NEW)	X	X	X		X			X	X		X
Community Emergency Response Team (CERT) Training and Special Event Participation	X	X	X		X			X	X	X	X
Emergency Preparedness Fair (NEW)	X	X	X		X			X	X	X	X

Health and Human Services	Ensure accessible location	Ensure website and content i.e. all electronic and digital communications, meets WCAG2.1, at a minimum. This includes all forms and other supporting documents.	Ensure that the application process is accessible to persons with disabilities.	Ensure Equal Employment Statement to provide reasonable accommodations	Ensure that all contractors abide by their ADA responsibilities	Ensure effective communication during emergency situations.	Include service animal guidelines; ensure staff aware.	Provide Notice of Compliance on all City communications i.e. web pages, brochures, reports.	Ensure effective communication for provision of alternative formats.	Ensure Notice of Compliance is provided for all public meetings, boards & commissions, and City sponsored event notifications.	Ensure that process for participating in the program including training, classes, camps, and related activities is accessible to persons with disabilities through reasonable modifications and communications.
Public Health (inclds Permits, Licenses, food safety, Human Services (General and Emergency Assistance)	X	X	X		X	X		X	X		X
Public Health	X	X	X		X	X		X	X		X
Permits and Licenses (Food safety/Food Protection)		X	X		X						X
Pest Control		X	X		X			X	X		X
Communicable Diseases, Public Health Emergency Preparedness, Human Services		X	X		X	X	X	X	X		X
General Assistance and Emergency Assistance	X	X	X		X	X		X	X		X
Community Services	X	X	X		X			X	X	X	X
Youth and Young Adult Services	X	X	X		X			X	X	X	X
Victim and Youth Services	X	X	X		X			X	X		X
Senior Services	X	X	X		X			X	X	X	X
Community Services (Youth and Young Adult and Senior Services)	X	X	X		X			X	X	X	X
Community Member Relief Assistance	X	X	X		X			X	X		X
Mayor's Summer Youth Employment Program	X	X	X	X	X			X	X	X	X

Appendix 7 - Glossary

2010 Standards for Accessible Design – Revised regulations for Titles II and III of the Americans with Disabilities Act of 1990, which set minimum requirements – both scoping and technical – for newly designed and constructed or altered State and local government facilities, public accommodations, and commercial facilities to be readily accessible to and usable by individuals with disabilities.

Title 38 of the Code of Federal Regulations – Principal set of rules and regulations issued by federal agencies regarding pensions, bonuses, and veterans’ relief. Includes Book C, Schedule for Rating Disabilities.

Americans with Disabilities Act – Signed into law on July 26, 1990, the ADA is a wide-ranging civil rights law that prohibits, under certain circumstances, discrimination based on disability. It affords similar protections against discrimination to Americans with disabilities as the Civil Rights Act of 1964, which made discrimination based on race, religion, sex, national origin, and other characteristics illegal.

1. **Title I**—Employment – Equal employment opportunity for individuals with disabilities. Of the five titles of the Americans with Disabilities Act, Title I of the ADA pertains to Employment. Under ADA Title I, covered entities shall not discriminate against a qualified individual with a disability. This applies to job application procedures, hiring, advancement and discharge of employees, worker's compensation, job training, and other terms, conditions, and privileges of employment.
2. **Title II**—State and Local Government – Nondiscrimination on the basis of disability in state and local government services. Of the five titles of the Americans with Disabilities Act, Title II of the ADA pertains to State and Local Government (public entities). ADA Title II requires agencies to comply with regulations similar to Section 504 of the Rehabilitation Act. These rules cover access to all services, programs, and activities offered by the public entity, and extends coverage to public transportation entities. Access includes physical access described in the Uniform Federal Accessibility Standards or the ADA Standards for Accessible Design and access that might be obstructed by discriminatory policies or procedures of the entity.
3. **Title III**—Public Accommodations – Nondiscrimination on the basis of disability by public accommodations and in commercial facilities. Of the five titles of the Americans with Disabilities Act, Title III of the ADA pertains to Public Accommodations (private entities). Under ADA Title III, no individual may be discriminated against on the basis of disability with regards to the full and equal enjoyment of the goods, services, facilities, or accommodations of any place of public accommodation by any person who owns, leases (or leases to), or operates a place of public accommodation.
4. **Title IV**—Telecommunications. Of the five titles of the Americans with Disabilities Act, Title IV of the ADA pertains to Telecommunications. ADA Title IV addresses telephone and television access for individuals with hearing and speech disabilities. Specific requirements under Title IV include closed captioning of Federally funded public service announcements, and telephone companies must establish in-state

and state-to-state telecommunications relay services (TRS) 24 hours a day, 7 days a week.

5. **Title V-Miscellaneous Provisions.** Of the five titles of the Americans with Disabilities Act, Title V of the ADA pertains to miscellaneous provisions, most of which apply to all titles of the ADA.

Alterations – Change in a building or facility that affects, or could affect, the usability of a building or facility or a portion thereof.

Alternative Formats – A different means of delivering the same information to make that information more accessible to people with disabilities.

Americans with Disabilities Act Accessibility Guidelines (ADAAG) – Guidelines drafted by the Access Board that describe the minimum requirements that a building should exhibit in order to be accessible.

Architectural Barriers – Obstacles or other features in the built environment that impede individuals with disabilities from gaining full and complete access to the goods and services being provided.

Braille – A tactile writing system for those who are visually impaired.

Budgeted Cost – A forecasted future expense that is expected to be incurred in the future.

Built Facility Entrance – Any access point to a building or portion of a building or facility used for the purpose of entering. An entrance includes the approach walk, the vertical access leading to the entrance platform, the entrance platform itself, vestibules if provided, the entry door(s) or gate(s), and the hardware of the entry door(s) or gate(s).

Captioning – A title, short explanation, or description accompanying an illustration or a photograph; process of displaying text on a visual display to provide additional or interpretive information.

Circulation path – defined by ADAAG § 106 as passages (exterior or interior) for pedestrians, such as “walks, hallways, courtyards, elevators, platform lifts, ramps, stairways, and landings.” Thus, an area connecting to a corridor or a particular room may be a circulation path.

Comfort Animal – Animals whose sole function is to provide comfort or emotional support do not qualify as service animals under the ADA. However, some State or local governments have laws that allow people to take emotional support animals into public places.

Department of Justice (DOJ) – Federal agency that has the authority to enforce all provisions of the Americans with Disabilities Act, but focuses primarily on ADA Title II (public services by State and local government) and ADA Title III (public accommodations).

Equal Employment Opportunity Commission (EEOC) – Federal agency primarily responsible for enforcement of Title I of the Americans with Disabilities Act, which deals with employment discrimination.

Effective Communication – Ensuring the communication between the entity and people with disabilities is equally effective as that between the entity and people without disabilities.

Eligibility Criteria – Standards or characteristics that must be shared by all participants.

Emergency Egress – An unobstructed path to leave buildings, structures, and spaces. A means of egress is comprised of exit access, exit, and exit discharge.

Employee Work Area – All or any portion of a space used only by employees and used only for work. Corridors, toilet rooms, kitchenettes and break rooms are not employee work areas.

Equivalent Facilitation – Acceptable deviations from the standards where alternative designs and technologies will provide substantially equivalent or greater access to and usability of the facility.

Facility – All or any portion of buildings, structures, site improvements, complexes, equipment, roads, walks, passageways, parking lots, or other real or personal property located on site.

Geographic Information Systems (GIS) – A framework for gathering, managing, and analyzing data. Rooted in the science of geography, GIS integrates many types of data. It analyzes spatial location and organizes layers of information into visualizations using maps and 3D scenes. With this unique capability, GIS reveals deeper insights into data, such as patterns, relationships, and situations—helping users make smarter decisions.

Large Print – Formatting of a book or other text document in which the typeface and sometimes the medium are considerably larger than usual to accommodate people who have vision impairments.

Machinery Spaces – Spaces frequented only by service personnel for maintenance, repair, or occasional monitoring of equipment shall not be required to comply with these requirements or to be on an accessible route. Machinery spaces include, but are not limited to, elevator pits or elevator penthouses; mechanical, electrical or communications equipment rooms; piping or equipment catwalks; water or sewage treatment pump rooms and stations; electric substations and transformer vaults; and highway and tunnel utility facilities.

Ordinances – Legislation enacted by a municipal authority.

Policies and Procedures - Policies are the principles and guidelines that a City implements to help it reach its long-term goals towards ADA compliance. Procedures are the specific methods City staff should follow to ensure compliance of the policy.

Professional Designer – An architect or engineer, or both, duly licensed for professional practice.

Program Access – A public entity’s services, programs, or activities, when viewed in their entirety, must be readily accessible to and usable by individuals with disabilities.

Programs, Services, and Activities (PSAs) – All the operations of a department or any entity representing a municipality that are available to the public.

Public Meeting – Held to engage a wide audience in information sharing and discussion in order to increase awareness of an issue or proposal.

Public Right-of-Way (ROW) – Any public thoroughfare such as a street, road, or alley. It usually includes the median, utility poles, sidewalks, and the area immediately adjacent to the street.

Reasonable Accommodation – A modification or adjustment to a job, the work environment, or the way things usually are done that enables a qualified individual with a disability to enjoy an equal employment opportunity, and does not create an undue financial or administrative hardship to the municipality, fundamentally alter the job, or create a direct threat to others or safety issue to the employee. They may include but are not limited to:

1. Modifications or adjustments to a job application process that enable a qualified applicant with a disability to be considered for the position such qualified applicant desires; or
2. Modifications or adjustments to the work environment, or to the manner or circumstances under which the position held or desired is customarily performed, that enable a qualified individual with a disability to perform the essential functions of that position; or

3. Modifications or adjustments that enable a covered entity's employee with a disability to enjoy equal benefits and privileges of employment as are enjoyed by its other similarly situated employees without disabilities.

Safe Harbor (for technical standards) – Elements in covered facilities that were built or altered in compliance with the 1991 Standards would not be required to be brought into compliance with the 2010 Standards until the elements were subject to a planned alteration. A similar safe harbor applies to elements associated with the "path of travel" to an altered area.

Self-Evaluation – Public entity's assessment of everything, including its programs, services, and activities; facilities; and current policies, practices, and procedures in order to identify and correct barriers to access that are inconsistent with Title II requirements.

Service Animal – A dog or miniature horse that is individually trained to do work or perform tasks for a person with a disability. The work or task the animal has been trained to provide must be directly related to the person's disability.

Structurally Impracticable – Unique characteristics of the land prevent the incorporation of accessibility features in a facility.

Technical Infeasibility – With respect to an alteration of a building or a facility, something that has little likelihood of being accomplished because existing structural conditions would require removing or altering a load-bearing member that is an essential part of the structural frame; or because other existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with the minimum requirements.

Temporary Events – Under Titles II and III of the ADA, it is expected that all participants will be able to experience full enjoyment of events.

Third Party Vendors – A noncity entity that is contracted to perform a specific task, service, or product.

Transit Stops – Bus stops, rail stations, and platforms, etc.

Undue Burden – Significant difficulty or expense. A public accommodation is not required to provide any auxiliary aid or service that would result in an undue burden.

Undue Hardship – An action that requires "significant difficulty or expense" in relation to the size of the employer, the resources available, and the nature of the operation. The concept of undue hardship includes any action that is unduly costly, extensive, substantial, disruptive, or would fundamentally alter the nature or operation of the business. Accordingly, whether a particular accommodation will impose an undue hardship must always be determined on a case-by-case basis.

Undue Financial and Administrative Burden – A public entity does not have to take any action that it can demonstrate would result in an undue financial and administrative burden. This applies in program accessibility, effective communication, and auxiliary aids and services. The determination of an undue financial and administrative burden must be:

1. Made by the head of the public entity or his/her designee
2. Accompanied by a written statement of the reasons
3. Based on all resources available for use in the program

US Access Board – Federal agency that develops and maintains design requirements for the built environment, transportation vehicles, telecommunications equipment, and information technology.

Web-content accessibility guidelines (WCAG) – Web Content Accessibility Guidelines (WCAG) is developed through the [W3C process](#) in cooperation with individuals and organizations around the world, with a goal of providing a single shared standard for web content accessibility that meets the needs of individuals, organizations, and governments internationally.

Appendix 8 - List Of Prioritized Facilities

Facility	Number of PSAs	PSAs Score	Facility Type	Facility Category	Facility Category Score	Polling Place Score	Pubic Input Score	FINAL SCORE
Civic Center	32	4	Citywide Services	cws	10	5	5	565
Robert Crown Community Center	408	5	Community Center	cmc	8	5	5	540
Levy Senior Center	186	5	Community Center	cmc	8	5	5	540
Noyes Cultural Arts Center	50	4	Community Center	cmc	8	5	5	505
Fleetwood-Jourdain Center	29	4	Community Center	cmc	8	5	5	505
Chandler-Newberger	204	5	Community Center	cmc	8	5	0	465
Evanston Ecology Center	30	4	Community Center	cmc	8	5	0	430
James Park	30	4	Recreation Field House	rfh	7	0	5	425
Main Library	5	2	Libraries	lib	9	0	5	415
Clark St Beach / Centennial Park	14	3	Community Park	cp	6	0	5	360
Leahy Park	50	4	Recreation Field House	rfh	7	0	0	350
Dempster Launch Facility	47	4	Recreation Field House	rfh	7	0	0	350
Gibbs-Morrison Center	16	3	Community Center	cmc	8	0	0	345
Lighthouse Beach	8	2	Community Park	cp	6	0	5	325
Lovelace Park	43	4	Community Park	cp	6	0	0	320
Fog Houses	3	2	Recreation Field House	rfh	7	0	0	280
Baker Park	18	3	Neighborhood Park	np	5	0	0	255
Bent Park	14	3	Neighborhood Park	np	5	0	0	255
Community Gardens	9	2	Community Park	cp	6	0	0	250
Mason Park	8	2	Community Park	cp	6	0	0	250
Dawes Park / Greenwood Beach	7	2	Community Park	cp	6	0	0	250
Fountain Square	7	2	Community Park	cp	6	0	0	250
Elliott Park	5	2	Community Park	cp	6	0	0	250
Tallmadge Park	4	2	Community Park	cp	6	0	0	250
Butler Park	3	2	Community Park	cp	6	0	0	250
Harbert Park	3	2	Community Park	cp	6	0	0	250
Evanston Fire Department HQ	2	1	Police and Fire Services	pof	4	0	5	230
Evanston Fire Department Buildings	1	1	Police and Fire Services	pof	4	0	5	230
Evanston Police Department	1	1	Police and Fire Services	pof	4	0	5	230
Ackerman Park	7	2	Neighborhood Park	np	5	0	0	220
Independence Park	4	2	Neighborhood Park	np	5	0	0	220
Larimer Park	4	2	Neighborhood Park	np	5	0	0	220
Raymond Park	4	2	Neighborhood Park	np	5	0	0	220
Cartwright Park	3	2	Neighborhood Park	np	5	0	0	220
Ingraham Park	6	2	Neighborhood Park	np	5	0	0	220
Burnham Shores Park	2	1	Community Park	cp	6	0	0	215
Ladd Arboretum	2	1	Community Park	cp	6	0	0	215
Beck Park	1	1	Community Park	cp	6	0	0	215
Clark Square	1	1	Community Park	cp	6	0	0	215
Chandler Park	1	1	Neighborhood Park	np	5	0	0	185
Foster Park	2	1	Neighborhood Park	np	5	0	0	185
Eggleston Park	1	1	Neighborhood Park	np	5	0	0	185
Eiden Park	1	1	Neighborhood Park	np	5	0	0	185
Garden Park	1	1	Neighborhood Park	np	5	0	0	185
Penny Park	1	1	Neighborhood Park	np	5	0	0	185